

Fax To: Benchmark Environmental, PLLC  
Contact: Bryan Hann  
Fax : 716-856-0583  
Date: 04/17/2003

Fax From: Erik Terranova  
EDR  
Phone: 1-800-352-0050

## EDR PUR-IQ<sup>®</sup> Report

*"the intelligent way to conduct historical research"*

for  
Buffalo Weaving and Belting Co  
260 Chandler Street  
Buffalo, NY 14207  
Lat./Long. 42.94350 / 78.88520  
EDR Inquiry # 0962135.1s

The EDR PUR-IQ report facilitates historical research planning required to complete the Phase I ESA process. The report identifies the *likelihood* of prior use coverage by searching EDR's proprietary historical source(s) database comprising nationwide information on: city directories, fire insurance maps, aerial photographs, historical topographic maps, flood maps and National Wetland Inventory maps.

**Potential for EDR Historical (Prior Use) Coverage** - Coverage in the following historical information sources may be used as a guide to develop your historical research strategy:

1. **City Directory:** Coverage exists for portions of BUFFALO, NY for 1959, 1998, 61, 62, 64-68, 70-77, 82, 85, 86, 87, 90, 92
2. **Fire Insurance Map:** When you order online any ASTM 2000 Package, or an EDR Radius Map with a Sanborn Map Search/Print, you receive site specific Sanborn Map coverage information at no charge.
3. **Aerial Photograph:** 1959, 1966, 1978, 1980, 1981, 1982, 1983, 1994, 1995 Shipping time 3-5 business days.
4. **Topographic Map:** The USGS 7.5 min. quad topo sheet(s) associated with this site:


Historical: Coverage exists for Erie County

Current: Target Property: 2442078-H8 Buffalo NW, NY CA10

Additional required for 1 Mile radius: 2442078-H7 Buffalo NE, NY

EDR's network of professional researchers, located throughout the United States, accesses the most extensive national collections of city directory, fire insurance maps, aerial photographs and historical topographic map resources available for Buffalo, NY. These collections may be located in multiple libraries throughout the country. To ensure maximum coverage, EDR will often assign researchers at these multiple locations on your behalf. Please call or fax your EDR representative to authorize a search.

321320





## **The EDR Radius Map with GeoCheck®**

**Buffalo Weaving and Belting Co  
260 Chandler Street  
Buffalo, NY 14207**

**Inquiry Number: 0962135.1s**

**April 17, 2003**

## ***The Source For Environmental Risk Management Data***

**3530 Post Road  
Southport, Connecticut 06890**

### **Nationwide Customer Service**

**Telephone: 1-800-352-0050  
Fax: 1-800-231-6802  
Internet: [www.edrnet.com](http://www.edrnet.com)**

## TABLE OF CONTENTS

<u>SECTION</u>	<u>PAGE</u>
Executive Summary.....	ES1
Overview Map.....	2
Detail Map.....	3
Map Findings Summary.....	4
Map Findings.....	6
Orphan Summary.....	122
EPA Waste Codes.....	EPA-1
Government Records Searched/Data Currency Tracking.....	GR-1
 <b><u>GEOCHECK ADDENDUM</u></b>	
Physical Setting Source Addendum.....	A-1
Physical Setting Source Summary.....	A-2
Physical Setting Source Map.....	A-6
Physical Setting Source Map Findings.....	A-7
Physical Setting Source Records Searched.....	A-13

***Thank you for your business.***  
Please contact EDR at 1-800-352-0050  
with any questions or comments.

### Disclaimer

#### Copyright and Trademark Notice

*This report contains information obtained from a variety of public and other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL EDR BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OR DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES.*

*Entire contents copyright 2003 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.*

*EDR and the edr logos are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.*

## EXECUTIVE SUMMARY

A search of available environmental records was conducted by Environmental Data Resources, Inc. (EDR). The report meets the government records search requirements of ASTM Standard Practice for Environmental Site Assessments, E 1527-00. Search distances are per ASTM standard or custom distances requested by the user.

### TARGET PROPERTY INFORMATION

#### ADDRESS

260 CHANDLER STREET  
BUFFALO, NY 14207

#### COORDINATES

Latitude (North): 42.943500 - 42° 56' 36.6"  
Longitude (West): 78.885200 - 78° 53' 6.7"  
Universal Transverse Mercator: Zone 17  
UTM X (Meters): 672539.4  
UTM Y (Meters): 4756495.5

### USGS TOPOGRAPHIC MAP ASSOCIATED WITH TARGET PROPERTY

Target Property: 2442078-H8 BUFFALO NW, NY CA10  
Source: USGS 7.5 min quad index

### TARGET PROPERTY SEARCH RESULTS

The target property was not listed in any of the databases searched by EDR.

### DATABASES WITH NO MAPPED SITES

No mapped sites were found in EDR's search of available ( "reasonably ascertainable ") government records either on the target property or within the ASTM E 1527-00 search radius around the target property for the following databases:

### FEDERAL ASTM STANDARD

NPL..... National Priority List  
Proposed NPL..... Proposed National Priority List Sites  
CERC-NFRAP..... CERCLIS No Further Remedial Action Planned  
CORRACTS..... Corrective Action Report  
RCRIS-TSD..... Resource Conservation and Recovery Information System  
RCRIS-LQG..... Resource Conservation and Recovery Information System  
ERNS..... Emergency Response Notification System

### STATE ASTM STANDARD

SWF/LF..... Facility Register



## EXECUTIVE SUMMARY

CBS UST..... Chemical Bulk Storage Database  
MOSF UST..... Major Oil Storage Facilities Database  
SWTIRE..... Registered Waste Tire Storage & Facility List  
SWRCY..... Registered Recycling Facility List

### FEDERAL ASTM SUPPLEMENTAL

CONSENT..... Superfund (CERCLA) Consent Decrees  
ROD..... Records Of Decision  
Delisted NPL..... National Priority List Deletions  
FINDS..... Facility Index System/Facility Identification Initiative Program Summary Report  
HMIRS..... Hazardous Materials Information Reporting System  
MLTS..... Material Licensing Tracking System  
MINES..... Mines Master Index File  
NPL Liens..... Federal Superfund Liens  
PADS..... PCB Activity Database System  
RAATS..... RCRA Administrative Action Tracking System  
TRIS..... Toxic Chemical Release Inventory System  
TSCA..... Toxic Substances Control Act  
SSTS..... Section 7 Tracking Systems  
FTTS..... FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)

### STATE OR LOCAL ASTM SUPPLEMENTAL

HSWDS..... Hazardous Substance Waste Disposal Site Inventory  
AST..... Petroleum Bulk Storage  
CBS AST..... Chemical Bulk Storage Database  
MOSF AST..... Major Oil Storage Facilities Database

### BROWNFIELDS DATABASES

Brownfields..... Brownfields Site List

### SURROUNDING SITES: SEARCH RESULTS

Surrounding sites were identified.

Elevations have been determined from the USGS Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified. EDR's definition of a site with an elevation equal to the target property includes a tolerance of +/- 10 feet. Sites with an elevation equal to or higher than the target property have been differentiated below from sites with an elevation lower than the target property (by more than 10 feet). Page numbers and map identification numbers refer to the EDR Radius Map report where detailed data on individual sites can be reviewed.

Sites listed in ***bold italics*** are in multiple databases.

Unmappable (orphan) sites are not considered in the foregoing analysis.

## EXECUTIVE SUMMARY

### FEDERAL ASTM STANDARD

**CERCLIS:** The Comprehensive Environmental Response, Compensation and Liability Information System contains data on potentially hazardous waste sites that have been reported to the USEPA by states, municipalities, private companies and private persons, pursuant to Section 103 of the Comprehensive Environmental Response, Compensation and Liability Act (CERCLA). CERCLIS contains sites which are either proposed to or on the National Priorities List (NPL) and sites which are in the screening and assessment phase for possible inclusion on the NPL.

A review of the CERCLIS list, as provided by EDR, and dated 03/19/2003 has revealed that there are 2 CERCLIS sites within approximately 0.5 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
<b>HERTEL AVE</b>	<b>S HERTEL RD 1000FTW MIL</b>	<b>1/4 - 1/2NW</b>	<b>26</b>	<b>95</b>
<b>MORGAN CHEMICALS INC</b>	<b>373 HERTEL AVE</b>	<b>1/4 - 1/2WNW</b>	<b>37</b>	<b>118</b>

**RCRIS:** The Resource Conservation and Recovery Act database includes selected information on sites that generate, store, treat, or dispose of hazardous waste as defined by the Act. The source of this database is the U.S. EPA.

A review of the RCRIS-SQG list, as provided by EDR, and dated 09/09/2002 has revealed that there are 10 RCRIS-SQG sites within approximately 0.25 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
<b>QUALITY PETROLEUM PRODUCTS INC</b>	<b>164 CHANDLER ST</b>	<b>0 - 1/8 SW</b>	<b>A3</b>	<b>66</b>
<b>COMBINED SUPPLY &amp; EQUIPMENT CO</b>	<b>215 CHANDLER ST</b>	<b>0 - 1/8 E</b>	<b>14</b>	<b>80</b>
<b>BUFFALO WEAVING &amp; BELTING CO</b>	<b>260 CHANDLER ST</b>	<b>1/8 - 1/4E</b>	<b>D15</b>	<b>80</b>
<b>WASTE STREAM TECHNOLOGY INC</b>	<b>302 GROTE ST</b>	<b>1/8 - 1/4ESE</b>	<b>17</b>	<b>83</b>
<b>GEM-COR</b>	<b>601 AMHERST ST</b>	<b>1/8 - 1/4SE</b>	<b>E19</b>	<b>90</b>
<b>PERSONNEL CONTRACTORS</b>	<b>601 AMHERST ST SE 1ST F</b>	<b>1/8 - 1/4SE</b>	<b>E21</b>	<b>91</b>
<b>MORRISON INDUSTRIES L P</b>	<b>601 AMHERST ST</b>	<b>1/8 - 1/4SE</b>	<b>E22</b>	<b>91</b>
<b>DESIGN FOR INDUSTRY</b>	<b>601 AMHERST</b>	<b>1/8 - 1/4SE</b>	<b>E23</b>	<b>93</b>
<b>MOHAWK INDUSTRIES INC</b>	<b>601 AMHERST ST - SW COR</b>	<b>1/8 - 1/4SE</b>	<b>E24</b>	<b>94</b>
<b>WEGMANS FOOD MARKETS</b>	<b>601 AMHERST ST</b>	<b>1/8 - 1/4SE</b>	<b>E25</b>	<b>94</b>

### STATE ASTM STANDARD

**SHWS:** The State Hazardous Waste Sites records are the states' equivalent to CERCLIS. These sites may or may not already be listed on the federal CERCLIS list. Priority sites planned for cleanup using state funds (state equivalent of Superfund) are identified along with sites where cleanup will be paid for by potentially responsible parties. The data come from the Department of Environmental Conservation's Inactive Hazardous waste Disposal Sites in New York State.

A review of the SHWS list, as provided by EDR, has revealed that there are 2 SHWS sites within approximately 1 mile of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
<b>ANACONDA COMPANY/AMERICAN BRAS</b>	<b>446 MILITARY ROAD</b>	<b>1/4 - 1/2NW</b>	<b>38</b>	<b>119</b>
<u>Lower Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
<b>MARCON ERECTORS INC</b>	<b>1 HOWELL ST</b>	<b>1/4 - 1/2S</b>	<b>30</b>	<b>100</b>

## EXECUTIVE SUMMARY

**LTANKS:** Leaking Storage Tank Incident Reports. These records contain an inventory of reported leaking storage tank incidents reported from 4/1/86 through the most recent update. They can be either leaking underground storage tanks or leaking aboveground storage tanks. The causes of the incidents are tank test failures, tank failures or tank overfills

A review of the LTANKS list, as provided by EDR, and dated 01/01/2002 has revealed that there are 10 LTANKS sites within approximately 0.5 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
<b>NIAGARA LUBRICANTS</b>	<b>164 CHANDLER STREET</b>	<b>0 - 1/8 SW</b>	<b>A1</b>	<b>6</b>
<b>CITY OF BUFFALO PD</b>	<b>669 HERTEL AVENUE</b>	<b>1/4 - 1/2 NNE</b>	<b>27</b>	<b>95</b>
<b>GIOIA PASTA</b>	<b>1700 ELMWOOD AVE</b>	<b>1/4 - 1/2 E</b>	<b>28</b>	<b>96</b>
<b>SMITH METAL ARTS CO INC</b>	<b>1721 ELMWOOD AVE</b>	<b>1/4 - 1/2 E</b>	<b>29</b>	<b>98</b>
<b>NOCO ENERGY</b>	<b>357 MILITARY ROAD</b>	<b>1/4 - 1/2 NW</b>	<b>31</b>	<b>103</b>
<b>CITY SERVICE TAXI</b>	<b>1056 GRANT STREET</b>	<b>1/4 - 1/2 WSW</b>	<b>32</b>	<b>106</b>
<b>CITGO</b>	<b>1602 ELMWOOD AVENUE</b>	<b>1/4 - 1/2 ESE</b>	<b>33</b>	<b>107</b>
<b>MOD-PAC CORP</b>	<b>1801 ELMWOOD AVE</b>	<b>1/4 - 1/2 ENE</b>	<b>34</b>	<b>108</b>
<b>CURBELL INC</b>	<b>777 HERTEL AVE</b>	<b>1/4 - 1/2 NE</b>	<b>35</b>	<b>113</b>
<b>AMERICAN BRASS</b>	<b>70 SAYRE AVENUE</b>	<b>1/4 - 1/2 NW</b>	<b>36</b>	<b>116</b>

**UST:** The Underground Storage Tank database contains registered USTs. USTs are regulated under Subtitle I of the Resource Conservation and Recovery Act (RCRA). The data come from the Department of Environmental Conservation's Petroleum Bulk Storage (PBS) Database

A review of the UST list, as provided by EDR, and dated 01/01/2002 has revealed that there are 3 UST sites within approximately 0.25 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
<b>NIAGARA LUBRICANT CO INC</b>	<b>164 CHANDLER STREET</b>	<b>0 - 1/8 SW</b>	<b>A2</b>	<b>8</b>
<b>PHARGO, LLC DBA BUFFALO WEAVING</b>	<b>260 CHANDLER ST</b>	<b>1/8 - 1/4 E</b>	<b>D16</b>	<b>81</b>
<b>GAS STATION</b>	<b>600 AMHERST ST</b>	<b>1/8 - 1/4 SE</b>	<b>E18</b>	<b>87</b>

**NY VCP:** Voluntary Cleanup Agreements. The voluntary remedial program uses private monies to get contaminated sites remediated to levels allowing for the sites' productive use. The program covers virtually any kind of site and contamination.

A review of the VCP list, as provided by EDR, and dated 03/03/2003 has revealed that there is 1 VCP site within approximately 0.5 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
<b>601 AMHERST STREET</b>	<b>601 AMHERST STREET</b>	<b>1/8 - 1/4 SE</b>	<b>E20</b>	<b>90</b>

### STATE OR LOCAL ASTM SUPPLEMENTAL

**SPILLS:** Data collected on spills reported to NYSDEC. is required by one or more of the following: Article 12 of the Navigation Law, 6 NYCRR Section 613.8 (from PBS regs), or 6 NYCRR Section 595.2 (from CBS regs). It includes spills active as of April 1, 1986, as well as spills occurring since this date.

A review of the NY Spills list, as provided by EDR, has revealed that there are 12 NY Spills sites

## EXECUTIVE SUMMARY

within approximately 0.125 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
NIAGARA LUBRICANTS	164 CHANDLER STREET	0 - 1/8 SW	A1	6
NIAGARA LUBRICANT CO INC	164 CHANDLER STREET	0 - 1/8 SW	A2	8
G & R MACHINE & EQUIP.	155 CHANDLER STREET	0 - 1/8 WSW	A4	67
G AND R MACHINERY	155 CHANDLER STREET	0 - 1/8 WSW	A5	68
BAKERY SALVAGE	CHANDLER STREET	0 - 1/8 SW	B6	69
SALVAGES	CHANDLER STREET	0 - 1/8 SW	B7	70
TRUCK AT OLD BAKERY SALVA	CHANDLER STREET	0 - 1/8 SW	B8	72
NIAGARA LUBRICANT	142 CHANDLER	0 - 1/8 WSW	C9	73
K R K AUTO & BODY CENTER	140 CHANDLER STREET	0 - 1/8 W	C10	75
FIRE AT BAKERY SALVAGE	138 CHANDLER STREET	0 - 1/8 W	C11	76
BAKERY SALVAGE	132 CHANDLER STREET	0 - 1/8 W	C12	77
BAKERY SALVAGE	130 CHANDLER	0 - 1/8 W	C13	78

### PROPRIETARY DATABASES

#### **Former Manufactured Gas (Coal Gas) Sites:**

The existence and location of Coal Gas sites is provided exclusively to EDR by Real Property Scan, Inc. Copyright 1993 Real Property Scan, Inc. For a technical description of the types of hazards which may be found at such sites, contact your EDR customer service representative

A review of the Coal Gas list, as provided by EDR, has revealed that there is 1 Coal Gas site within approximately 1 mile of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
PEOPLES GASLIGHT & COKE CO.	BRADLEY & DART	1/2 - 1 SSW	39	121

### BROWNFIELDS DATABASES

**NY VCP:** Voluntary Cleanup Agreements. The voluntary remedial program uses private monies to get contaminated sites remediated to levels allowing for the sites' productive use. The program covers virtually any kind of site and contamination.

A review of the VCP list, as provided by EDR, and dated 03/03/2003 has revealed that there is 1 VCP site within approximately 0.5 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Dist / Dir</u>	<u>Map ID</u>	<u>Page</u>
601 AMHERST STREET	601 AMHERST STREET	1/8 - 1/4 SE	E20	90

## EXECUTIVE SUMMARY

Due to poor or inadequate address information, the following sites were not mapped:

<u>Site Name</u>	<u>Database(s)</u>
BUFFALO POLICE RADIO TOWE	LTANKS
UNKNOWN TRUCK	LTANKS
BUFFALO FIRE HOUSE #10	LTANKS
BUFFALO GENERAL HOSPITAL	LTANKS
BUFFALO FIRE HOUSE #26	LTANKS
B M H A - JASPER PARRISH BLOCK 1	RCRIS-SQG, FINDS
WBEN RADIO	RCRIS-SQG, FINDS
NYSDOT BIN 1-02273-0	FINDS, RCRIS-LQG
NYSDOT BIN 1-02261-0	FINDS, RCRIS-LQG
NYSDOT BIN 1-02277-0	FINDS, RCRIS-LQG
NYSDOT BIN 1-02271-0	FINDS, RCRIS-LQG
BRENTON - BLUE LIQUID	NY Spills
TAR ON ROAD	NY Spills
CITY OF BFLO PARKS DEPT	NY Spills
WARD TRUCKING	NY Spills
UPS/BUFFALO NIAGARA AIRPO	NY Spills
SUNY AT BUFFALO	NY Spills
BUFFALO RIVER	NY Spills
BUFFALO RIVER	NY Spills
BUFFALO RIVER DISCHARGE	NY Spills
BUFFALO FIRE HOUSE #22	NY Spills
BUFFALO STREETS & SANITAT	NY Spills
BOAT SUNK BUFFALO HARBOR	NY Spills
BUFFALO STATE COLLEGE	NY Spills
BUFFALO RIVER/ CROSSROADS	NY Spills
SHEEN ON BUFFALO RIVER	NY Spills
ASHLAND OIL HAZ WASTE SIT	NY Spills
CITY OF BUFFALO	NY Spills
BARGE BUFFALO RIVER	NY Spills
FIRE ENGINE #13 FIRE DEPT	NY Spills
BUFFALO SEWER AUTHORITY	NY Spills
BUFFALO PUBLIC SCHOOL	NY Spills
BUFFALO FUEL TRUCK	NY Spills
BUFFALO FOUNDRY	NY Spills
BUFFALO NAVAL SERV. PARK	NY Spills
CITY OF BUFFALO	NY Spills
BUFFALO RIVER	NY Spills
OIL ON BUFFALO RIVER	NY Spills
CITY OF BUFFALO TRUCK	NY Spills
BUFFALO WESTSIDE POST OFC	NY Spills
BUFFALO STATE COLLEGE	NY Spills
SAFETY KLEEN CORP.	NY Spills
CONRAIL	NY Spills
TRUCK ACCIDENT	NY Spills
BUFFALO AND PITTSBURGH RR	NY Spills
SHEEN ON SCAJAQUADA	NY Spills
MARCON ERECTORS	NY Spills
OIL ON BUFFALO RIVER	NY Spills
SUNY AT BUFFALO	NY Spills
BUFFALO INNER HARBOR	NY Spills
BUFFALO RIVER	NY Spills
NATIONAL RECYCLING TRUCK	NY Spills
BUFFALO RAILROAD	NY Spills
SCAJAQUADA CREEK	NY Spills
SUNY BUFFALO NORTH CAMPUS	NY Spills
BUFFALO NEWS	NY Spills

# OVERVIEW MAP - 0962135.1s - Benchmark Environmental, PLLC




- ★ Target Property
- ▲ Sites at elevations higher than or equal to the target property
- ◆ Sites at elevations lower than the target property
- ▲ Coal Gasification Sites
- ▨ National Priority List Sites
- ▨ Landfill Sites

- County Boundary
- Power transmission lines
- Oil & Gas pipelines
- ▨ 100-year flood zone
- ▨ 500-year flood zone
- ▨ Wetlands

**TARGET PROPERTY:** Buffalo Weaving and Belting Co  
**ADDRESS:** 260 Chandler Street  
**CITY/STATE/ZIP:** Buffalo NY 14207  
**LAT/LONG:** 42.9435 / 78.8852

**CUSTOMER:** Benchmark Environmental, PLLC  
**CONTACT:** Bryan Hann  
**INQUIRY #:** 0962135.1s  
**DATE:** April 17, 2003 6:14 pm

# DETAIL MAP - 0962135.1s - Benchmark Environmental, PLLC

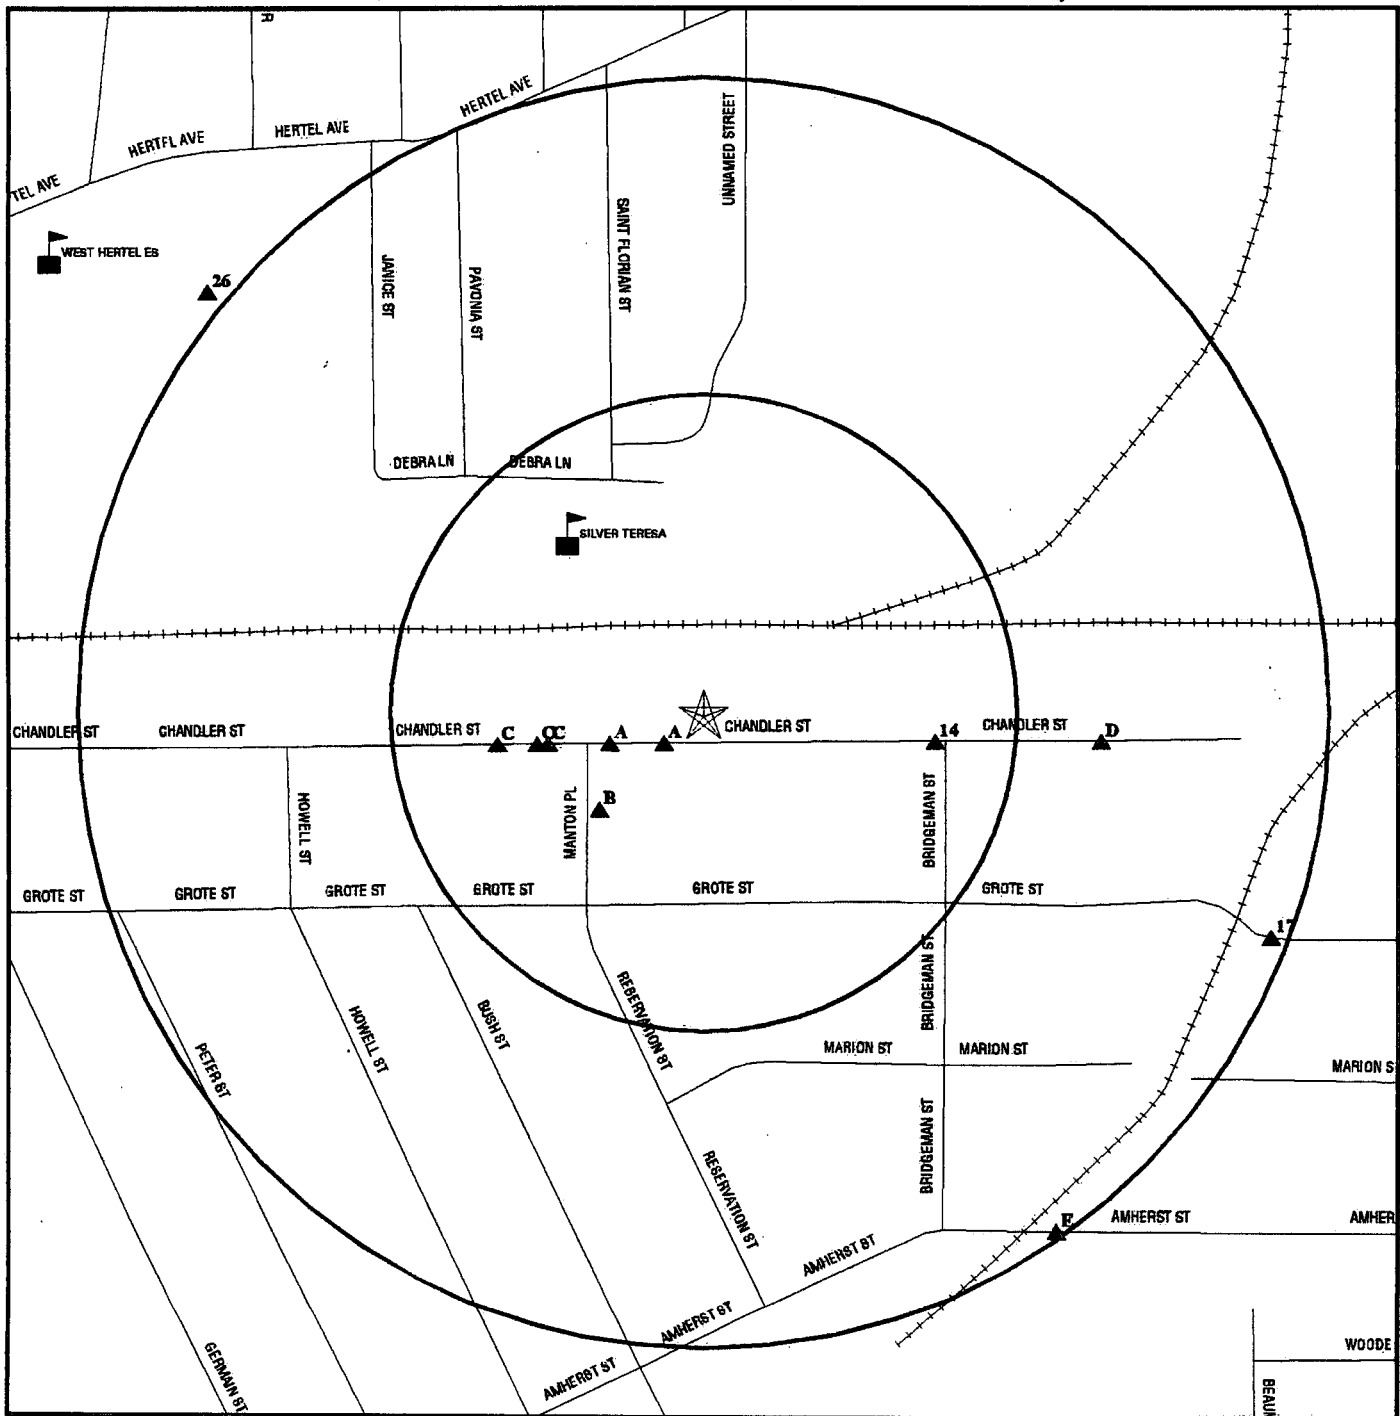

- ★ Target Property
- ▲ Sites at elevations higher than or equal to the target property
- ◆ Sites at elevations lower than the target property
- ▲ Coal Gasification Sites
- ⚡ Sensitive Receptors
- ☒ National Priority List Sites
- ☒ Landfill Sites

- County Boundary
- Power transmission lines
- Oil & Gas pipelines
- ▨ 100-year flood zone
- ▨ 500-year flood zone

0 1/16 1/8 1/4 Miles

**TARGET PROPERTY:** Buffalo Weaving and Belting Co  
**ADDRESS:** 260 Chandler Street  
**CITY/STATE/ZIP:** Buffalo NY 14207  
**LAT/LONG:** 42.9435 / 78.8852

**CUSTOMER:** Benchmark Environmental, PLLC  
**CONTACT:** Bryan Hann  
**INQUIRY #:** 0962135.1s  
**DATE:** April 17, 2003 6:15 pm

## MAP FINDINGS SUMMARY

Database	Target Property	Search Distance (Miles)	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
<b><u>FEDERAL ASTM STANDARD</u></b>								
NPL		1.000	0	0	0	0	NR	0
Proposed NPL		1.000	0	0	0	0	NR	0
CERCLIS		0.500	0	0	2	NR	NR	2
CERC-NFRAP		0.250	0	0	NR	NR	NR	0
CORRACTS		1.000	0	0	0	0	NR	0
RCRIS-TSD		0.500	0	0	0	NR	NR	0
RCRIS Lg. Quan. Gen.		0.250	0	0	NR	NR	NR	0
RCRIS Sm. Quan. Gen.		0.250	2	8	NR	NR	NR	10
ERNS	TP		NR	NR	NR	NR	NR	0
<b><u>STATE ASTM STANDARD</u></b>								
State Haz. Waste		1.000	0	0	2	0	NR	2
State Landfill		0.500	0	0	0	NR	NR	0
LTANKS		0.500	1	0	9	NR	NR	10
UST		0.250	1	2	NR	NR	NR	3
CBS UST		0.250	0	0	NR	NR	NR	0
MOSF UST		0.500	0	0	0	NR	NR	0
VCP		0.500	0	1	0	NR	NR	1
SWTIRE		0.500	0	0	0	NR	NR	0
SWRCY		0.500	0	0	0	NR	NR	0
<b><u>FEDERAL ASTM SUPPLEMENTAL</u></b>								
CONSENT		1.000	0	0	0	0	NR	0
ROD		1.000	0	0	0	0	NR	0
Delisted NPL		1.000	0	0	0	0	NR	0
FINDS	TP		NR	NR	NR	NR	NR	0
HMIRS	TP		NR	NR	NR	NR	NR	0
MLTS	TP		NR	NR	NR	NR	NR	0
MINES		0.250	0	0	NR	NR	NR	0
NPL Liens	TP		NR	NR	NR	NR	NR	0
PADS	TP		NR	NR	NR	NR	NR	0
RAATS	TP		NR	NR	NR	NR	NR	0
TRIS	TP		NR	NR	NR	NR	NR	0
TSCA	TP		NR	NR	NR	NR	NR	0
SSTS	TP		NR	NR	NR	NR	NR	0
FTTS	TP		NR	NR	NR	NR	NR	0
<b><u>STATE OR LOCAL ASTM SUPPLEMENTAL</u></b>								
HSWDS		0.500	0	0	0	NR	NR	0
AST	TP		NR	NR	NR	NR	NR	0
CBS AST		0.250	0	0	NR	NR	NR	0
MOSF AST		0.500	0	0	0	NR	NR	0
NY Spills		0.125	12	NR	NR	NR	NR	12



## MAP FINDINGS SUMMARY

<u>Database</u>	<u>Target Property</u>	<u>Search Distance (Miles)</u>	<u>&lt; 1/8</u>	<u>1/8 - 1/4</u>	<u>1/4 - 1/2</u>	<u>1/2 - 1</u>	<u>&gt; 1</u>	<u>Total Plotted</u>
<b><u>EDR PROPRIETARY HISTORICAL DATABASES</u></b>								
Coal Gas		1.000	0	0	0	1	NR	1
<b><u>BROWNFIELDS DATABASES</u></b>								
Brownfields		0.500	0	0	0	NR	NR	0
VCP		0.500	0	1	0	NR	NR	1

**NOTES:**

AQUIFLOW - see EDR Physical Setting Source Addendum

TP = Target Property

NR = Not Requested at this Search Distance

Sites may be listed in more than one database

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

A1  
SW  
< 1/8  
106 ft.  
Higher

NIAGARA LUBRICANTS  
164 CHANDLER STREET  
BUFFALO, NY

Site 1 of 5 in cluster A

Database(s)  
EDR ID Number  
EPA ID Number

LTANKS  
NY Spills

S104075279  
N/A

SPILLS:

Spill Number:	9800260	Region of Spill:	9
Facility Contact:	Not reported	Facility Tele:	Not reported
Investigator:	SAC	SWIS:	14
Caller Name:	Not reported	Caller Agency:	Not reported
Caller Phone:	Not reported	Caller Extension:	Not reported
Notifier Name:	Not reported	Notifier Agency:	Not reported
Notifier Phone:	Not reported	Notifier Extension:	Not reported
Spiller Contact:	LEON SMITH	Spiller Phone:	(716) 874-2300
Spiller:	NIAGARA LUBRICANTS		
Spiller Address:	164 CHANDLER STREET BUFFALO, NY 14207		
Spill Class:	Known release that creates potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.		
Spill Closed Dt:	08/07/2001		
Spill Cause:	Housekeeping	Resource Affected:	On Land
Water Affected:	Not reported	Spill Source:	Other Commercial/Industrial
Spill Notifier:	Citizen	PBS Number:	Not reported
Spill Date:	04/01/1998 12:00	Reported to Dept:	04/01/1998 10:00
Cleanup Ceased:	Not reported		
Last Inspection:	20010807		
Cleanup Meets Standard:	False		
Recommended Penalty:	Penalty Not Recommended		
Spiller Cleanup Date:	Not reported		
Enforcement Date:	Not reported		
Investigation Complete:	Not reported		
UST Involvement:	False		
Spill Record Last Update:	08/07/2001		
Is Updated:	False		
Corrective Action Plan Submitted:	Not reported		
Date Spill Entered In Computer Data File:	04/07/1998		
Date Region Sent Summary to Central Office:	Not reported		
Tank Test:			
PBS Number:	Not reported		
Tank Number:	Not reported		
Test Method:	Not reported		
Capacity of Failed Tank:	Not reported		
Leak Rate Failed Tank:	Not reported		
Gross Leak Rate:	Not reported		
Material:			
Material Class Type:	1		
Quantity Spilled:	0		
Units:	Gallons		
Unknown Qty Spilled:	No		
Quantity Recovered:	0		
Unknown Qty Recovered:	False		
Material:	WASTE OIL		
Class Type:	Petroleum		
Chem Abstract Service Number:	WASTE OIL		
Last Date:	09/27/1994		
Num Times Material Entry In File:	9509		
Material Class Type:	3		
Quantity Spilled:	0		

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation      Site

MAP FINDINGS

Database(s)      EDR ID Number  
EPA ID Number

NIAGARA LUBRICANTS (Continued)

S104075279

Units:                      Gallons  
Unknown Qty Spilled:      No  
Quantity Recovered:      0  
Unknown Qty Recovered:   False  
Material:                  SOLVENTS  
Class Type:                Non Pet/Non Haz  
Chem Abstract Service Number:      SOLVENTS  
Last Date:                09/28/1994  
Num Times Material Entry In File:      424

Remark:      CALLER CLAIMS THAT APPROXIMATELY 150 55 GALLON DRUMS OF MOSTLY WASTE OIL HAVE BEEN STORED IN BASEMENT FOR YEARS. MANY ARE LEAKING. ALSO, LEAKING ABOVE GROUND WASTEWATER OIL TANKS. \*\*\* FORMERLY MJS FILE\*\*\*

DEC Remarks:      04/09/98: MJS, RNL SITE INSPECT. MET WITH DENNIS RILEY CHEMIST. ADVISED HIM OF COMPLAINT. FOUND OIL APPROX 150 GALLONS TOTAL) PUDDLED ON BASEMENT FLOOR IN SEVERAL LOCATIONS. FOUND SEVERAL HUNDRED DRUMS IN BASEMENT, MANY LEAKING WITH SPEEDI DRI SPREAD AROUND THEM. MR RILEY STATED THAT MANY OF THE DRUMS ARE FROM A CLEANUP FROM THE PAST. DRUM LIDS ARE DATED 1993. ALSO FOUND HOPPERS FILLED WITH OIL AND WASTE. MJS ADVISED MR RILEY THAT THERE ARE MANY ISSUES THAT WILL HAVE TO BE DEALT WITH. HE STATED THAT AT WE SHOULD CONTACT TOM MCLEOD VP) OR LEON SMITH PRES). 8/7/01:JFO, SAC INSPECT SITE, MET W/LEON SMITH - PRESIDENT OF NIAGARA LUBRICANT, WENT INTO BASEMENT FOUND DRUMS OF PRODUCT AND HOME HEATING OIL TANKS ON THE FLOOR WHICH ARE APPARENTLY EMPTY, MR. SMITH SAID THEY FABRICATE LUBRICANTS AND THESE DRUMS ARE FILLED WITH OFF-SPEC PRODUCT IN WHICH SMALL AMOUNTS ARE MIXED INTO THE BATCHES WHEN MAKING NEW PRODUCT, THEY REUSE THE DRUMS SHELLS AND PROBABLY GO THROUGH THE OFF SPEC PRODUCT IN 4 TO 6 MONTH CYCLES. MR. SMITH SAID THE NUMBER OF DRUMS HAS BEEN REDUCED FROM A FEW YEARS AGO WHEN MOST OF THE BASEMENT WAS FILLED WITH DRUMS, THE FLOOR IS OIL STAINED AND RESIDUAL SPEEDI-DRY WAS OBSERVED ON THE FLOOR, EQUIPMENT IN THE BASEMENT HAD DRIIP PANS UNDERNEATH THAT HAD PRODUCT FILLED IN THEM, MR. SMITH SAID THAT THE BUILDING WAS PART OF QUAKER STATE REFINING AT ONE TIME AND THAT THE FLOOR IS SEALED TO PREVENT SEEPAGE AND THAT THERE ARE NO FLOOR DRAINS IN THE BASEMENT PREVENTING ANY OFF-SITE MIGRATION, SAC DISCUSS SITE W/MARK HANS, DIV OF SOLID AND HAZARDOUS MATERIALS, MR. HANS WILL HAVE SOMEONE FROM HIS DIVISION FOLLOW UP, NO FURTHER WORK BY SPILLS.

LTANKS:

Spill Number:	9975094	Region of Spill:	9
Facility Contact:	Not reported	Facility Tele:	Not reported
Investigator:	SAC	SWIS:	14
Caller Name:	Not reported	Caller Agency:	Not reported
Caller Phone:	Not reported	Caller Extension:	Not reported
Notifier Name:	Not reported	Notifier Agency:	Not reported
Notifier Phone:	Not reported	Notifier Extension:	Not reported
Spiller Contact:	Not reported	Spiller Phone:	Not reported
Spiller:	ARROW TRUCKING		
Spiller Address:	Not reported		
Spill Class:	Known release that creates potential for fire or hazard. (Highly Improbable)		
Spill Closed Dt:	04/11/2001		
Spill Cause:	Tank Failure	Resource Affected:	On Land
Water Affected:	Not reported	Spill Source:	Commercial Vehicle
Spill Notifier:	Affected Persons	PBS Number:	Not reported
Spill Date:	05/04/1999 12:00	Reported to Dept:	05/04/1999 15:10
Cleanup Ceased:	Not reported		
Last Inspection:	Not reported		
Cleanup Meets Standard:	True		

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
EPA ID Number

NIAGARA LUBRICANTS (Continued)

S104075279

Recommended Penalty: Penalty Not Recommended  
Spiller Cleanup Date: Not reported  
Enforcement Date: Not reported  
Investigation Complete: Not reported  
UST Involvement: False  
Spill Record Last Update: 04/30/2001  
Is Updated: False  
Corrective Action Plan Submitted: Not reported  
Date Spill Entered In Computer Data File: 05/04/1999 15:18  
Date Region Sent Summary to Central Office: Not reported

Tank Test:

PBS Number: Not reported  
Tank Number: Not reported  
Test Method: Not reported  
Capacity of Failed Tank: Not reported  
Leak Rate Failed Tank: Not reported  
Gross Leak Rate: Not reported

Material:

Material Class Type: 1  
Quantity Spilled: 200  
Units: Gallons  
Unknown Qty Spilled: 200  
Quantity Recovered: 200  
Unknown Qty Recovered: False  
Material: MOTOR OIL  
Class Type: Petroleum  
Chem Abstract Service Number: MOTOR OIL  
Last Date: 07/28/1994  
Num Times Material Entry In File: 508

DEC Remarks: 05/04/99: MJS TOOK CALL FROM PAUL SUOZZI, ESG INC. THEY WILL PAD FREE P  
RODUCT AND SECURE FOR THE EVENING. THEY NEED TO EXCAVATE SOILS TO CLEAN  
SITE. 03/26/01: SAC ASSUMED SITE RESPONSIBILITY AS MJS LEFT DEPARTMEN  
T, FOUND NO FILE FOR SITESAC TELECON DAVE MENDEL REGARDING RECORDS FOR T  
HE SITE, HE BELIEVES THEY HAVE BEEN ARCHIVED AND HE WILL TRY TO LOCATE T  
HEM. 04/10/01: SAC RECEIVED DISPOSAL RECEIPTS FOR 90 TONS OF MATERIAL

Spill Cause: VIRGIN MOTOR OIL SPILLED FROM DELIVERY TRUCK TO GROUND OUTSIDE BUILDING.  
\*\*\* FORMERLY MJS FILE)\*\*\*

A2  
SW  
< 1/8  
106 ft.  
Higher

NIAGARA LUBRICANT CO INC  
164 CHANDLER STREET  
BUFFALO, NY 14207

UST U003318611  
AST N/A  
NY Spills

Site 2 of 5 in cluster A

SPILLS:

Spill Number:	9306631	Region of Spill:	9
Facility Contact:	Not reported	Facility Tele:	Not reported
Investigator:	RMC	SWIS:	14
Caller Name:	Not reported	Caller Agency:	Not reported
Caller Phone:	Not reported	Caller Extension:	Not reported
Notifier Name:	Not reported	Notifier Agency:	Not reported
Notifier Phone:	Not reported	Notifier Extension:	Not reported
Spiller Contact:	Not reported	Spiller Phone:	(716) 874-2300
Spiller:	NIAGARA LUBRICANT		
Spiller Address:	164 CHANDLER STREET BUFFALO, NY 14207		
Spill Class:	Known release that creates potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.		

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

NIAGARA LUBRICANT CO INC (Continued)

EDR ID Number  
EPA ID Number

Database(s)

U003318611

Spill Closed Dt: 04/03/1995  
Spill Cause: Housekeeping  
Water Affected: Not reported  
Spill Notifier: DEC  
Spill Date: 08/11/1993 12:00  
Cleanup Ceased: 03/03/1995  
Last Inspection: 19940107  
Cleanup Meets Standard: False  
Recommended Penalty: Penalty Not Recommended  
Spiller Cleanup Date: Not reported  
Enforcement Date: Not reported  
Investigation Complete: Not reported  
UST Involvement: False  
Spill Record Last Update: 08/07/2001  
Is Updated: False  
Corrective Action Plan Submitted: Not reported  
Date Spill Entered In Computer Data File: 08/31/1993  
Date Region Sent Summary to Central Office: Not reported  
Tank Test:  
PBS Number: Not reported  
Tank Number: Not reported  
Test Method: Not reported  
Capacity of Failed Tank: Not reported  
Leak Rate Failed Tank: Not reported  
Gross Leak Rate: Not reported  
Material:  
Material Class Type: 1  
Quantity Spilled: 0  
Units: Pounds  
Unknown Qty Spilled: No  
Quantity Recovered: 0  
Unknown Qty Recovered: True  
Material: UNKNOWN PETROLEUM  
Class Type: Petroleum  
Chem Abstract Service Number: UNKNOWN PETROLEUM  
Last Date: 09/29/1994  
Num Times Material Entry In File: 16414

Remark: MR. WU REPORTS THAT SITE IS IN GENERAL NEED OF ATTENTION. ALSO TWO 5K  
TANK REMOVALS WITH CONTAMINATION  
DEC Remarks: 09/14/93: RMC/SITE OWNER NOT THERE. TO REINSPECT. 09/15/93: RMC/MCLE  
OD/PHONE RP HAS HIRED CONTRACTOR TO CLEANUP, TO INSPECT WHEN COMPLETE BY  
10/30/93. 12/21/93: SAC/BILL GALLOWAY, ENV. SVCS. GROUP/TELECON - BEG  
AN EXCAVATING FOR CLOSING TANK INN-PLACE. FOUND CONTAMINATION. PROBLEM W  
/6 5K A/G TANKS ON CONCRETE PAD ON TOP OF TANK THAT IS BEING CLOSED.  
12/21/93: RMC/BILL GALLOWAY/SITE - GROSS CONTAMINATION NOTED IN EXCAVATI  
ON TO TOP OF TANK. R.P. TO ANALYZE COSTS OF REMOVAL VS. SUBSURFACEE REME  
DIATION. PLAN DUE BY 12/30/93. 01/03/94: RMC/BILL GALLOWAY/SITE - RE  
MOVED GLYCOL AND FUEL OIL TANK THEY WERE PREVIOUSLY UNAWARE OF, TO REMOV  
E SACOND 5K TANK NEXT WEEK CALL DUE 1/30/94. 01/07/94: RMC/TOM DAY/S  
ITE - ALL THREE TANKS REMOVED, COULD NOT DIG TO VISUAL CLEAN, RP TO INS  
TALL TANK PIT MONITORING WELL, PAPERWORK DUE 2/28/94. 01/07/94: RMC/T  
OM DAY/SITE - ALL THREE TANKS REMOVED, COULD NOT DIG TO VISUAL CLEAN, RP  
TO INSTALL TANK PIT MONITORING WELL, LETTER,PAPERWORK DUE 2/228/94. 0  
3/08/94: RMC/TOM DAY/PHONE WORK ON HOLD DUE TO WEATHER, WASTE STREAM TO  
CONTINUE ON, INSPECT 4/15/94. 05/26/94: RMC/LETTER RESPONSE DUE 6/10/  
94. 06/30/94: RMC/NO RESPONSE LETTER, RESPONSE DUE 7/30/94. 07/08/  
94: RMC/LEON SMITH NIAGGARA LUBE/PHONE WASTE STREAM DOING TESTING,FAXED

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

Site

MAP FINDINGS

Database(s)

EDR ID Number  
EPA ID Number

NIAGARA LUBRICANT CO INC (Continued)

U003318611

1/10/94 LETTER THAT RP MISS PLACED, RESULTS DUE 7/30/94. 07/27/94: RM  
C/RECEIVED RESULTS, I PER RNL UPON RECEIPT OF DISPOSAL DOCUMENTATION,  
, DISPOSAL RECEIPT DUE 8/30/94. 10/13/94: RMC/DISPOSAL LLETTER, RECEI  
PT DUE 10/30/94. 04/03/95: RMC/RECEIVED DISPOSAL DOCUMENTATION FOR 80  
+ TONS, OK, INACTIVE.

PBS UST:

PBS Number:	9-502766	CBS Number:	Not reported
SPDES Number:	Not reported	SWIS ID:	1402
Operator:	NIAGARA LUBRICANT CO INC (716) 874-2300		
Emergency Contact:	THOMAS R MCLEOD (716) 662-2741		
Total Tanks:	53		
Owner:	NIAGARA LUBRICANT CO INC 164 CHANDLER STREET BUFFALO, NY 14207 (716) 874-2300		
Owner Type:	Corporate/Commercial		
Owner Mark:	First Owner		
Owner Subtype:	Not reported		
Mailing Address:	NIAGARA LUBRICANT CO INC 164 CHANDLER STREET BUFFALO, NY 14207 (716) 874-2300		
Tank Status:	Closed - Removed		
Capacity (gals):	5000		
Tank Location:	UNDERGROUND		
Tank Id:	Y52	Install Date:	Not reported
Tank Type:	Steel/carbon steel	Product Stored:	OTHER
Tank Internal:	Not reported	Pipe Internal:	Not reported
Pipe Location:	1	Pipe Type:	STEEL/IRON
Tank External:	Not reported		
Missing Data for Tank:	Minor Data Missing		
Pipe External:	Not reported		
Second Containment:	Not reported		
Leak Detection:	NONE		
Overfill Prot:	2	Dispenser:	Suction
Date Tested:	Not reported	Next Test Date:	Not reported
Date Closed:	12/01/1993	Test Method:	Not reported
Deleted:	False	Updated:	True
Dead Letter:	False	Owner Screen:	No data missing
FAMT:	Fiscal amount for registration fee is correct		
Total Capacity:	262425	Renewal Date:	Not reported
Tank Screen:	No data missing	Federal ID:	Not reported
Renew Flag:	Renwal has not been printed	Facility Screen:	No data missing
Certification Flag:	False	Certification Date:	06/01/2000
Old PBS Number:	Not reported	Expiration Date:	05/14/2005
Inspected Date:	08/11/1993	Inspector:	SIMON
Inspection Result:	Not reported		
Lat/long:	Not reported		
Facility Type:	STORAGE TERMINAL/PETROLEUM DISTRIBUTOR		
Town or City:	BUFFALO (C)		
Town or City Code:	02		
County Code:	14		
Region:	9		

PBS Number: 9-502766

CBS Number: Not reported

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

NIAGARA LUBRICANT CO INC (Continued)

EDR ID Number  
EPA ID Number

Database(s)

U003318611

SPDES Number:	Not reported	SWIS ID:	1402
Operator:	NIAGARA LUBRICANT CO INC (716) 874-2300		
Emergency Contact:	THOMAS R MCLEOD (716) 662-2741		
Total Tanks:	53		
Owner:	NIAGARA LUBRICANT CO INC 164 CHANDLER STREET BUFFALO, NY 14207 (716) 874-2300		
Owner Type:	Corporate/Commercial		
Owner Mark:	First Owner		
Owner Subtype:	Not reported		
Mailing Address:	NIAGARA LUBRICANT CO INC 164 CHANDLER STREET BUFFALO, NY 14207 (716) 874-2300		
Tank Status:	Closed - In Place	Install Date:	Not reported
Capacity (gals):	5000	Product Stored:	OTHER
Tank Location:	UNDERGROUND	Pipe Internal:	Not reported
Tank Id:	Y53	Pipe Type:	STEEL/IRON
Tank Type:	Steel/carbon steel		
Tank Internal:	Not reported		
Pipe Location:	1		
Tank External:	Not reported		
Missing Data for Tank:	Minor Data Missing		
Pipe External:	Not reported		
Second Containment:	Not reported		
Leak Detection:	NONE		
Overfill Prot:	2	Dispenser:	Suction
Date Tested:	Not reported	Next Test Date:	Not reported
Date Closed:	12/01/1993	Test Method:	Not reported
Deleted:	False	Updated:	True
Dead Letter:	False	Owner Screen:	No data missing
FAMT:	Fiscal amount for registration fee is correct		
Total Capacity:	262425	Renewal Date:	Not reported
Tank Screen:	No data missing	Federal ID:	Not reported
Renew Flag:	Renwal has not been printed	Facility Screen:	No data missing
Certification Flag:	False	Certification Date:	06/01/2000
Old PBS Number:	Not reported	Expiration Date:	05/14/2005
Inspected Date:	08/11/1993	Inspector:	SIMON
Inspection Result:	Not reported		
Lat/long:	Not reported		
Facility Type:	STORAGE TERMINAL/PETROLEUM DISTRIBUTOR		
Town or City:	BUFFALO (C)		
Town or City Code:	02		
County Code:	14		
Region:	9		
PBS AST:			
PBS Number:	9-502766	CBS Number:	Not reported
SPDES Number:	Not reported	SWIS Code:	1402
Federal ID:	Not reported	Previous PBS#:	Not reported
Facility Status:	1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.		
Facility Type:	STORAGE TERMINAL/PETROLEUM DISTRIBUTOR		
Owner Type:	Corporate/Commercial		
Owner Sub Type:	Not reported		

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation     Site

MAP FINDINGS

Database(s)     EDR ID Number  
EPA ID Number

NIAGARA LUBRICANT CO INC (Continued)

U003318611

Owner: NIAGARA LUBRICANT CO INC  
164 CHANDLER STREET  
BUFFALO, NY 14207  
Owner Phone: (716) 874-2300  
Facility Phone: (716) 874-2300  
Operator: NIAGARA LUBRICANT CO INC  
Emergency Name: THOMAS R MCLEOD  
Emergency Phone: (716) 662-2741  
Total Tanks: 53  
Total Capacity: 262425  
Tank ID: B14  
Capacity (Gal): 7900  
Missing Data for Tank : No data missing  
Tank Location: ABOVEGROUND  
Product Stored: LUBE OIL  
Tank Type: Steel/carbon steel  
Install Date: / /  
Tank Internal: NONE  
Tank External: PAINTED/ASPHALT COATING/NONE  
Tank Containment: CONCRETE DIKE/NONE  
Pipe Type: STEEL/IRON  
Pipe Location: Aboveground  
Pipe Internal: NONE  
Pipe External: NONE/NONE  
Leak Detection: NONE/NONE  
Overfill Protection: None  
Dispenser Method: Suction  
Date Tested: / /     Next Test Date: / /  
Date Closed: / /     Test Method: Not reported  
Updated: True     Deleted: False  
Date Inspected: 08/11/1993     Inspector: SIMON  
Result of Inspection: Not reported  
Mailing Name: NIAGARA LUBRICANT CO INC  
Mailing Address: 164 CHANDLER STREET  
BUFFALO, NY 14207  
Mailing Contact: Not reported  
Mailing Telephone: (716) 874-2300  
Owner Mark: First Owner     Expiration Date: 05/14/2005  
Certification Flag: False     Certification Date: 06/01/2000  
Renew Flag: False     Renew Date: / /  
Lat/Long: Not reported  
Dead Letter: False  
Facility Screen: No data missing  
Owner Screen: No data missing  
Tank Screen: No data missing  
Town or City: BUFFALO (C)  
Town or City Code: 02  
County Code: 14  
Region: 9  
Fiscal Amount for Registration Fee is Correct: True  
PBS Number: 9-502766     CBS Number: Not reported  
SPDES Number: Not reported     SWIS Code: 1402  
Federal ID: Not reported     Previous PBS#: Not reported  
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than  
1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.  
Facility Type: STORAGE TERMINAL/PETROLEUM DISTRIBUTOR



Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation    Site

MAP FINDINGS

Database(s)    EDR ID Number  
EPA ID Number

NIAGARA LUBRICANT CO INC (Continued)

U003318611

Owner Type:	Corporate/Commercial	
Owner Sub Type:	Not reported	
Owner:	NIAGARA LUBRICANT CO INC	
	164 CHANDLER STREET	
	BUFFALO, NY 14207	
Owner Phone:	(716) 874-2300	
Facility Phone:	(716) 874-2300	
Operator:	NIAGARA LUBRICANT CO INC	
Emergency Name:	THOMAS R MCLEOD	
Emergency Phone:	(716) 662-2741	
Total Tanks:	53	
Total Capacity:	262425	
Tank ID:	B07	
Capacity (Gal):	3900	
Missing Data for Tank :	No data missing	
Tank Location:	ABOVEGROUND	
Product Stored:	LUBE OIL	
Tank Type:	Steel/carbon steel	
Install Date:	/ /	
Tank Internal:	NONE	
Tank External:	PAINTED/ASPHALT COATING/NONE	
Tank Containment:	NONE/CONCRETE DIKE	
Pipe Type:	STEEL/IRON	
Pipe Location:	Aboveground	
Pipe Internal:	NONE	
Pipe External:	NONE/NONE	
Leak Detection:	NONE/NONE	
Overfill Protection:	None	
Dispenser Method:	Suction	
Date Tested:	/ /	Next Test Date: / /
Date Closed:	/ /	Test Method: Not reported
Updated:	True	Deleted: False
Date Inspected:	08/11/1993	Inspector: SIMON
Result of Inspection:	Not reported	
Mailing Name:	NIAGARA LUBRICANT CO INC	
Mailing Address:	164 CHANDLER STREET	
	BUFFALO, NY 14207	
Mailing Contact:	Not reported	
Mailing Telephone:	(716) 874-2300	
Owner Mark:	First Owner	Expiration Date: 05/14/2005
Certification Flag:	False	Certification Date: 06/01/2000
Renew Flag:	False	Renew Date: / /
Lat/Long:	Not reported	
Dead Letter:	False	
Facility Screen:	No data missing	
Owner Screen:	No data missing	
Tank Screen:	No data missing	
Town or City:	BUFFALO (C)	
Town or City Code:	02	
County Code:	14	
Region:	9	
Fiscal Amount for Registration Fee is Correct:	True	
PBS Number:	9-502766	CBS Number: Not reported
SPDES Number:	Not reported	SWIS Code: 1402
Federal ID:	Not reported	Previous PBS#: Not reported

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
EPA ID Number

NIAGARA LUBRICANT CO INC (Continued)

U003318611

Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.  
Facility Type: STORAGE TERMINAL/PETROLEUM DISTRIBUTOR  
Owner Type: Corporate/Commercial  
Owner Sub Type: Not reported  
Owner: NIAGARA LUBRICANT CO INC  
164 CHANDLER STREET  
BUFFALO, NY 14207  
Owner Phone: (716) 874-2300  
Facility Phone: (716) 874-2300  
Operator: NIAGARA LUBRICANT CO INC  
Emergency Name: THOMAS R MCLEOD  
Emergency Phone: (716) 662-2741  
Total Tanks: 53  
Total Capacity: 262425  
Tank ID: B08  
Capacity (Gal): 3900  
Missing Data for Tank : No data missing  
Tank Location: ABOVEGROUND  
Product Stored: LUBE OIL  
Tank Type: Steel/carbon steel  
Install Date: / /  
Tank Internal: NONE  
Tank External: PAINTED/ASPHALT COATING/NONE  
Tank Containment: CONCRETE DIKE/NONE  
Pipe Type: STEEL/IRON  
Pipe Location: Aboveground  
Pipe Internal: NONE  
Pipe External: NONE/NONE  
Leak Detection: NONE/NONE  
Overfill Protection: None  
Dispenser Method: Suction  
Date Tested: / /  
Date Closed: / /  
Updated: True  
Date Inspected: 08/11/1993  
Result of Inspection: Not reported  
Mailing Name: NIAGARA LUBRICANT CO INC  
Mailing Address: 164 CHANDLER STREET  
BUFFALO, NY 14207  
Mailing Contact: Not reported  
Mailing Telephone: (716) 874-2300  
Owner Mark: First Owner  
Certification Flag: False  
Renew Flag: False  
Lat/Long: Not reported  
Dead Letter: False  
Facility Screen: No data missing  
Owner Screen: No data missing  
Tank Screen: No data missing  
Town or City: BUFFALO (C)  
Town or City Code: 02  
County Code: 14  
Region: 9  
Fiscal Amount for Registration Fee is Correct: True

Next Test Date: / /  
Test Method: Not reported  
Deleted: False  
Inspector: SIMON

Expiration Date: 05/14/2005  
Certification Date: 06/01/2000  
Renew Date: / /

PBS Number: 9-502766

CBS Number: Not reported

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

NIAGARA LUBRICANT CO INC (Continued)

EDR ID Number  
EPA ID Number

Database(s)

U003318611

SPDES Number: Not reported SWIS Code: 1402  
Federal ID: Not reported Previous PBS#: Not reported  
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than  
1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.  
Facility Type: STORAGE TERMINAL/PETROLEUM DISTRIBUTOR  
Owner Type: Corporate/Commercial  
Owner Sub Type: Not reported  
Owner: NIAGARA LUBRICANT CO INC  
164 CHANDLER STREET  
BUFFALO, NY 14207  
Owner Phone: (716) 874-2300  
Facility Phone: (716) 874-2300  
Operator: NIAGARA LUBRICANT CO INC  
Emergency Name: THOMAS R MCLEOD  
Emergency Phone: (716) 662-2741  
Total Tanks: 53  
Total Capacity: 262425  
Tank ID: B09  
Capacity (Gal): 3200  
Missing Data for Tank: No data missing  
Tank Location: ABOVEGROUND  
Product Stored: LUBE OIL  
Tank Type: Steel/carbon steel  
Install Date: / /  
Tank Internal: NONE  
Tank External: PAINTED/ASPHALT COATING/NONE  
Tank Containment: NONE/CONCRETE DIKE  
Pipe Type: STEEL/IRON  
Pipe Location: Aboveground  
Pipe Internal: NONE  
Pipe External: NONE/NONE  
Leak Detection: NONE/NONE  
Overfill Protection: None  
Dispenser Method: Suction  
Date Tested: / / Next Test Date: / /  
Date Closed: / / Test Method: Not reported  
Updated: True Deleted: False  
Date Inspected: 08/11/1993 Inspector: SIMON  
Result of Inspection: Not reported  
Mailing Name: NIAGARA LUBRICANT CO INC  
Mailing Address: 164 CHANDLER STREET  
BUFFALO, NY 14207  
Mailing Contact: Not reported  
Mailing Telephone: (716) 874-2300  
Owner Mark: First Owner Expiration Date: 05/14/2005  
Certification Flag: False Certification Date: 06/01/2000  
Renew Flag: False Renew Date: / /  
Lat/Long: Not reported  
Dead Letter: False  
Facility Screen: No data missing  
Owner Screen: No data missing  
Tank Screen: No data missing  
Town or City: BUFFALO (C)  
Town or City Code: 02  
County Code: 14  
Region: 9  
Fiscal Amount for Registration Fee is Correct: True

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation    Site

MAP FINDINGS

Database(s)  
EDR ID Number  
EPA ID Number

NIAGARA LUBRICANT CO INC (Continued)

U003318611

PBS Number: 9-502766 CBS Number: Not reported  
SPDES Number: Not reported SWIS Code: -1402  
Federal ID: Not reported Previous PBS#: Not reported  
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.  
Facility Type: STORAGE TERMINAL/PETROLEUM DISTRIBUTOR  
Owner Type: Corporate/Commercial  
Owner Sub Type: Not reported  
Owner: NIAGARA LUBRICANT CO INC  
164 CHANDLER STREET  
BUFFALO, NY 14207  
Owner Phone: (716) 874-2300  
Facility Phone: (716) 874-2300  
Operator: NIAGARA LUBRICANT CO INC  
Emergency Name: THOMAS R MCLEOD  
Emergency Phone: (716) 662-2741  
Total Tanks: 53  
Total Capacity: 262425  
Tank ID: B10  
Capacity (Gal): 3200  
Missing Data for Tank : No data missing  
Tank Location: ABOVEGROUND  
Product Stored: LUBE OIL  
Tank Type: Steel/carbon steel  
Install Date: / /  
Tank Internal: NONE  
Tank External: PAINTED/ASPHALT COATING/NONE  
Tank Containment: CONCRETE DIKE/NONE  
Pipe Type: STEEL/IRON  
Pipe Location: Aboveground  
Pipe Internal: NONE  
Pipe External: NONE/NONE  
Leak Detection: NONE/NONE  
Overfill Protection: None  
Dispenser Method: Suction  
Date Tested: / / Next Test Date: / /  
Date Closed: / / Test Method: Not reported  
Updated: True Deleted: False  
Date Inspected: 08/11/1993 Inspector: SIMON  
Result of Inspection: Not reported  
Mailing Name: NIAGARA LUBRICANT CO INC  
Mailing Address: 164 CHANDLER STREET  
BUFFALO, NY 14207  
Mailing Contact: Not reported  
Mailing Telephone: (716) 874-2300  
Owner Mark: First Owner  
Certification Flag: False Expiration Date: 05/14/2005  
Renew Flag: False Certification Date: 06/01/2000  
Lat/Long: Not reported Renew Date: / /  
Dead Letter: False  
Facility Screen: No data missing  
Owner Screen: No data missing  
Tank Screen: No data missing  
Town or City: BUFFALO (C)  
Town or City Code: 02  
County Code: 14

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation Site

MAP FINDINGS

Database(s)  
EDR ID Number  
EPA ID Number

NIAGARA LUBRICANT CO INC (Continued)

U003318611

Region: 9  
Fiscal Amount for Registration Fee is Correct: True

PBS Number: 9-502766 CBS Number: Not reported  
SPDES Number: Not reported SWIS Code: 1402  
Federal ID: Not reported Previous PBS#: Not reported  
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.  
Facility Type: STORAGE TERMINAL/PETROLEUM DISTRIBUTOR  
Owner Type: Corporate/Commercial  
Owner Sub Type: Not reported  
Owner: NIAGARA LUBRICANT CO INC  
164 CHANDLER STREET  
BUFFALO, NY 14207  
Owner Phone: (716) 874-2300  
Facility Phone: (716) 874-2300  
Operator: NIAGARA LUBRICANT CO INC  
Emergency Name: THOMAS R MCLEOD  
Emergency Phone: (716) 662-2741  
Total Tanks: 53  
Total Capacity: 262425  
Tank ID: B11  
Capacity (Gal): 3100  
Missing Data for Tank : No data missing  
Tank Location: ABOVEGROUND  
Product Stored: LUBE OIL  
Tank Type: Steel/carbon steel  
Install Date: / /  
Tank Internal: NONE  
Tank External: PAINTED/ASPHALT COATING/NONE  
Tank Containment: CONCRETE DIKE/NONE  
Pipe Type: STEEL/IRON  
Pipe Location: Aboveground  
Pipe Internal: NONE  
Pipe External: NONE/NONE  
Leak Detection: NONE/NONE  
Overfill Protection: None  
Dispenser Method: Suction  
Date Tested: / /  
Date Closed: / /  
Updated: True  
Date Inspected: 08/11/1993  
Result of Inspection: Not reported  
Mailing Name: NIAGARA LUBRICANT CO INC  
Mailing Address: 164 CHANDLER STREET  
BUFFALO, NY 14207  
Mailing Contact: Not reported  
Mailing Telephone: (716) 874-2300  
Owner Mark: First Owner  
Certification Flag: False  
Renew Flag: False  
Lat/Long: Not reported  
Dead Letter: False  
Facility Screen: No data missing  
Owner Screen: No data missing  
Tank Screen: No data missing  
Town or City: BUFFALO (C)

Next Test Date: / /  
Test Method: Not reported  
Deleted: False  
Inspector: SIMON  
Expiration Date: 05/14/2005  
Certification Date: 06/01/2000  
Renew Date: / /

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

NIAGARA LUBRICANT CO INC (Continued)

EDR ID Number  
EPA ID Number

Database(s)

U003318611

Town or City Code: 02  
County Code: 14  
Region: 9  
Fiscal Amount for Registration Fee is Correct: True

PBS Number: 9-502766  
SPDES Number: Not reported  
Federal ID: Not reported  
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

CBS Number: Not reported  
SWIS Code: 1402  
Previous PBS#: Not reported

Facility Type: STORAGE TERMINAL/PETROLEUM DISTRIBUTOR  
Owner Type: Corporate/Commercial  
Owner Sub Type: Not reported  
Owner: NIAGARA LUBRICANT CO INC  
164 CHANDLER STREET  
BUFFALO, NY 14207

Owner Phone: (716) 874-2300  
Facility Phone: (716) 874-2300  
Operator: NIAGARA LUBRICANT CO INC  
Emergency Name: THOMAS R MCLEOD  
Emergency Phone: (716) 662-2741  
Total Tanks: 53  
Total Capacity: 262425  
Tank ID: B12  
Capacity (Gal): 3100  
Missing Data for Tank : No data missing  
Tank Location: ABOVEGROUND  
Product Stored: LUBE OIL  
Tank Type: Steel/carbon steel  
Install Date: / /  
Tank Internal: NONE  
Tank External: PAINTED/ASPHALT COATING/NONE  
Tank Containment: CONCRETE DIKE/NONE  
Pipe Type: STEEL/IRON  
Pipe Location: Aboveground  
Pipe Internal: NONE  
Pipe External: NONE/NONE  
Leak Detection: NONE/NONE  
Overfill Protection: None  
Dispenser Method: Suction  
Date Tested: / /  
Date Closed: / /  
Updated: True  
Date Inspected: 08/11/1993  
Result of Inspection: Not reported  
Mailing Name: NIAGARA LUBRICANT CO INC  
Mailing Address: 164 CHANDLER STREET  
BUFFALO, NY 14207  
Mailing Contact: Not reported  
Mailing Telephone: (716) 874-2300  
Owner Mark: First Owner  
Certification Flag: False  
Renew Flag: False  
Lat/Long: Not reported  
Dead Letter: False  
Facility Screen: No data missing  
Owner Screen: No data missing

Next Test Date: / /  
Test Method: Not reported  
Deleted: False  
Inspector: SIMON

Expiration Date: 05/14/2005  
Certification Date: 06/01/2000  
Renew Date: / /

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
EPA ID Number

NIAGARA LUBRICANT CO INC (Continued)

U003318611

Tank Screen: No data missing  
Town or City: BUFFALO (C)  
Town or City Code: 02  
County Code: 14  
Region: 9  
Fiscal Amount for Registration Fee is Correct: True

PBS Number: 9-502766 CBS Number: Not reported  
SPDES Number: Not reported SWIS Code: 1402  
Federal ID: Not reported Previous PBS#: Not reported  
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

Facility Type: STORAGE TERMINAL/PETROLEUM DISTRIBUTOR  
Owner Type: Corporate/Commercial  
Owner Sub Type: Not reported  
Owner: NIAGARA LUBRICANT CO INC

164 CHANDLER STREET  
BUFFALO, NY 14207

Owner Phone: (716) 874-2300  
Facility Phone: (716) 874-2300  
Operator: NIAGARA LUBRICANT CO INC  
Emergency Name: THOMAS R MCLEOD  
Emergency Phone: (716) 662-2741

Total Tanks: 53

Total Capacity: 262425

Tank ID: B13

Capacity (Gal): 3100

Missing Data for Tank : No data missing

Tank Location: ABOVEGROUND

Product Stored: LUBE OIL

Tank Type: Steel/carbon steel

Install Date: / /

Tank Internal: NONE

Tank External: PAINTED/ASPHALT COATING/NONE

Tank Containment: CONCRETE DIKE/NONE

Pipe Type: STEEL/IRON

Pipe Location: Aboveground

Pipe Internal: NONE

Pipe External: NONE/NONE

Leak Detection: NONE/NONE

Overfill Protection: None

Dispenser Method: Suction

Date Tested: / /

Date Closed: / /

Updated: True

Date Inspected: 08/11/1993

Result of Inspection: Not reported

Mailing Name: NIAGARA LUBRICANT CO INC

Mailing Address: 164 CHANDLER STREET

BUFFALO, NY 14207

Mailing Contact: Not reported

Mailing Telephone: (716) 874-2300

Owner Mark: First Owner

Certification Flag: False

Renew Flag: False

Lat/Long: Not reported

Dead Letter: False

Next Test Date: / /

Test Method: Not reported

Deleted: False

Inspector: SIMON

Expiration Date: 05/14/2005

Certification Date: 06/01/2000

Renew Date: / /

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

Site

MAP FINDINGS

Database(s)

EDR ID Number  
EPA ID Number

NIAGARA LUBRICANT CO INC (Continued)

U003318611

Facility Screen: No data missing  
Owner Screen: No data missing  
Tank Screen: No data missing  
Town or City: BUFFALO (C)  
Town or City Code: 02  
County Code: 14  
Region: 9  
Fiscal Amount for Registration Fee is Correct: True

PBS Number: 9-502766  
SPDES Number: Not reported  
Federal ID: Not reported  
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

CBS Number: Not reported  
SWIS Code: 1402  
Previous PBS#: Not reported

Facility Type: STORAGE TERMINAL/PETROLEUM DISTRIBUTOR  
Owner Type: Corporate/Commercial  
Owner Sub Type: Not reported  
Owner: NIAGARA LUBRICANT CO INC

164 CHANDLER STREET  
BUFFALO, NY 14207

Owner Phone: (716) 874-2300  
Facility Phone: (716) 874-2300  
Operator: NIAGARA LUBRICANT CO INC  
Emergency Name: THOMAS R MCLEOD  
Emergency Phone: (716) 662-2741

Total Tanks: 53  
Total Capacity: 262425  
Tank ID: T39  
Capacity (Gal): 6700  
Missing Data for Tank : No data missing  
Tank Location: ABOVEGROUND  
Product Stored: LUBE OIL  
Tank Type: Steel/carbon steel  
Install Date: / /  
Tank Internal: NONE  
Tank External: PAINTED/ASPHALT COATING/NONE  
Tank Containment: NONE/NONE  
Pipe Type: STEEL/IRON  
Pipe Location: Aboveground  
Pipe Internal: NONE  
Pipe External: NONE/NONE  
Leak Detection: NONE/NONE

Overfill Protection: Product Level Gauge, None  
Dispenser Method: Suction

Date Tested: / /  
Date Closed: / /  
Updated: True

Next Test Date: / /  
Test Method: Not reported  
Deleted: False  
Inspector: SIMON

Date Inspected: 08/11/1993  
Result of Inspection: Not reported  
Mailing Name: NIAGARA LUBRICANT CO INC  
Mailing Address: 164 CHANDLER STREET  
BUFFALO, NY 14207

Mailing Contact: Not reported  
Mailing Telephone: (716) 874-2300  
Owner Mark: First Owner  
Certification Flag: False  
Renew Flag: False

Expiration Date: 05/14/2005  
Certification Date: 06/01/2000  
Renew Date: / /



Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

NIAGARA LUBRICANT CO INC (Continued)

EDR ID Number  
EPA ID Number

Database(s)

U003318611

Lat/Long: Not reported  
Dead Letter: False  
Facility Screen: No data missing  
Owner Screen: No data missing  
Tank Screen: No data missing  
Town or City: BUFFALO (C)  
Town or City Code: 02  
County Code: 14  
Region: 9  
Fiscal Amount for Registration Fee is Correct: True

PBS Number: 9-502766  
SPDES Number: Not reported  
Federal ID: Not reported  
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

CBS Number: Not reported  
SWIS Code: 1402  
Previous PBS#: Not reported

Facility Type: STORAGE TERMINAL/PETROLEUM DISTRIBUTOR

Owner Type: Corporate/Commercial  
Owner Sub Type: Not reported  
Owner: NIAGARA LUBRICANT CO INC  
164 CHANDLER STREET  
BUFFALO, NY 14207

Owner Phone: (716) 874-2300  
Facility Phone: (716) 874-2300  
Operator: NIAGARA LUBRICANT CO INC  
Emergency Name: THOMAS R MCLEOD  
Emergency Phone: (716) 662-2741

Total Tanks: 53  
Total Capacity: 262425  
Tank ID: T40  
Capacity (Gal): 6700  
Missing Data for Tank : No data missing  
Tank Location: ABOVEGROUND  
Product Stored: LUBE OIL  
Tank Type: Steel/carbon steel  
Install Date: / /

Tank Internal: NONE  
Tank External: PAINTED/ASPHALT COATING/NONE  
Tank Containment: NONE/NONE  
Pipe Type: STEEL/IRON  
Pipe Location: Aboveground  
Pipe Internal: NONE  
Pipe External: NONE/NONE  
Leak Detection: NONE/NONE

Overfill Protection: Product Level Gauge, None  
Dispenser Method: Suction

Date Tested: / /

Date Closed: / /

Updated: True

Date Inspected: 08/11/1993

Result of Inspection: Not reported

Mailing Name: NIAGARA LUBRICANT CO INC  
Mailing Address: 164 CHANDLER STREET  
BUFFALO, NY 14207

Mailing Contact: Not reported  
Mailing Telephone: (716) 874-2300

Owner Mark: First Owner

Next Test Date: / /

Test Method: Not reported

Deleted: False

Inspector: SIMON

Expiration Date: 05/14/2005

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation     Site

MAP FINDINGS

Database(s)  
EDR ID Number  
EPA ID Number

NIAGARA LUBRICANT CO INC (Continued)

U003318611

Certification Flag:	False	Certification Date:	06/01/2000
Renew Flag:	False	Renew Date:	/ /
Lat/Long:	Not reported		
Dead Letter:	False		
Facility Screen:	No data missing		
Owner Screen:	No data missing		
Tank Screen:	No data missing		
Town or City:	BUFFALO (C)		
Town or City Code:	02		
County Code:	14		
Region:	9		
Fiscal Amount for Registration Fee is Correct:	True		
PBS Number:	9-502766	CBS Number:	Not reported
SPDES Number:	Not reported	SWIS Code:	1402
Federal ID:	Not reported	Previous PBS#:	Not reported
Facility Status:	1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.		
Facility Type:	STORAGE TERMINAL/PETROLEUM DISTRIBUTOR		
Owner Type:	Corporate/Commercial		
Owner Sub Type:	Not reported		
Owner:	NIAGARA LUBRICANT CO INC 164 CHANDLER STREET BUFFALO, NY 14207		
Owner Phone:	(716) 874-2300		
Facility Phone:	(716) 874-2300		
Operator:	NIAGARA LUBRICANT CO INC		
Emergency Name:	THOMAS R MCLEOD		
Emergency Phone:	(716) 662-2741		
Total Tanks:	53		
Total Capacity:	262425		
Tank ID:	T41		
Capacity (Gal):	13000		
Missing Data for Tank :	No data missing		
Tank Location:	ABOVEGROUND		
Product Stored:	LUBE OIL		
Tank Type:	Steel/carbon steel		
Install Date:	/ /		
Tank Internal:	NONE		
Tank External:	PAINTED/ASPHALT COATING/NONE		
Tank Containment:	NONE/NONE		
Pipe Type:	STEEL/IRON		
Pipe Location:	Aboveground		
Pipe Internal:	NONE		
Pipe External:	NONE/NONE		
Leak Detection:	NONE/NONE		
Overfill Protection:	Product Level Gauge, None		
Dispenser Method:	Suction		
Date Tested:	/ /		
Date Closed:	/ /		
Updated:	True		
Date Inspected:	08/11/1993		
Result of Inspection:	Not reported		
Mailing Name:	NIAGARA LUBRICANT CO INC		
Mailing Address:	164 CHANDLER STREET BUFFALO, NY 14207		
Mailing Contact:	Not reported		
		Next Test Date:	/ /
		Test Method:	Not reported
		Deleted:	False
		Inspector:	SIMON

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

NIAGARA LUBRICANT CO INC (Continued)

EDR ID Number  
EPA ID Number

Database(s)

U003318611

Mailing Telephone: (716) 874-2300  
Owner Mark: First Owner  
Certification Flag: False  
Renew Flag: False  
Lat/Long: Not reported  
Dead Letter: False  
Facility Screen: No data missing  
Owner Screen: No data missing  
Tank Screen: No data missing  
Town or City: BUFFALO (C)  
Town or City Code: 02  
County Code: 14  
Region: 9  
Fiscal Amount for Registration Fee is Correct: True

PBS Number: 9-502766  
SPDES Number: Not reported  
Federal ID: Not reported  
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

CBS Number: Not reported  
SWIS Code: 1402  
Previous PBS#: Not reported

Facility Type: STORAGE TERMINAL/PETROLEUM DISTRIBUTOR  
Owner Type: Corporate/Commercial  
Owner Sub Type: Not reported  
Owner: NIAGARA LUBRICANT CO INC  
164 CHANDLER STREET  
BUFFALO, NY 14207

Owner Phone: (716) 874-2300  
Facility Phone: (716) 874-2300  
Operator: NIAGARA LUBRICANT CO INC  
Emergency Name: THOMAS R MCLEOD  
Emergency Phone: (716) 662-2741  
Total Tanks: 53  
Total Capacity: 262425  
Tank ID: Y46  
Capacity (Gal): 20000  
Missing Data for Tank : No data missing  
Tank Location: ABOVEGROUND  
Product Stored: EMPTY  
Tank Type: Steel/carbon steel  
Install Date: / /  
Tank Internal: NONE  
Tank External: PAINTED/ASPHALT COATING/NONE  
Tank Containment: CONCRETE DIKE/NONE  
Pipe Type: STEEL/IRON  
Pipe Location: Aboveground  
Pipe Internal: NONE  
Pipe External: NONE/NONE  
Leak Detection: NONE/NONE  
Overfill Protection: None  
Dispenser Method: Suction  
Date Tested: / /  
Date Closed: / /  
Updated: True  
Date Inspected: 08/11/1993  
Result of Inspection: Not reported  
Mailing Name: NIAGARA LUBRICANT CO INC  
Mailing Address: 164 CHANDLER STREET

Next Test Date: / /  
Test Method: Not reported  
Deleted: False  
Inspector: SIMON

## MAP FINDINGS

**U003318611**

Next Test Date: / /  
Test Method: Not reported  
Deleted: False  
Inspector: SIMON

Map ID  
Direction  
Distance

MAP FINDINGS

Elevation Site

Database(s)

EDR ID Number  
EPA ID Number

NIAGARA LUBRICANT CO INC (Continued)

U003318611

Mailing Name: NIAGARA LUBRICANT CO INC  
Mailing Address: 164 CHANDLER STREET  
BUFFALO, NY 14207  
Mailing Contact: Not reported  
Mailing Telephone: (716) 874-2300  
Owner Mark: First Owner  
Certification Flag: False  
Renew Flag: False  
Lat/Long: Not reported  
Dead Letter: False  
Facility Screen: No data missing  
Owner Screen: No data missing  
Tank Screen: No data missing  
Town or City: BUFFALO (C)  
Town or City Code: 02  
County Code: 14  
Region: 9  
Expiration Date: 05/14/2005  
Certification Date: 06/01/2000  
Renew Date: / /  
Fiscal Amount for Registration Fee is Correct: True  
PBS Number: 9-502766  
SPDES Number: Not reported  
Federal ID: Not reported  
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.  
CBS Number: Not reported  
SWIS Code: 1402  
Previous PBS#: Not reported  
Facility Type: STORAGE TERMINAL/PETROLEUM DISTRIBUTOR  
Owner Type: Corporate/Commercial  
Owner Sub Type: Not reported  
Owner: NIAGARA LUBRICANT CO INC  
164 CHANDLER STREET  
BUFFALO, NY 14207  
Owner Phone: (716) 874-2300  
Facility Phone: (716) 874-2300  
Operator: NIAGARA LUBRICANT CO INC  
Emergency Name: THOMAS R MCLEOD  
Emergency Phone: (716) 662-2741  
Total Tanks: 53  
Total Capacity: 262425  
Tank ID: Y44  
Capacity (Gal): 12000  
Missing Data for Tank : No data missing  
Tank Location: ABOVEGROUND  
Product Stored: EMPTY  
Tank Type: Steel/carbon steel  
Install Date: / /  
Tank Internal: NONE  
Tank External: PAINTED/ASPHALT COATING/NONE  
Tank Containment: CONCRETE DIKE/NONE  
Pipe Type: STEEL/IRON  
Pipe Location: Aboveground  
Pipe Internal: NONE  
Pipe External: NONE/NONE  
Leak Detection: NONE/NONE  
Overfill Protection: None  
Dispenser Method: Suction  
Date Tested: / /  
Date Closed: / /  
Updated: True  
Next Test Date: / /  
Test Method: Not reported  
Deleted: False

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

NIAGARA LUBRICANT CO INC (Continued)

EDR ID Number  
EPA ID Number

Database(s)

U003318611

Date Inspected: 08/11/1993 Inspector: SIMON  
Result of Inspection: Not reported  
Mailing Name: NIAGARA LUBRICANT CO INC  
Mailing Address: 164 CHANDLER STREET  
BUFFALO, NY 14207  
Mailing Contact: Not reported  
Mailing Telephone: (716) 874-2300  
Owner Mark: First Owner Expiration Date: 05/14/2005  
Certification Flag: False Certification Date: 06/01/2000  
Renew Flag: False Renew Date: / /  
Lat/Long: Not reported  
Dead Letter: False  
Facility Screen: No data missing  
Owner Screen: No data missing  
Tank Screen: No data missing  
Town or City: BUFFALO (C)  
Town or City Code: 02  
County Code: 14  
Region: 9  
Fiscal Amount for Registration Fee is Correct: True  
PBS Number: 9-502766 CBS Number: Not reported  
SPDES Number: Not reported SWIS Code: 1402  
Federal ID: Not reported Previous PBS#: Not reported  
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than  
1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.  
Facility Type: STORAGE TERMINAL/PETROLEUM DISTRIBUTOR  
Owner Type: Corporate/Commercial  
Owner Sub Type: Not reported  
Owner: NIAGARA LUBRICANT CO INC  
164 CHANDLER STREET  
BUFFALO, NY 14207  
Owner Phone: (716) 874-2300  
Facility Phone: (716) 874-2300  
Operator: NIAGARA LUBRICANT CO INC  
Emergency Name: THOMAS R MCLEOD  
Emergency Phone: (716) 662-2741  
Total Tanks: 53  
Total Capacity: 262425  
Tank ID: Y43  
Capacity (Gal): 12000  
Missing Data for Tank : No data missing  
Tank Location: ABOVEGROUND  
Product Stored: EMPTY  
Tank Type: Steel/carbon steel  
Install Date: / /  
Tank Internal: NONE  
Tank External: PAINTED/ASPHALT COATING/NONE  
Tank Containment: CONCRETE DIKE/NONE  
Pipe Type: STEEL/IRON  
Pipe Location: Aboveground  
Pipe Internal: NONE  
Pipe External: NONE/NONE  
Leak Detection: NONE/NONE  
Overfill Protection: None  
Dispenser Method: Suction  
Date Tested: / / Next Test Date: / /

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

NIAGARA LUBRICANT CO INC (Continued)

EDR ID Number  
EPA ID Number

Database(s)

U003318611

Date Closed: / /  
Updated: True  
Date Inspected: 08/11/1993  
Result of Inspection: Not reported  
Mailing Name: NIAGARA LUBRICANT CO INC  
Mailing Address: 164 CHANDLER STREET  
BUFFALO, NY 14207  
Mailing Contact: Not reported  
Mailing Telephone: (716) 874-2300  
Owner Mark: First Owner  
Certification Flag: False  
Renew Flag: False  
Lat/Long: Not reported  
Dead Letter: False  
Facility Screen: No data missing  
Owner Screen: No data missing  
Tank Screen: No data missing  
Town or City: BUFFALO (C)  
Town or City Code: 02  
County Code: 14  
Region: 9  
Expiration Date: 05/14/2005  
Certification Date: 06/01/2000  
Renew Date: / /  
Fiscal Amount for Registration Fee is Correct: True

PBS Number: 9-502766  
SPDES Number: Not reported  
Federal ID: Not reported  
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.  
CBS Number: Not reported  
SWIS Code: 1402  
Previous PBS#: Not reported  
Facility Type: STORAGE TERMINAL/PETROLEUM DISTRIBUTOR  
Owner Type: Corporate/Commercial  
Owner Sub Type: Not reported  
Owner: NIAGARA LUBRICANT CO INC  
164 CHANDLER STREET  
BUFFALO, NY 14207  
Owner Phone: (716) 874-2300  
Facility Phone: (716) 874-2300  
Operator: NIAGARA LUBRICANT CO INC  
Emergency Name: THOMAS R MCLEOD  
Emergency Phone: (716) 662-2741  
Total Tanks: 53  
Total Capacity: 262425  
Tank ID: F14  
Capacity (Gal): 1900  
Missing Data for Tank : No data missing  
Tank Location: ABOVEGROUND  
Product Stored: LUBE OIL  
Tank Type: Steel/carbon steel  
Install Date: / /  
Tank Internal: NONE  
Tank External: PAINTED/ASPHALT COATING/NONE  
Tank Containment: NONE/NONE  
Pipe Type: STEEL/IRON  
Pipe Location: Aboveground  
Pipe Internal: NONE  
Pipe External: NONE/NONE  
Leak Detection: NONE/NONE  
Overfill Protection: Product Level Gauge, None

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

Site

MAP FINDINGS

Database(s)

EDR ID Number  
EPA ID Number

NIAGARA LUBRICANT CO INC (Continued)

U003318611

Dispenser Method:	Suction	Next Test Date:	/ /
Date Tested:	/ /	Test Method:	Not reported
Date Closed:	/ /	Deleted:	False
Updated:	True	Inspector:	SIMON
Date Inspected:	08/11/1993		
Result of Inspection:	Not reported		
Mailing Name:	NIAGARA LUBRICANT CO INC		
Mailing Address:	164 CHANDLER STREET		
	BUFFALO, NY 14207		
Mailing Contact:	Not reported		
Mailing Telephone:	(716) 874-2300	Expiration Date:	05/14/2005
Owner Mark:	First Owner	Certification Date:	06/01/2000
Certification Flag:	False	Renew Date:	/ /
Renew Flag:	False		
Lat/Long:	Not reported		
Dead Letter:	False		
Facility Screen:	No data missing		
Owner Screen:	No data missing		
Tank Screen:	No data missing		
Town or City:	BUFFALO (C)		
Town or City Code:	02		
County Code:	14		
Region:	9		
Fiscal Amount for Registration Fee is Correct:	True		
PBS Number:	9-502766	CBS Number:	Not reported
SPDES Number:	Not reported	SWIS Code:	1402
Federal ID:	Not reported	Previous PBS#:	Not reported
Facility Status:	1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.		
Facility Type:	STORAGE TERMINAL/PETROLEUM DISTRIBUTOR		
Owner Type:	Corporate/Commercial		
Owner Sub Type:	Not reported		
Owner:	NIAGARA LUBRICANT CO INC		
	164 CHANDLER STREET		
	BUFFALO, NY 14207		
Owner Phone:	(716) 874-2300		
Facility Phone:	(716) 874-2300		
Operator:	NIAGARA LUBRICANT CO INC		
Emergency Name:	THOMAS R MCLEOD		
Emergency Phone:	(716) 662-2741		
Total Tanks:	53		
Total Capacity:	262425		
Tank ID:	F15		
Capacity (Gal):	4100		
Missing Data for Tank :	No data missing		
Tank Location:	ABOVEGROUND		
Product Stored:	LUBE OIL		
Tank Type:	Steel/carbon steel		
Install Date:	/ /		
Tank Internal:	NONE		
Tank External:	PAINTED/ASPHALT COATING/NONE		
Tank Containment:	NONE/NONE		
Pipe Type:	STEEL/IRON		
Pipe Location:	Aboveground		
Pipe Internal:	NONE		
Pipe External:	NONE/NONE		



Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

Site

MAP FINDINGS

Database(s)

EDR ID Number

EPA ID Number

NIAGARA LUBRICANT CO INC (Continued)

U003318611

Leak Detection:	NONE/NONE	
Overfill Protection:	Product Level Gauge, None	
Dispenser Method:	Suction	
Date Tested:	/ /	Next Test Date: / /
Date Closed:	/ /	Test Method: Not reported
Updated:	True	Deleted: False
Date Inspected:	08/11/1993	Inspector: SIMON
Result of Inspection:	Not reported	
Mailing Name:	NIAGARA LUBRICANT CO INC	
Mailing Address:	164 CHANDLER STREET	
	BUFFALO, NY 14207	
Mailing Contact:	Not reported	
Mailing Telephone:	(716) 874-2300	
Owner Mark:	First Owner	Expiration Date: 05/14/2005
Certification Flag:	False	Certification Date: 06/01/2000
Renew Flag:	False	Renew Date: / /
Lat/Long:	Not reported	
Dead Letter:	False	
Facility Screen:	No data missing	
Owner Screen:	No data missing	
Tank Screen:	No data missing	
Town or City:	BUFFALO (C)	
Town or City Code:	02	
County Code:	14	
Region:	9	
Fiscal Amount for Registration Fee is Correct:	True	
PBS Number:	9-502766	CBS Number: Not reported
SPDES Number:	Not reported	SWIS Code: 1402
Federal ID:	Not reported	Previous PBS#: Not reported
Facility Status:	1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.	
Facility Type:	STORAGE TERMINAL/PETROLEUM DISTRIBUTOR	
Owner Type:	Corporate/Commercial	
Owner Sub Type:	Not reported	
Owner:	NIAGARA LUBRICANT CO INC	
	164 CHANDLER STREET	
	BUFFALO, NY 14207	
Owner Phone:	(716) 874-2300	
Facility Phone:	(716) 874-2300	
Operator:	NIAGARA LUBRICANT CO INC	
Emergency Name:	THOMAS R MCLEOD	
Emergency Phone:	(716) 662-2741	
Total Tanks:	53	
Total Capacity:	262425	
Tank ID:	F16	
Capacity (Gal):	2000	
Missing Data for Tank:	No data missing	
Tank Location:	ABOVEGROUND	
Product Stored:	LUBE OIL	
Tank Type:	Steel/carbon steel	
Install Date:	/ /	
Tank Internal:	NONE	
Tank External:	PAINTED/ASPHALT COATING/NONE	
Tank Containment:	NONE/NONE	
Pipe Type:	STEEL/IRON	
Pipe Location:	Aboveground	

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

NIAGARA LUBRICANT CO INC (Continued)

EDR ID Number  
EPA ID Number

Database(s)

U003318611

Pipe Internal:	NONE	
Pipe External:	NONE/NONE	
Leak Detection:	NONE/NONE	
Overfill Protection:	Product Level Gauge, None	
Dispenser Method:	Suction	
Date Tested:	/ /	Next Test Date: / /
Date Closed:	/ /	Test Method: Not reported
Updated:	True	Deleted: False
Date Inspected:	08/11/1993	Inspector: SIMON
Result of Inspection:	Not reported	
Mailing Name:	NIAGARA LUBRICANT CO INC	
Mailing Address:	164 CHANDLER STREET	
	BUFFALO, NY 14207	
Mailing Contact:	Not reported	
Mailing Telephone:	(716) 874-2300	
Owner Mark:	First Owner	Expiration Date: 05/14/2005
Certification Flag:	False	Certification Date: 06/01/2000
Renew Flag:	False	Renew Date: / /
Lat/Long:	Not reported	
Dead Letter:	False	
Facility Screen:	No data missing	
Owner Screen:	No data missing	
Tank Screen:	No data missing	
Town or City:	BUFFALO (C)	
Town or City Code:	02	
County Code:	14	
Region:	9	
Fiscal Amount for Registration Fee is Correct:	True	
PBS Number:	9-502766	CBS Number: Not reported
SPDES Number:	Not reported	SWIS Code: 1402
Federal ID:	Not reported	Previous PBS#: Not reported
Facility Status:	1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.	
Facility Type:	STORAGE TERMINAL/PETROLEUM DISTRIBUTOR	
Owner Type:	Corporate/Commercial	
Owner Sub Type:	Not reported	
Owner:	NIAGARA LUBRICANT CO INC	
	164 CHANDLER STREET	
	BUFFALO, NY 14207	
Owner Phone:	(716) 874-2300	
Facility Phone:	(716) 874-2300	
Operator:	NIAGARA LUBRICANT CO INC	
Emergency Name:	THOMAS R MCLEOD	
Emergency Phone:	(716) 662-2741	
Total Tanks:	53	
Total Capacity:	262425	
Tank ID:	F17	
Capacity (Gal):	2000	
Missing Data for Tank :	No data missing	
Tank Location:	ABOVEGROUND	
Product Stored:	LUBE OIL	
Tank Type:	Steel/carbon steel	
Install Date:	/ /	
Tank Internal:	NONE	
Tank External:	PAINTED/ASPHALT COATING/NONE	
Tank Containment:	NONE/NONE	

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

Database(s)  
EDR ID Number  
EPA ID Number

NIAGARA LUBRICANT CO INC (Continued)

U003318611

Pipe Type: STEEL/IRON  
Pipe Location: Aboveground  
Pipe Internal: NONE  
Pipe External: NONE/NONE  
Leak Detection: NONE/NONE  
Overfill Protection: Product Level Gauge, None  
Dispenser Method: Suction  
Date Tested: / /  
Date Closed: / /  
Updated: True  
Date Inspected: 08/11/1993  
Result of Inspection: Not reported  
Mailing Name: NIAGARA LUBRICANT CO INC  
Mailing Address: 164 CHANDLER STREET  
BUFFALO, NY 14207  
Mailing Contact: Not reported  
Mailing Telephone: (716) 874-2300  
Owner Mark: First Owner  
Certification Flag: False  
Renew Flag: False  
Lat/Long: Not reported  
Dead Letter: False  
Facility Screen: No data missing  
Owner Screen: No data missing  
Tank Screen: No data missing  
Town or City: BUFFALO (C)  
Town or City Code: 02  
County Code: 14  
Region: 9  
Fiscal Amount for Registration Fee is Correct: True  
Next Test Date: / /  
Test Method: Not reported  
Deleted: False  
Inspector: SIMON  
Expiration Date: 05/14/2005  
Certification Date: 06/01/2000  
Renew Date: / /  
PBS Number: 9-502766  
SPDES Number: Not reported  
Federal ID: Not reported  
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.  
Facility Type: STORAGE TERMINAL/PETROLEUM DISTRIBUTOR  
Owner Type: Corporate/Commercial  
Owner Sub Type: Not reported  
Owner: NIAGARA LUBRICANT CO INC  
164 CHANDLER STREET  
BUFFALO, NY 14207  
Owner Phone: (716) 874-2300  
Facility Phone: (716) 874-2300  
Operator: NIAGARA LUBRICANT CO INC  
Emergency Name: THOMAS R MCLEOD  
Emergency Phone: (716) 662-2741  
Total Tanks: 53  
Total Capacity: 262425  
Tank ID: F18  
Capacity (Gal): 2000  
Missing Data for Tank: No data missing  
Tank Location: ABOVEGROUND  
Product Stored: LUBE OIL  
Tank Type: Steel/carbon steel  
Install Date: / /  
Tank Internal: NONE  
CBS Number: Not reported  
SWIS Code: 1402  
Previous PBS#: Not reported

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

NIAGARA LUBRICANT CO INC (Continued)

EDR ID Number  
EPA ID Number

Database(s)

U003318611

Tank External:	PAINTED/ASPHALT COATING/NONE	
Tank Containment:	NONE/NONE	
Pipe Type:	STEEL/IRON	
Pipe Location:	Aboveground	
Pipe Internal:	NONE	
Pipe External:	NONE/NONE	
Leak Detection:	NONE/NONE	
Overfill Protection:	Product Level Gauge, None	
Dispenser Method:	Suction	
Date Tested:	/ /	Next Test Date: / /
Date Closed:	/ /	Test Method: Not reported
Updated:	True	Deleted: False
Date Inspected:	08/11/1993	Inspector: SIMON
Result of Inspection:	Not reported	
Mailing Name:	NIAGARA LUBRICANT CO INC	
Mailing Address:	164 CHANDLER STREET BUFFALO, NY 14207	
Mailing Contact:	Not reported	
Mailing Telephone:	(716) 874-2300	
Owner Mark:	First Owner	Expiration Date: 05/14/2005
Certification Flag:	False	Certification Date: 06/01/2000
Renew Flag:	False	Renew Date: / /
Lat/Long:	Not reported	
Dead Letter:	False	
Facility Screen:	No data missing	
Owner Screen:	No data missing	
Tank Screen:	No data missing	
Town or City:	BUFFALO (C)	
Town or City Code:	02	
County Code:	14	
Region:	9	
Fiscal Amount for Registration Fee is Correct:	True	
PBS Number:	9-502766	CBS Number: Not reported
SPDES Number:	Not reported	SWIS Code: 1402
Federal ID:	Not reported	Previous PBS#: Not reported
Facility Status:	1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.	
Facility Type:	STORAGE TERMINAL/PETROLEUM DISTRIBUTOR	
Owner Type:	Corporate/Commercial	
Owner Sub Type:	Not reported	
Owner:	NIAGARA LUBRICANT CO INC 164 CHANDLER STREET BUFFALO, NY 14207	
Owner Phone:	(716) 874-2300	
Facility Phone:	(716) 874-2300	
Operator:	NIAGARA LUBRICANT CO INC	
Emergency Name:	THOMAS R MCLEOD	
Emergency Phone:	(716) 662-2741	
Total Tanks:	53	
Total Capacity:	262425	
Tank ID:	F19	
Capacity (Gal):	2000	
Missing Data for Tank:	No data missing	
Tank Location:	ABOVEGROUND	
Product Stored:	LUBE OIL	
Tank Type:	Steel/carbon steel	

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

NIAGARA LUBRICANT CO INC (Continued)

EDR ID Number  
EPA ID Number

Database(s)

U003318611

Install Date: / /  
Tank Internal: NONE  
Tank External: PAINTED/ASPHALT COATING/NONE  
Tank Containment: NONE/NONE  
Pipe Type: STEEL/IRON  
Pipe Location: Aboveground  
Pipe Internal: NONE  
Pipe External: NONE/NONE  
Leak Detection: NONE/NONE  
Overfill Protection: Product Level Gauge, None  
Dispenser Method: Suction  
Date Tested: / /  
Date Closed: / /  
Updated: True  
Date Inspected: 08/11/1993  
Result of Inspection: Not reported  
Mailing Name: NIAGARA LUBRICANT CO INC  
Mailing Address: 164 CHANDLER STREET  
BUFFALO, NY 14207  
Mailing Contact: Not reported  
Mailing Telephone: (716) 874-2300  
Owner Mark: First Owner  
Certification Flag: False  
Renew Flag: False  
Lat/Long: Not reported  
Dead Letter: False  
Facility Screen: No data missing  
Owner Screen: No data missing  
Tank Screen: No data missing  
Town or City: BUFFALO (C)  
Town or City Code: 02  
County Code: 14  
Region: 9  
Fiscal Amount for Registration Fee is Correct: True  
Next Test Date: / /  
Test Method: Not reported  
Deleted: False  
Inspector: SIMON  
Expiration Date: 05/14/2005  
Certification Date: 06/01/2000  
Renew Date: / /  
PBS Number: 9-502766  
SPDES Number: Not reported  
Federal ID: Not reported  
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.  
Facility Type: STORAGE TERMINAL/PETROLEUM DISTRIBUTOR  
Owner Type: Corporate/Commercial  
Owner Sub Type: Not reported  
Owner: NIAGARA LUBRICANT CO INC  
164 CHANDLER STREET  
BUFFALO, NY 14207  
Owner Phone: (716) 874-2300  
Facility Phone: (716) 874-2300  
Operator: NIAGARA LUBRICANT CO INC  
Emergency Name: THOMAS R MCLEOD  
Emergency Phone: (716) 662-2741  
Total Tanks: 53  
Total Capacity: 262425  
Tank ID: F20  
Capacity (Gal): 2000  
Missing Data for Tank : No data missing  
Tank Location: ABOVEGROUND  
CBS Number: Not reported  
SWIS Code: 1402  
Previous PBS#: Not reported

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

NIAGARA LUBRICANT CO INC (Continued)

EDR ID Number  
EPA ID Number

Database(s)

U003318611

Product Stored: LUBE OIL  
Tank Type: Steel/carbon steel  
Install Date: / /  
Tank Internal: NONE  
Tank External: PAINTED/ASPHALT COATING/NONE  
Tank Containment: NONE/NONE  
Pipe Type: STEEL/IRON  
Pipe Location: Aboveground  
Pipe Internal: NONE  
Pipe External: NONE/NONE  
Leak Detection: NONE/NONE  
Overfill Protection: Product Level Gauge, None  
Dispenser Method: Suction  
Date Tested: / /  
Date Closed: / /  
Updated: True  
Date Inspected: 08/11/1993  
Result of Inspection: Not reported  
Mailing Name: NIAGARA LUBRICANT CO INC  
Mailing Address: 164 CHANDLER STREET  
BUFFALO, NY 14207  
Mailing Contact: Not reported  
Mailing Telephone: (716) 874-2300  
Owner Mark: First Owner  
Certification Flag: False  
Renew Flag: False  
Lat/Long: Not reported  
Dead Letter: False  
Facility Screen: No data missing  
Owner Screen: No data missing  
Tank Screen: No data missing  
Town or City: BUFFALO (C)  
Town or City Code: 02  
County Code: 14  
Region: 9  
Fiscal Amount for Registration Fee is Correct: True  
Next Test Date: / /  
Test Method: Not reported  
Deleted: False  
Inspector: SIMON  
Expiration Date: 05/14/2005  
Certification Date: 06/01/2000  
Renew Date: / /  
PBS Number: 9-502766  
SPDES Number: Not reported  
Federal ID: Not reported  
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.  
Facility Type: STORAGE TERMINAL/PETROLEUM DISTRIBUTOR  
Owner Type: Corporate/Commercial  
Owner Sub Type: Not reported  
Owner: NIAGARA LUBRICANT CO INC  
164 CHANDLER STREET  
BUFFALO, NY 14207  
Owner Phone: (716) 874-2300  
Facility Phone: (716) 874-2300  
Operator: NIAGARA LUBRICANT CO INC  
Emergency Name: THOMAS R MCLEOD  
Emergency Phone: (716) 662-2741  
Total Tanks: 53  
Total Capacity: 262425  
Tank ID: F21  
Capacity (Gal): 1900  
CBS Number: Not reported  
SWIS Code: 1402  
Previous PBS#: Not reported

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation    Site

MAP FINDINGS

Database(s)  
EDR ID Number  
EPA ID Number

NIAGARA LUBRICANT CO INC (Continued)

U003318611

Missing Data for Tank : No data missing  
Tank Location: ABOVEGROUND  
Product Stored: LUBE OIL  
Tank Type: Steel/carbon steel  
Install Date: / /  
Tank Internal: NONE  
Tank External: PAINTED/ASPHALT COATING/NONE  
Tank Containment: NONE/NONE  
Pipe Type: STEEL/IRON  
Pipe Location: Aboveground  
Pipe Internal: NONE  
Pipe External: NONE/NONE  
Leak Detection: NONE/NONE  
Overfill Protection: Product Level Gauge, None  
Dispenser Method: Suction  
Date Tested: / /  
Date Closed: / /  
Updated: True  
Date Inspected: 08/11/1993  
Result of Inspection: Not reported  
Mailing Name: NIAGARA LUBRICANT CO INC  
Mailing Address: 164 CHANDLER STREET  
                  BUFFALO, NY 14207  
Mailing Contact: Not reported  
Mailing Telephone: (716) 874-2300  
Owner Mark: First Owner  
Certification Flag: False  
Renew Flag: False  
Lat/Long: Not reported  
Dead Letter: False  
Facility Screen: No data missing  
Owner Screen: No data missing  
Tank Screen: No data missing  
Town or City: BUFFALO (C)  
Town or City Code: 02  
County Code: 14  
Region: 9  
Fiscal Amount for Registration Fee is Correct: True  
Next Test Date: / /  
Test Method: Not reported  
Deleted: False  
Inspector: SIMON  
Expiration Date: 05/14/2005  
Certification Date: 06/01/2000  
Renew Date: / /  
PBS Number: 9-502766  
SPDES Number: Not reported  
Federal ID: Not reported  
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.  
Facility Type: STORAGE TERMINAL/PETROLEUM DISTRIBUTOR  
Owner Type: Corporate/Commercial  
Owner Sub Type: Not reported  
Owner: NIAGARA LUBRICANT CO INC  
          164 CHANDLER STREET  
          BUFFALO, NY 14207  
Owner Phone: (716) 874-2300  
Facility Phone: (716) 874-2300  
Operator: NIAGARA LUBRICANT CO INC  
Emergency Name: THOMAS R MCLEOD  
Emergency Phone: (716) 662-2741  
Total Tanks: 53  
Total Capacity: 262425  
CBS Number: Not reported  
SWIS Code: 1402  
Previous PBS#: Not reported

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

NIAGARA LUBRICANT CO INC (Continued)

EDR ID Number  
EPA ID Number

Database(s)

U003318611

Tank ID:	F22	
Capacity (Gal):	1900	
Missing Data for Tank :	No data missing	
Tank Location:	ABOVEGROUND	
Product Stored:	LUBE OIL	
Tank Type:	Steel/carbon steel	
Install Date:	/ /	
Tank Internal:	NONE	
Tank External:	PAINTED/ASPHALT COATING/NONE	
Tank Containment:	NONE/NONE	
Pipe Type:	STEEL/IRON	
Pipe Location:	Aboveground	
Pipe Internal:	NONE	
Pipe External:	NONE/NONE	
Leak Detection:	NONE/NONE	
Overfill Protection:	Product Level Gauge, None	
Dispenser Method:	Suction	
Date Tested:	/ /	Next Test Date: / /
Date Closed:	/ /	Test Method: Not reported
Updated:	True	Deleted: False
Date Inspected:	08/11/1993	Inspector: SIMON
Result of Inspection:	Not reported	
Mailing Name:	NIAGARA LUBRICANT CO INC	
Mailing Address:	164 CHANDLER STREET BUFFALO, NY 14207	
Mailing Contact:	Not reported	
Mailing Telephone:	(716) 874-2300	
Owner Mark:	First Owner	Expiration Date: 05/14/2005
Certification Flag:	False	Certification Date: 06/01/2000
Renew Flag:	False	Renew Date: / /
Lat/Long:	Not reported	
Dead Letter:	False	
Facility Screen:	No data missing	
Owner Screen:	No data missing	
Tank Screen:	No data missing	
Town or City:	BUFFALO (C)	
Town or City Code:	02	
County Code:	14	
Region:	9	
Fiscal Amount for Registration Fee is Correct:	True	
PBS Number:	9-502766	CBS Number: Not reported
SPDES Number:	Not reported	SWIS Code: 1402
Federal ID:	Not reported	Previous PBS#: Not reported
Facility Status:	1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.	
Facility Type:	STORAGE TERMINAL/PETROLEUM DISTRIBUTOR	
Owner Type:	Corporate/Commercial	
Owner Sub Type:	Not reported	
Owner:	NIAGARA LUBRICANT CO INC 164 CHANDLER STREET BUFFALO, NY 14207	
Owner Phone:	(716) 874-2300	
Facility Phone:	(716) 874-2300	
Operator:	NIAGARA LUBRICANT CO INC	
Emergency Name:	THOMAS R MCLEOD	
Emergency Phone:	(716) 662-2741	



Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
EPA ID Number

NIAGARA LUBRICANT CO INC (Continued)

U003318611

Total Tanks: 53  
Total Capacity: 262425  
Tank ID: B01  
Capacity (Gal): 5600  
Missing Data for Tank : No data missing  
Tank Location: ABOVEGROUND  
Product Stored: LUBE OIL  
Tank Type: Steel/carbon steel  
Install Date: / /  
Tank Internal: NONE  
Tank External: PAINTED/ASPHALT COATING/NONE  
Tank Containment: CONCRETE DIKE/NONE  
Pipe Type: STEEL/IRON  
Pipe Location: Aboveground  
Pipe Internal: NONE  
Pipe External: NONE/NONE  
Leak Detection: NONE/NONE  
Overfill Protection: None  
Dispenser Method: Suction  
Date Tested: / /  
Date Closed: / /  
Updated: True  
Date Inspected: 08/11/1993  
Result of Inspection: Not reported  
Mailing Name: NIAGARA LUBRICANT CO INC  
Mailing Address: 164 CHANDLER STREET  
BUFFALO, NY 14207  
Mailing Contact: Not reported  
Mailing Telephone: (716) 874-2300  
Owner Mark: First Owner  
Certification Flag: False  
Renew Flag: False  
Lat/Long: Not reported  
Dead Letter: False  
Facility Screen: No data missing  
Owner Screen: No data missing  
Tank Screen: No data missing  
Town or City: BUFFALO (C)  
Town or City Code: 02  
County Code: 14  
Region: 9  
Fiscal Amount for Registration Fee is Correct: True  
Next Test Date: / /  
Test Method: Not reported  
Deleted: False  
Inspector: SIMON  
Expiration Date: 05/14/2005  
Certification Date: 06/01/2000  
Renew Date: / /  
PBS Number: 9-502766  
SPDES Number: Not reported  
Federal ID: Not reported  
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.  
Facility Type: STORAGE TERMINAL/PETROLEUM DISTRIBUTOR  
Owner Type: Corporate/Commercial  
Owner Sub Type: Not reported  
Owner: NIAGARA LUBRICANT CO INC  
164 CHANDLER STREET  
BUFFALO, NY 14207  
Owner Phone: (716) 874-2300  
Facility Phone: (716) 874-2300  
Operator: NIAGARA LUBRICANT CO INC  
CBS Number: Not reported  
SWIS Code: 1402  
Previous PBS#: Not reported

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

NIAGARA LUBRICANT CO INC (Continued)

EDR ID Number  
EPA ID Number

Database(s)

U003318611

Emergency Name: THOMAS R MCLEOD  
Emergency Phone: (716) 662-2741  
Total Tanks: 53  
Total Capacity: 262425  
Tank ID: B02  
Capacity (Gal): 5800  
Missing Data for Tank : No data missing  
Tank Location: ABOVEGROUND  
Product Stored: LUBE OIL  
Tank Type: Steel/carbon steel  
Install Date: / /  
Tank Internal: NONE  
Tank External: PAINTED/ASPHALT COATING/NONE  
Tank Containment: CONCRETE DIKE/NONE  
Pipe Type: STEEL/IRON  
Pipe Location: Aboveground  
Pipe Internal: NONE  
Pipe External: NONE/NONE  
Leak Detection: NONE/NONE  
Overfill Protection: None  
Dispenser Method: Suction  
Date Tested: / /  
Date Closed: / /  
Updated: True  
Date Inspected: 08/11/1993  
Result of Inspection: Not reported  
Mailing Name: NIAGARA LUBRICANT CO INC  
Mailing Address: 164 CHANDLER STREET  
BUFFALO, NY 14207  
Mailing Contact: Not reported  
Mailing Telephone: (716) 874-2300  
Owner Mark: First Owner  
Certification Flag: False  
Renew Flag: False  
Lat/Long: Not reported  
Dead Letter: False  
Facility Screen: No data missing  
Owner Screen: No data missing  
Tank Screen: No data missing  
Town or City: BUFFALO (C)  
Town or City Code: 02  
County Code: 14  
Region: 9  
Fiscal Amount for Registration Fee is Correct: True  
Next Test Date: / /  
Test Method: Not reported  
Deleted: False  
Inspector: SIMON  
Expiration Date: 05/14/2005  
Certification Date: 06/01/2000  
Renew Date: / /  
PBS Number: 9-502766  
SPDES Number: Not reported  
Federal ID: Not reported  
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.  
Facility Type: STORAGE TERMINAL/PETROLEUM DISTRIBUTOR  
Owner Type: Corporate/Commercial  
Owner Sub Type: Not reported  
Owner: NIAGARA LUBRICANT CO INC  
164 CHANDLER STREET  
BUFFALO, NY 14207  
Owner Phone: (716) 874-2300  
CBS Number: Not reported  
SWIS Code: 1402  
Previous PBS#: Not reported

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

Site

MAP FINDINGS

Database(s)

EDR ID Number  
EPA ID Number

NIAGARA LUBRICANT CO INC (Continued)

U003318611

Facility Phone: (716) 874-2300  
Operator: NIAGARA LUBRICANT CO INC  
Emergency Name: THOMAS R MCLEOD  
Emergency Phone: (716) 662-2741  
Total Tanks: 53  
Total Capacity: 262425  
Tank ID: B03  
Capacity (Gal): 5800  
Missing Data for Tank : No data missing  
Tank Location: ABOVEGROUND  
Product Stored: LUBE OIL  
Tank Type: Steel/carbon steel  
Install Date: / /  
Tank Internal: NONE  
Tank External: PAINTED/ASPHALT COATING/NONE  
Tank Containment: CONCRETE DIKE/NONE  
Pipe Type: STEEL/IRON  
Pipe Location: Aboveground  
Pipe Internal: NONE  
Pipe External: NONE/NONE  
Leak Detection: NONE/NONE  
Overfill Protection: None  
Dispenser Method: Suction  
Date Tested: / /  
Date Closed: / /  
Updated: True  
Date Inspected: 08/11/1993  
Result of Inspection: Not reported  
Mailing Name: NIAGARA LUBRICANT CO INC  
Mailing Address: 164 CHANDLER STREET  
BUFFALO, NY 14207  
Mailing Contact: Not reported  
Mailing Telephone: (716) 874-2300  
Owner Mark: First Owner  
Certification Flag: False  
Renew Flag: False  
Lat/Long: Not reported  
Dead Letter: False  
Facility Screen: No data missing  
Owner Screen: No data missing  
Tank Screen: No data missing  
Town or City: BUFFALO (C)  
Town or City Code: 02  
County Code: 14  
Region: 9  
Fiscal Amount for Registration Fee is Correct: True  
Next Test Date: / /  
Test Method: Not reported  
Deleted: False  
Inspector: SIMON  
Expiration Date: 05/14/2005  
Certification Date: 06/01/2000  
Renew Date: / /  
PBS Number: 9-502766  
SPDES Number: Not reported  
Federal ID: Not reported  
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.  
Facility Type: STORAGE TERMINAL/PETROLEUM DISTRIBUTOR  
Owner Type: Corporate/Commercial  
Owner Sub Type: Not reported  
Owner: NIAGARA LUBRICANT CO INC  
164 CHANDLER STREET  
CBS Number: Not reported  
SWIS Code: 1402  
Previous PBS#: Not reported

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

NIAGARA LUBRICANT CO INC (Continued)

EDR ID Number  
EPA ID Number

Database(s)

U003318611

Owner Phone: BUFFALO, NY 14207 (716) 874-2300  
Facility Phone: (716) 874-2300  
Operator: NIAGARA LUBRICANT CO INC  
Emergency Name: THOMAS R MCLEOD  
Emergency Phone: (716) 662-2741  
Total Tanks: 53  
Total Capacity: 262425  
Tank ID: B04  
Capacity (Gal): 3800  
Missing Data for Tank : No data missing  
Tank Location: ABOVEGROUND  
Product Stored: LUBE OIL  
Tank Type: Steel/carbon steel  
Install Date: / /  
Tank Internal: NONE  
Tank External: PAINTED/ASPHALT COATING/NONE  
Tank Containment: CONCRETE DIKE/NONE  
Pipe Type: STEEL/IRON  
Pipe Location: Aboveground  
Pipe Internal: NONE  
Pipe External: NONE/NONE  
Leak Detection: NONE/NONE  
Overfill Protection: None  
Dispenser Method: Suction  
Date Tested: / /  
Date Closed: / /  
Updated: True  
Date Inspected: 08/11/1993  
Result of Inspection: Not reported  
Mailing Name: NIAGARA LUBRICANT CO INC  
Mailing Address: 164 CHANDLER STREET  
BUFFALO, NY 14207  
Mailing Contact: Not reported  
Mailing Telephone: (716) 874-2300  
Owner Mark: First Owner  
Certification Flag: False  
Renew Flag: False  
Lat/Long: Not reported  
Dead Letter: False  
Facility Screen: No data missing  
Owner Screen: No data missing  
Tank Screen: No data missing  
Town or City: BUFFALO (C)  
Town or City Code: 02  
County Code: 14  
Region: 9  
Fiscal Amount for Registration Fee is Correct: True  
Next Test Date: / /  
Test Method: Not reported  
Deleted: False  
Inspector: SIMON  
Expiration Date: 05/14/2005  
Certification Date: 06/01/2000  
Renew Date: / /  
PBS Number: 9-502766  
SPDES Number: Not reported  
Federal ID: Not reported  
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.  
Facility Type: STORAGE TERMINAL/PETROLEUM DISTRIBUTOR  
Owner Type: Corporate/Commercial  
Owner Sub Type: Not reported  
CBS Number: Not reported  
SWIS Code: 1402  
Previous PBS#: Not reported

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation    Site

MAP FINDINGS

Database(s)  
EDR ID Number  
EPA ID Number

NIAGARA LUBRICANT CO INC (Continued)

U003318611

Owner: NIAGARA LUBRICANT CO INC  
164 CHANDLER STREET  
BUFFALO, NY 14207  
Owner Phone: (716) 874-2300  
Facility Phone: (716) 874-2300  
Operator: NIAGARA LUBRICANT CO INC  
Emergency Name: THOMAS R MCLEOD  
Emergency Phone: (716) 662-2741  
Total Tanks: 53  
Total Capacity: 262425  
Tank ID: B05  
Capacity (Gal): 3800  
Missing Data for Tank : No data missing  
Tank Location: ABOVEGROUND  
Product Stored: LUBE OIL  
Tank Type: Steel/carbon steel  
Install Date: / /  
Tank Internal: NONE  
Tank External: PAINTED/ASPHALT COATING/NONE  
Tank Containment: CONCRETE DIKE/NONE  
Pipe Type: STEEL/IRON  
Pipe Location: Aboveground  
Pipe Internal: NONE  
Pipe External: NONE/NONE  
Leak Detection: NONE/NONE  
Overfill Protection: None  
Dispenser Method: Suction  
Date Tested: / /  
Date Closed: / /  
Updated: True  
Date Inspected: 08/11/1993  
Result of Inspection: Not reported  
Mailing Name: NIAGARA LUBRICANT CO INC  
Mailing Address: 164 CHANDLER STREET  
BUFFALO, NY 14207  
Mailing Contact: Not reported  
Mailing Telephone: (716) 874-2300  
Owner Mark: First Owner  
Certification Flag: False  
Renew Flag: False  
Lat/Long: Not reported  
Dead Letter: False  
Facility Screen: No data missing  
Owner Screen: No data missing  
Tank Screen: No data missing  
Town or City: BUFFALO (C)  
Town or City Code: 02  
County Code: 14  
Region: 9  
Fiscal Amount for Registration Fee is Correct: True  
Next Test Date: / /  
Test Method: Not reported  
Deleted: False  
Inspector: SIMON  
Expiration Date: 05/14/2005  
Certification Date: 06/01/2000  
Renew Date: / /  
PBS Number: 9-502766  
SPDES Number: Not reported  
Federal ID: Not reported  
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.  
Facility Type: STORAGE TERMINAL/PETROLEUM DISTRIBUTOR  
CBS Number: Not reported  
SWIS Code: 1402  
Previous PBS#: Not reported

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
EPA ID Number

NIAGARA LUBRICANT CO INC (Continued)

U003318611

Owner Type: Corporate/Commercial  
Owner-Sub Type: Not reported  
Owner: NIAGARA LUBRICANT CO INC  
164 CHANDLER STREET  
BUFFALO, NY 14207  
Owner Phone: (716) 874-2300  
Facility Phone: (716) 874-2300  
Operator: NIAGARA LUBRICANT CO INC  
Emergency Name: THOMAS R MCLEOD  
Emergency Phone: (716) 662-2741  
Total Tanks: 53  
Total Capacity: 262425  
Tank ID: B06  
Capacity (Gal): 7900  
Missing Data for Tank : No data missing  
Tank Location: ABOVEGROUND  
Product Stored: LUBE OIL  
Tank Type: Steel/carbon steel  
Install Date: / /  
Tank Internal: NONE  
Tank External: PAINTED/ASPHALT COATING/NONE  
Tank Containment: CONCRETE DIKE/NONE  
Pipe Type: STEEL/IRON  
Pipe Location: Aboveground  
Pipe Internal: NONE  
Pipe External: NONE/NONE  
Leak Detection: NONE/NONE  
Overfill Protection: None  
Dispenser Method: Suction  
Date Tested: / /  
Date Closed: / /  
Updated: True  
Date Inspected: 08/11/1993  
Result of Inspection: Not reported  
Mailing Name: NIAGARA LUBRICANT CO INC  
Mailing Address: 164 CHANDLER STREET  
BUFFALO, NY 14207  
Mailing Contact: Not reported  
Mailing Telephone: (716) 874-2300  
Owner Mark: First Owner  
Certification Flag: False  
Renew Flag: False  
Lat/Long: Not reported  
Dead Letter: False  
Facility Screen: No data missing  
Owner Screen: No data missing  
Tank Screen: No data missing  
Town or City: BUFFALO (C)  
Town or City Code: 02  
County Code: 14  
Region: 9  
Fiscal Amount for Registration Fee is Correct: True  
Next Test Date: / /  
Test Method: Not reported  
Deleted: False  
Inspector: SIMON  
Expiration Date: 05/14/2005  
Certification Date: 06/01/2000  
Renew Date: / /  
PBS Number: 9-502766  
SPDES Number: Not reported  
Federal ID: Not reported  
CBS Number: Not reported  
SWIS Code: 1402  
Previous PBS#: Not reported

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

NIAGARA LUBRICANT CO INC (Continued)

EDR ID Number  
EPA ID Number

Database(s)

U003318611

Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.  
Facility Type: STORAGE TERMINAL/PETROLEUM DISTRIBUTOR  
Owner Type: Corporate/Commercial  
Owner Sub Type: Not reported  
Owner: NIAGARA LUBRICANT CO INC  
164 CHANDLER STREET  
BUFFALO, NY 14207  
Owner Phone: (716) 874-2300  
Facility Phone: (716) 874-2300  
Operator: NIAGARA LUBRICANT CO INC  
Emergency Name: THOMAS R MCLEOD  
Emergency Phone: (716) 662-2741  
Total Tanks: 53  
Total Capacity: 262425  
Tank ID: F23  
Capacity (Gal): 2700  
Missing Data for Tank : No data missing  
Tank Location: ABOVEGROUND  
Product Stored: LUBE OIL  
Tank Type: Steel/carbon steel  
Install Date: 04/01/1990  
Tank Internal: NONE  
Tank External: PAINTED/ASPHALT COATING/NONE  
Tank Containment: NONE/NONE  
Pipe Type: STEEL/IRON  
Pipe Location: Aboveground  
Pipe Internal: NONE  
Pipe External: NONE/NONE  
Leak Detection: NONE/NONE  
Overfill Protection: Product Level Gauge, None  
Dispenser Method: Suction  
Date Tested: / /  
Date Closed: / /  
Updated: True  
Date Inspected: 08/11/1993  
Result of Inspection: Not reported  
Mailing Name: NIAGARA LUBRICANT CO INC  
Mailing Address: 164 CHANDLER STREET  
BUFFALO, NY 14207  
Mailing Contact: Not reported  
Mailing Telephone: (716) 874-2300  
Owner Mark: First Owner  
Certification Flag: False  
Renew Flag: False  
Lat/Long: Not reported  
Dead Letter: False  
Facility Screen: No data missing  
Owner Screen: No data missing  
Tank Screen: No data missing  
Town or City: BUFFALO (C)  
Town or City Code: 02  
County Code: 14  
Region: 9  
Fiscal Amount for Registration Fee is Correct: True

Next Test Date: / /  
Test Method: Not reported  
Deleted: False  
Inspector: SIMON

Expiration Date: 05/14/2005  
Certification Date: 06/01/2000  
Renew Date: / /

PBS Number: 9-502766

CBS Number: Not reported

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation     Site

MAP FINDINGS

Database(s)  
EDR ID Number  
EPA ID Number

NIAGARA LUBRICANT CO INC (Continued)

U003318611

SPDES Number: Not reported  
Federal ID: Not reported  
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.  
Facility Type: STORAGE TERMINAL/PETROLEUM DISTRIBUTOR  
Owner Type: Corporate/Commercial  
Owner Sub Type: Not reported  
Owner: NIAGARA LUBRICANT CO INC  
164 CHANDLER STREET  
BUFFALO, NY 14207  
Owner Phone: (716) 874-2300  
Facility Phone: (716) 874-2300  
Operator: NIAGARA LUBRICANT CO INC  
Emergency Name: THOMAS R MCLEOD  
Emergency Phone: (716) 662-2741  
Total Tanks: 53  
Total Capacity: 262425  
Tank ID: F24  
Capacity (Gal): 2700  
Missing Data for Tank : No data missing  
Tank Location: ABOVEGROUND  
Product Stored: LUBE OIL  
Tank Type: Steel/carbon steel  
Install Date: 04/01/1990  
Tank Internal: NONE  
Tank External: PAINTED/ASPHALT COATING/NONE  
Tank Containment: NONE/NONE  
Pipe Type: STEEL/IRON  
Pipe Location: Aboveground  
Pipe Internal: NONE  
Pipe External: NONE/NONE  
Leak Detection: NONE/NONE  
Overfill Protection: Product Level Gauge, None  
Dispenser Method: Suction  
Date Tested: / /  
Date Closed: / /  
Updated: True  
Date Inspected: 08/11/1993  
Result of Inspection: Not reported  
Mailing Name: NIAGARA LUBRICANT CO INC  
Mailing Address: 164 CHANDLER STREET  
BUFFALO, NY 14207  
Mailing Contact: Not reported  
Mailing Telephone: (716) 874-2300  
Owner Mark: First Owner  
Certification Flag: False  
Renew Flag: False  
Lat/Long: Not reported  
Dead Letter: False  
Facility Screen: No data missing  
Owner Screen: No data missing  
Tank Screen: No data missing  
Town or City: BUFFALO (C)  
Town or City Code: 02  
County Code: 14  
Region: 9  
Fiscal Amount for Registration Fee is Correct: True

SWIS Code: 1402  
Previous PBS#: Not reported  
Next Test Date: / /  
Test Method: Not reported  
Deleted: False  
Inspector: SIMON  
Expiration Date: 05/14/2005  
Certification Date: 06/01/2000  
Renew Date: / /



Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation    Site

MAP FINDINGS

Database(s)    EDR ID Number  
EPA ID Number

NIAGARA LUBRICANT CO INC (Continued)

U003318611

PBS Number:	9-502766	CBS Number:	Not reported
SPDES Number:	Not reported	SWIS Code:	1402
Federal ID:	Not reported	Previous PBS#:	Not reported
Facility Status:	1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.		
Facility Type:	STORAGE TERMINAL/PETROLEUM DISTRIBUTOR		
Owner Type:	Corporate/Commercial		
Owner Sub Type:	Not reported		
Owner:	NIAGARA LUBRICANT CO INC 164 CHANDLER STREET BUFFALO, NY 14207		
Owner Phone:	(716) 874-2300		
Facility Phone:	(716) 874-2300		
Operator:	NIAGARA LUBRICANT CO INC		
Emergency Name:	THOMAS R MCLEOD		
Emergency Phone:	(716) 662-2741		
Total Tanks:	53		
Total Capacity:	262425		
Tank ID:	F25		
Capacity (Gal):	2700		
Missing Data for Tank :	No data missing		
Tank Location:	ABOVEGROUND		
Product Stored:	LUBE OIL		
Tank Type:	Steel/carbon steel		
Install Date:	04/01/1990		
Tank Internal:	NONE		
Tank External:	PAINTED/ASPHALT COATING/NONE		
Tank Containment:	NONE/NONE		
Pipe Type:	STEEL/IRON		
Pipe Location:	Aboveground		
Pipe Internal:	NONE		
Pipe External:	NONE/NONE		
Leak Detection:	NONE/NONE		
Overfill Protection:	Product Level Gauge, None		
Dispenser Method:	Suction		
Date Tested:	/ /		
Date Closed:	/ /		
Updated:	True		
Date Inspected:	08/11/1993		
Result of Inspection:	Not reported		
Mailing Name:	NIAGARA LUBRICANT CO INC		
Mailing Address:	164 CHANDLER STREET BUFFALO, NY 14207		
Mailing Contact:	Not reported		
Mailing Telephone:	(716) 874-2300		
Owner Mark:	First Owner		
Certification Flag:	False		
Renew Flag:	False		
Lat/Long:	Not reported		
Dead Letter:	False		
Facility Screen:	No data missing		
Owner Screen:	No data missing		
Tank Screen:	No data missing		
Town or City:	BUFFALO (C)		
Town or City Code:	02		
County Code:	14		

Next Test Date:	/ /
Test Method:	Not reported
Deleted:	False
Inspector:	SIMON

Expiration Date:	05/14/2005
Certification Date:	06/01/2000
Renew Date:	/ /

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation Site

MAP FINDINGS

Database(s)  
EDR ID Number  
EPA ID Number

NIAGARA LUBRICANT CO INC (Continued)

U003318611

Region: 9  
Fiscal Amount for Registration Fee is Correct: True

PBS Number: 9-502766 CBS Number: Not reported  
SPDES Number: Not reported SWIS Code: 1402  
Federal ID: Not reported Previous PBS#: Not reported  
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.  
Facility Type: STORAGE TERMINAL/PETROLEUM DISTRIBUTOR  
Owner Type: Corporate/Commercial  
Owner Sub Type: Not reported  
Owner: NIAGARA LUBRICANT CO INC  
164 CHANDLER STREET  
BUFFALO, NY 14207  
Owner Phone: (716) 874-2300  
Facility Phone: (716) 874-2300  
Operator: NIAGARA LUBRICANT CO INC  
Emergency Name: THOMAS R MCLEOD  
Emergency Phone: (716) 662-2741  
Total Tanks: 53  
Total Capacity: 262425  
Tank ID: F26  
Capacity (Gal): 2700  
Missing Data for Tank : No data missing  
Tank Location: ABOVEGROUND  
Product Stored: LUBE OIL  
Tank Type: Steel/carbon steel  
Install Date: 04/01/1990  
Tank Internal: NONE  
Tank External: PAINTED/ASPHALT COATING/NONE  
Tank Containment: NONE/NONE  
Pipe Type: STEEL/IRON  
Pipe Location: Aboveground  
Pipe Internal: NONE  
Pipe External: NONE/NONE  
Leak Detection: NONE/NONE  
Overfill Protection: Product Level Gauge, None  
Dispenser Method: Suction  
Date Tested: / /  
Date Closed: / /  
Updated: True  
Date Inspected: 08/11/1993  
Result of Inspection: Not reported  
Mailing Name: NIAGARA LUBRICANT CO INC  
Mailing Address: 164 CHANDLER STREET  
BUFFALO, NY 14207  
Mailing Contact: Not reported  
Mailing Telephone: (716) 874-2300  
Owner Mark: First Owner  
Certification Flag: False  
Renew Flag: False  
Lat/Long: Not reported  
Dead Letter: False  
Facility Screen: No data missing  
Owner Screen: No data missing  
Tank Screen: No data missing  
Town or City: BUFFALO (C)

Next Test Date: / /  
Test Method: Not reported  
Deleted: False  
Inspector: SIMON  
Expiration Date: 05/14/2005  
Certification Date: 06/01/2000  
Renew Date: / /

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation      Site

MAP FINDINGS

Database(s)      EDR ID Number  
EPA ID Number

NIAGARA LUBRICANT CO INC (Continued)

U003318611

Town or City Code: 02  
County Code: 14  
Region: 9  
Fiscal Amount for Registration Fee is Correct: True

PBS Number: 9-502766      CBS Number: Not reported  
SPDES Number: Not reported      SWIS Code: 1402  
Federal ID: Not reported      Previous PBS#: Not reported  
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than  
1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.  
Facility Type: STORAGE TERMINAL/PETROLEUM DISTRIBUTOR  
Owner Type: Corporate/Commercial  
Owner Sub Type: Not reported  
Owner: NIAGARA LUBRICANT CO INC

164 CHANDLER STREET  
BUFFALO, NY 14207  
Owner Phone: (716) 874-2300  
Facility Phone: (716) 874-2300  
Operator: NIAGARA LUBRICANT CO INC  
Emergency Name: THOMAS R MCLEOD  
Emergency Phone: (716) 662-2741  
Total Tanks: 53  
Total Capacity: 262425  
Tank ID: F27  
Capacity (Gal): 2700  
Missing Data for Tank : No data missing  
Tank Location: ABOVEGROUND  
Product Stored: LUBE OIL  
Tank Type: Steel/carbon steel  
Install Date: 04/01/1990  
Tank Internal: NONE  
Tank External: PAINTED/ASPHALT COATING/NONE  
Tank Containment: NONE/NONE  
Pipe Type: STEEL/IRON  
Pipe Location: Aboveground  
Pipe Internal: NONE  
Pipe External: NONE/NONE  
Leak Detection: NONE/NONE  
Overfill Protection: Product Level Gauge, None  
Dispenser Method: Suction  
Date Tested: / /  
Date Closed: / /  
Updated: True  
Date Inspected: 08/11/1993  
Result of Inspection: Not reported  
Mailing Name: NIAGARA LUBRICANT CO INC  
Mailing Address: 164 CHANDLER STREET  
BUFFALO, NY 14207  
Mailing Contact: Not reported  
Mailing Telephone: (716) 874-2300  
Owner Mark: First Owner  
Certification Flag: False  
Renew Flag: False  
Lat/Long: Not reported  
Dead Letter: False  
Facility Screen: No data missing  
Owner Screen: No data missing

Next Test Date: / /  
Test Method: Not reported  
Deleted: False  
Inspector: SIMON

Expiration Date: 05/14/2005  
Certification Date: 06/01/2000  
Renew Date: / /

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

Site

MAP FINDINGS

Database(s)

EDR ID Number  
EPA ID Number

NIAGARA LUBRICANT CO INC (Continued)

U003318611

Tank Screen: No data missing  
Town or City: BUFFALO (C)  
Town or City Code: 02  
County Code: 14  
Region: 9  
Fiscal Amount for Registration Fee is Correct: True

PBS Number: 9-502766  
SPDES Number: Not reported  
Federal ID: Not reported  
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

CBS Number: Not reported  
SWIS Code: 1402  
Previous PBS#: Not reported

Facility Type: STORAGE TERMINAL/PETROLEUM DISTRIBUTOR  
Owner Type: Corporate/Commercial  
Owner Sub Type: Not reported  
Owner: NIAGARA LUBRICANT CO INC

164 CHANDLER STREET  
BUFFALO, NY 14207

Owner Phone: (716) 874-2300  
Facility Phone: (716) 874-2300  
Operator: NIAGARA LUBRICANT CO INC  
Emergency Name: THOMAS R MCLEOD  
Emergency Phone: (716) 662-2741

Total Tanks: 53

Total Capacity: 262425

Tank ID: F28

Capacity (Gal): 2700

Missing Data for Tank : No data missing

Tank Location: ABOVEGROUND

Product Stored: LUBE OIL

Tank Type: Steel/carbon steel

Install Date: 04/01/1990

Tank Internal: NONE

Tank External: PAINTED/ASPHALT COATING/NONE

Tank Containment: NONE/NONE

Pipe Type: STEEL/IRON

Pipe Location: Aboveground

Pipe Internal: NONE

Pipe External: NONE/NONE

Leak Detection: NONE/NONE

Overfill Protection: Product Level Gauge, None

Dispenser Method: Suction

Date Tested: / /

Date Closed: / /

Updated: True

Date Inspected: 08/11/1993

Result of Inspection: Not reported

Mailing Name: NIAGARA LUBRICANT CO INC

Mailing Address: 164 CHANDLER STREET

BUFFALO, NY 14207

Mailing Contact: Not reported

Mailing Telephone: (716) 874-2300

Owner Mark: First Owner

Certification Flag: False

Renew Flag: False

Lat/Long: Not reported

Dead Letter: False

Next Test Date: / /

Test Method: Not reported

Deleted: False

Inspector: SIMON

Expiration Date: 05/14/2005

Certification Date: 06/01/2000

Renew Date: / /

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

Site

MAP FINDINGS

Database(s)  
EDR ID Number  
EPA ID Number

NIAGARA LUBRICANT CO INC (Continued)

U003318611

Facility Screen: No data missing  
Owner Screen: No data missing  
Tank Screen: No data missing  
Town or City: BUFFALO (C)  
Town or City Code: 02  
County Code: 14  
Region: 9  
Fiscal Amount for Registration Fee is Correct: True

PBS Number: 9-502766  
SPDES Number: Not reported  
Federal ID: Not reported  
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

CBS Number: Not reported  
SWIS Code: 1402  
Previous PBS#: Not reported

Facility Type: STORAGE TERMINAL/PETROLEUM DISTRIBUTOR  
Owner Type: Corporate/Commercial  
Owner Sub Type: Not reported  
Owner: NIAGARA LUBRICANT CO INC  
164 CHANDLER STREET  
BUFFALO, NY 14207

Owner Phone: (716) 874-2300  
Facility Phone: (716) 874-2300  
Operator: NIAGARA LUBRICANT CO INC  
Emergency Name: THOMAS R MCLEOD  
Emergency Phone: (716) 662-2741  
Total Tanks: 53  
Total Capacity: 262425  
Tank ID: F29  
Capacity (Gal): 2700  
Missing Data for Tank.: No data missing  
Tank Location: ABOVEGROUND  
Product Stored: LUBE OIL  
Tank Type: Steel/carbon steel  
Install Date: 04/01/1990  
Tank Internal: NONE  
Tank External: PAINTED/ASPHALT COATING/NONE  
Tank Containment: NONE/NONE  
Pipe Type: STEEL/IRON  
Pipe Location: Aboveground  
Pipe Internal: NONE  
Pipe External: NONE/NONE  
Leak Detection: NONE/NONE  
Overfill Protection: Product Level Gauge, None  
Dispenser Method: Suction  
Date Tested: / /  
Date Closed: / /  
Updated: True  
Date Inspected: 08/11/1993  
Result of Inspection: Not reported  
Mailing Name: NIAGARA LUBRICANT CO INC  
Mailing Address: 164 CHANDLER STREET  
BUFFALO, NY 14207  
Mailing Contact: Not reported  
Mailing Telephone: (716) 874-2300  
Owner Mark: First Owner  
Certification Flag: False  
Renew Flag: False

Next Test Date: / /  
Test Method: Not reported  
Deleted: False  
Inspector: SIMON

Expiration Date: 05/14/2005  
Certification Date: 06/01/2000  
Renew Date: / /

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

NIAGARA LUBRICANT CO INC (Continued)

EDR ID Number  
EPA ID Number

Database(s)

U003318611

Lat/Long: Not reported  
Dead Letter: False  
Facility Screen: No data missing  
Owner Screen: No data missing  
Tank Screen: No data missing  
Town or City: BUFFALO (C)  
Town or City Code: 02  
County Code: 14  
Region: 9  
Fiscal Amount for Registration Fee is Correct: True

PBS Number: 9-502766  
SPDES Number: Not reported  
Federal ID: Not reported  
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.  
Facility Type: STORAGE TERMINAL/PETROLEUM DISTRIBUTOR  
Owner Type: Corporate/Commercial  
Owner Sub Type: Not reported  
Owner: NIAGARA LUBRICANT CO INC  
164 CHANDLER STREET  
BUFFALO, NY 14207  
Owner Phone: (716) 874-2300  
Facility Phone: (716) 874-2300  
Operator: NIAGARA LUBRICANT CO INC  
Emergency Name: THOMAS R MCLEOD  
Emergency Phone: (716) 662-2741  
Total Tanks: 53  
Total Capacity: 262425  
Tank ID: F30  
Capacity (Gal): 2700  
Missing Data for Tank : No data missing  
Tank Location: ABOVEGROUND  
Product Stored: LUBE OIL  
Tank Type: Steel/carbon steel  
Install Date: 04/01/1990  
Tank Internal: NONE  
Tank External: PAINTED/ASPHALT COATING/NONE  
Tank Containment: NONE/NONE  
Pipe Type: STEEL/IRON  
Pipe Location: Aboveground  
Pipe Internal: NONE  
Pipe External: NONE/NONE  
Leak Detection: NONE/NONE  
Overfill Protection: Product Level Gauge, None  
Dispenser Method: Suction  
Date Tested: / /  
Date Closed: / /  
Updated: True  
Date Inspected: 08/11/1993  
Result of Inspection: Not reported  
Mailing Name: NIAGARA LUBRICANT CO INC  
Mailing Address: 164 CHANDLER STREET  
BUFFALO, NY 14207  
Mailing Contact: Not reported  
Mailing Telephone: (716) 874-2300  
Owner Mark: First Owner

CBS Number: Not reported  
SWIS Code: 1402  
Previous PBS#: Not reported

Next Test Date: / /  
Test Method: Not reported  
Deleted: False  
Inspector: SIMON

Expiration Date: 05/14/2005

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

Site

MAP FINDINGS

Database(s)  
EDR ID Number  
EPA ID Number

NIAGARA LUBRICANT CO INC (Continued)

U003318611

Certification Flag:	False	Certification Date:	06/01/2000
Renew Flag:	False	Renew Date:	/ /
Lat/Long:	Not reported		
Dead Letter:	False		
Facility Screen:	No data missing		
Owner Screen:	No data missing		
Tank Screen:	No data missing		
Town or City:	BUFFALO (C)		
Town or City Code:	02		
County Code:	14		
Region:	9		
Fiscal Amount for Registration Fee is Correct: True			
PBS Number:	9-502766	CBS Number:	Not reported
SPDES Number:	Not reported	SWIS Code:	1402
Federal ID:	Not reported	Previous PBS#:	Not reported
Facility Status:	1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.		
Facility Type:	STORAGE TERMINAL/PETROLEUM DISTRIBUTOR		
Owner Type:	Corporate/Commercial		
Owner Sub Type:	Not reported		
Owner:	NIAGARA LUBRICANT CO INC 164 CHANDLER STREET BUFFALO, NY 14207		
Owner Phone:	(716) 874-2300		
Facility Phone:	(716) 874-2300		
Operator:	NIAGARA LUBRICANT CO INC		
Emergency Name:	THOMAS R MCLEOD		
Emergency Phone:	(716) 662-2741		
Total Tanks:	53		
Total Capacity:	262425		
Tank ID:	F31		
Capacity (Gal):	2700		
Missing Data for Tank :	No data missing		
Tank Location:	ABOVEGROUND		
Product Stored:	LUBE OIL		
Tank Type:	Steel/carbon steel		
Install Date:	04/01/1990		
Tank Internal:	NONE		
Tank External:	PAINTED/ASPHALT COATING/NONE		
Tank Containment:	NONE/NONE		
Pipe Type:	STEEL/IRON		
Pipe Location:	Aboveground		
Pipe Internal:	NONE		
Pipe External:	NONE/NONE		
Leak Detection:	NONE/NONE		
Overfill Protection:	Product Level Gauge, None		
Dispenser Method:	Suction		
Date Tested:	/ /		
Date Closed:	/ /		
Updated:	True		
Date Inspected:	08/11/1993		
Result of Inspection:	Not reported		
Mailing Name:	NIAGARA LUBRICANT CO INC		
Mailing Address:	164 CHANDLER STREET BUFFALO, NY 14207		
Mailing Contact:	Not reported		
		Next Test Date:	/ /
		Test Method:	Not reported
		Deleted:	False
		Inspector:	SIMON

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation     Site

MAP FINDINGS

Database(s)  
EDR ID Number  
EPA ID Number

NIAGARA LUBRICANT CO INC (Continued)

U003318611

Mailing Telephone: (716) 874-2300  
Owner Mark: First Owner  
Certification Flag: False  
Renew Flag: False  
Lat/Long: Not reported  
Dead Letter: False  
Facility Screen: No data missing  
Owner Screen: No data missing  
Tank Screen: No data missing  
Town or City: BUFFALO (C)  
Town or City Code: 02  
County Code: 14  
Region: 9  
Fiscal Amount for Registration Fee is Correct: True

PBS Number: 9-502766  
SPDES Number: Not reported  
Federal ID: Not reported  
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.

CBS Number: Not reported  
SWIS Code: 1402  
Previous PBS#: Not reported

Facility Type: STORAGE TERMINAL/PETROLEUM DISTRIBUTOR  
Owner Type: Corporate/Commercial  
Owner Sub Type: Not reported  
Owner: NIAGARA LUBRICANT CO INC  
164 CHANDLER STREET  
BUFFALO, NY 14207

Owner Phone: (716) 874-2300  
Facility Phone: (716) 874-2300  
Operator: NIAGARA LUBRICANT CO INC  
Emergency Name: THOMAS R MCLEOD  
Emergency Phone: (716) 662-2741  
Total Tanks: 53  
Total Capacity: 262425  
Tank ID: F32  
Capacity (Gal): 875  
Missing Data for Tank : No data missing  
Tank Location: ABOVEGROUND  
Product Stored: LUBE OIL  
Tank Type: Steel/carbon steel  
Install Date: 04/01/1990  
Tank Internal: NONE  
Tank External: PAINTED/ASPHALT COATING/NONE  
Tank Containment: NONE/NONE  
Pipe Type: STEEL/IRON  
Pipe Location: Aboveground  
Pipe Internal: NONE  
Pipe External: NONE/NONE  
Leak Detection: NONE/NONE  
Overfill Protection: Product Level Gauge, None  
Dispenser Method: Suction  
Date Tested: / /  
Date Closed: / /  
Updated: True  
Date Inspected: 08/11/1993  
Result of Inspection: Not reported  
Mailing Name: NIAGARA LUBRICANT CO INC  
Mailing Address: 164 CHANDLER STREET

Next Test Date: / /  
Test Method: Not reported  
Deleted: False  
Inspector: SIMON



Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation Site

MAP FINDINGS

Database(s)  
EDR ID Number  
EPA ID Number

NIAGARA LUBRICANT CO INC (Continued)

U003318611

BUFFALO, NY 14207  
Mailing Contact: Not reported  
Mailing Telephone: (716) 874-2300  
Owner Mark: First Owner  
Certification Flag: False  
Renew Flag: False  
Lat/Long: Not reported  
Dead Letter: False  
Facility Screen: No data missing  
Owner Screen: No data missing  
Tank Screen: No data missing  
Town or City: BUFFALO (C)  
Town or City Code: 02  
County Code: 14  
Region: 9  
Expiration Date: 05/14/2005  
Certification Date: 06/01/2000  
Renew Date: / /  
Fiscal Amount for Registration Fee is Correct: True  
PBS Number: 9-502766  
SPDES Number: Not reported  
Federal ID: Not reported  
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.  
CBS Number: Not reported  
SWIS Code: 1402  
Previous PBS#: Not reported  
Facility Type: STORAGE TERMINAL/PETROLEUM DISTRIBUTOR  
Owner Type: Corporate/Commercial  
Owner Sub Type: Not reported  
Owner: NIAGARA LUBRICANT CO INC  
164 CHANDLER STREET  
BUFFALO, NY 14207  
Owner Phone: (716) 874-2300  
Facility Phone: (716) 874-2300  
Operator: NIAGARA LUBRICANT CO INC  
Emergency Name: THOMAS R MCLEOD  
Emergency Phone: (716) 662-2741  
Total Tanks: 53  
Total Capacity: 262425  
Tank ID: F33  
Capacity (Gal): 875  
Missing Data for Tank : No data missing  
Tank Location: ABOVEGROUND  
Product Stored: LUBE OIL  
Tank Type: Steel/carbon steel  
Install Date: 04/01/1990  
Tank Internal: NONE  
Tank External: PAINTED/ASPHALT COATING/NONE  
Tank Containment: NONE/NONE  
Pipe Type: STEEL/IRON  
Pipe Location: Aboveground  
Pipe Internal: NONE  
Pipe External: NONE/NONE  
Leak Detection: NONE/NONE  
Overfill Protection: Product Level Gauge, None  
Dispenser Method: Suction  
Date Tested: / /  
Date Closed: / /  
Updated: True  
Date Inspected: 08/11/1993  
Result of Inspection: Not reported  
Next Test Date: / /  
Test Method: Not reported  
Deleted: False  
Inspector: SIMON

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation      Site

MAP FINDINGS

Database(s)  
EDR ID Number  
EPA ID Number

NIAGARA LUBRICANT CO INC (Continued)

U003318611

Mailing Name: NIAGARA LUBRICANT CO INC  
Mailing Address: 164 CHANDLER STREET  
BUFFALO, NY 14207  
Mailing Contact: Not reported  
Mailing Telephone: (716) 874-2300  
Owner Mark: First Owner  
Certification Flag: False  
Renew Flag: False  
Lat/Long: Not reported  
Dead Letter: False  
Facility Screen: No data missing  
Owner Screen: No data missing  
Tank Screen: No data missing  
Town or City: BUFFALO (C)  
Town or City Code: 02  
County Code: 14  
Region: 9  
Expiration Date: 05/14/2005  
Certification Date: 06/01/2000  
Renew Date: / /  
Fiscal Amount for Registration Fee is Correct: True  
PBS Number: 9-502766  
SPDES Number: Not reported  
Federal ID: Not reported  
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.  
CBS Number: Not reported  
SWIS Code: 1402  
Previous PBS#: Not reported  
Facility Type: STORAGE TERMINAL/PETROLEUM DISTRIBUTOR  
Owner Type: Corporate/Commercial  
Owner Sub Type: Not reported  
Owner: NIAGARA LUBRICANT CO INC  
164 CHANDLER STREET  
BUFFALO, NY 14207  
Owner Phone: (716) 874-2300  
Facility Phone: (716) 874-2300  
Operator: NIAGARA LUBRICANT CO INC  
Emergency Name: THOMAS R MCLEOD  
Emergency Phone: (716) 662-2741  
Total Tanks: 53  
Total Capacity: 262425  
Tank ID: F34  
Capacity (Gal): 875  
Missing Data for Tank : No data missing  
Tank Location: ABOVEGROUND  
Product Stored: LUBE OIL  
Tank Type: Steel/carbon steel  
Install Date: 04/01/1990  
Tank Internal: NONE  
Tank External: PAINTED/ASPHALT COATING/NONE  
Tank Containment: NONE/NONE  
Pipe Type: STEEL/IRON  
Pipe Location: Aboveground  
Pipe Internal: NONE  
Pipe External: NONE/NONE  
Leak Detection: NONE/NONE  
Overfill Protection: Product Level Gauge, None  
Dispenser Method: Suction  
Date Tested: / /  
Date Closed: / /  
Updated: True  
Next Test Date: / /  
Test Method: Not reported  
Deleted: False

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation     Site

MAP FINDINGS

Database(s)     EDR ID Number  
EPA ID Number

NIAGARA LUBRICANT CO INC (Continued)

U003318611

Date Inspected: 08/11/1993     Inspector: SIMON  
Result of Inspection: Not reported  
Mailing Name: NIAGARA LUBRICANT CO INC  
Mailing Address: 164 CHANDLER STREET  
BUFFALO, NY 14207  
Mailing Contact: Not reported  
Mailing Telephone: (716) 874-2300  
Owner Mark: First Owner     Expiration Date: 05/14/2005  
Certification Flag: False     Certification Date: 06/01/2000  
Renew Flag: False     Renew Date: / /  
Lat/Long: Not reported  
Dead Letter: False  
Facility Screen: No data missing  
Owner Screen: No data missing  
Tank Screen: No data missing  
Town or City: BUFFALO (C)  
Town or City Code: 02  
County Code: 14  
Region: 9  
Fiscal Amount for Registration Fee is Correct: True  
PBS Number: 9-502766     CBS Number: Not reported  
SPDES Number: Not reported     SWIS Code: 1402  
Federal ID: Not reported     Previous PBS#: Not reported  
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than  
1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.  
Facility Type: STORAGE TERMINAL/PETROLEUM DISTRIBUTOR  
Owner Type: Corporate/Commercial  
Owner Sub Type: Not reported  
Owner: NIAGARA LUBRICANT CO INC  
164 CHANDLER STREET  
BUFFALO, NY 14207  
Owner Phone: (716) 874-2300  
Facility Phone: (716) 874-2300  
Operator: NIAGARA LUBRICANT CO INC  
Emergency Name: THOMAS R MCLEOD  
Emergency Phone: (716) 662-2741  
Total Tanks: 53  
Total Capacity: 262425  
Tank ID: F35  
Capacity (Gal): 875  
Missing Data for Tank : No data missing  
Tank Location: ABOVEGROUND  
Product Stored: LUBE OIL  
Tank Type: Steel/carbon steel  
Install Date: 04/01/1990  
Tank Internal: NONE  
Tank External: PAINTED/ASPHALT COATING/NONE  
Tank Containment: NONE/NONE  
Pipe Type: STEEL/IRON  
Pipe Location: Aboveground  
Pipe Internal: NONE  
Pipe External: NONE/NONE  
Leak Detection: NONE/NONE  
Overfill Protection: Product Level Gauge, None  
Dispenser Method: Suction  
Date Tested: / /     Next Test Date: / /

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

NIAGARA LUBRICANT CO INC (Continued)

EDR ID Number  
EPA ID Number

Database(s)

U003318611

Date Closed: / /  
Updated: True  
Date Inspected: 08/11/1993  
Result of Inspection: Not reported  
Mailing Name: NIAGARA LUBRICANT CO INC  
Mailing Address: 164 CHANDLER STREET  
BUFFALO, NY 14207  
Mailing Contact: Not reported  
Mailing Telephone: (716) 874-2300  
Owner Mark: First Owner  
Certification Flag: False  
Renew Flag: False  
Lat/Long: Not reported  
Dead Letter: False  
Facility Screen: No data missing  
Owner Screen: No data missing  
Tank Screen: No data missing  
Town or City: BUFFALO (C)  
Town or City Code: 02  
County Code: 14  
Region: 9  
Test Method: Not reported  
Deleted: False  
Inspector: SIMON  
Expiration Date: 05/14/2005  
Certification Date: 06/01/2000  
Renew Date: / /  
Fiscal Amount for Registration Fee is Correct: True

PBS Number: 9-502766  
SPDES Number: Not reported  
Federal ID: Not reported  
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.  
CBS Number: Not reported  
SWIS Code: 1402  
Previous PBS#: Not reported  
Facility Type: STORAGE TERMINAL/PETROLEUM DISTRIBUTOR  
Owner Type: Corporate/Commercial  
Owner Sub Type: Not reported  
Owner: NIAGARA LUBRICANT CO INC  
164 CHANDLER STREET  
BUFFALO, NY 14207  
Owner Phone: (716) 874-2300  
Facility Phone: (716) 874-2300  
Operator: NIAGARA LUBRICANT CO INC  
Emergency Name: THOMAS R MCLEOD  
Emergency Phone: (716) 662-2741  
Total Tanks: 53  
Total Capacity: 262425  
Tank ID: F36  
Capacity (Gal): 875  
Missing Data for Tank : No data missing  
Tank Location: ABOVEGROUND  
Product Stored: LUBE OIL  
Tank Type: Steel/carbon steel  
Install Date: 04/01/1990  
Tank Internal: NONE  
Tank External: PAINTED/ASPHALT COATING/NONE  
Tank Containment: NONE/NONE  
Pipe Type: STEEL/IRON  
Pipe Location: Aboveground  
Pipe Internal: NONE  
Pipe External: NONE/NONE  
Leak Detection: NONE/NONE  
Overfill Protection: Product Level Gauge, None

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation    Site

MAP FINDINGS

Database(s)    EDR ID Number  
EPA ID Number

NIAGARA LUBRICANT CO INC (Continued)

U003318611

Dispenser Method:	Suction	Next Test Date:	/ /
Date Tested:	/ /	Test Method:	Not reported
Date Closed:	/ /	Deleted:	False
Updated:	True	Inspector:	SIMON
Date Inspected:	08/11/1993		
Result of Inspection:	Not reported		
Mailing Name:	NIAGARA LUBRICANT CO INC		
Mailing Address:	164 CHANDLER STREET BUFFALO, NY 14207		
Mailing Contact:	Not reported		
Mailing Telephone:	(716) 874-2300	Expiration Date:	05/14/2005
Owner Mark:	First Owner	Certification Date:	06/01/2000
Certification Flag:	False	Renew Date:	/ /
Renew Flag:	False		
Lat/Long:	Not reported		
Dead Letter:	False		
Facility Screen:	No data missing		
Owner Screen:	No data missing		
Tank Screen:	No data missing		
Town or City:	BUFFALO (C)		
Town or City Code:	02		
County Code:	14		
Region:	9		
Fiscal Amount for Registration Fee is Correct:	True		
PBS Number:	9-502766	CBS Number:	Not reported
SPDES Number:	Not reported	SWIS Code:	1402
Federal ID:	Not reported	Previous PBS#:	Not reported
Facility Status:	1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.		
Facility Type:	STORAGE TERMINAL/PETROLEUM DISTRIBUTOR		
Owner Type:	Corporate/Commercial		
Owner Sub Type:	Not reported		
Owner:	NIAGARA LUBRICANT CO INC 164 CHANDLER STREET BUFFALO, NY 14207		
Owner Phone:	(716) 874-2300		
Facility Phone:	(716) 874-2300		
Operator:	NIAGARA LUBRICANT CO INC		
Emergency Name:	THOMAS R MCLEOD		
Emergency Phone:	(716) 662-2741		
Total Tanks:	53		
Total Capacity:	262425		
Tank ID:	F37		
Capacity (Gal):	875		
Missing Data for Tank :	No data missing		
Tank Location:	ABOVEGROUND		
Product Stored:	LUBE OIL		
Tank Type:	Steel/carbon steel		
Install Date:	04/01/1990		
Tank Internal:	NONE		
Tank External:	PAINTED/ASPHALT COATING/NONE		
Tank Containment:	NONE/NONE		
Pipe Type:	STEEL/IRON		
Pipe Location:	Aboveground		
Pipe Internal:	NONE		
Pipe External:	NONE/NONE		

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

NIAGARA LUBRICANT CO INC (Continued)

EDR ID Number  
EPA ID Number

Database(s)

U003318611

Leak Detection: NONE/NONE  
Overfill Protection: Product Level Gauge, None  
Dispenser Method: Suction  
Date Tested: / /  
Date Closed: / /  
Updated: True  
Date Inspected: 08/11/1993  
Result of Inspection: Not reported  
Mailing Name: NIAGARA LUBRICANT CO INC  
Mailing Address: 164 CHANDLER STREET  
BUFFALO, NY 14207  
Mailing Contact: Not reported  
Mailing Telephone: (716) 874-2300  
Owner Mark: First Owner  
Certification Flag: False  
Renew Flag: False  
Lat/Long: Not reported  
Dead Letter: False  
Facility Screen: No data missing  
Owner Screen: No data missing  
Tank Screen: No data missing  
Town or City: BUFFALO (C)  
Town or City Code: 02  
County Code: 14  
Region: 9  
Fiscal Amount for Registration Fee is Correct: True  
Next Test Date: / /  
Test Method: Not reported  
Deleted: False  
Inspector: SIMON  
Expiration Date: 05/14/2005  
Certification Date: 06/01/2000  
Renew Date: / /  
PBS Number: 9-502766  
SPDES Number: Not reported  
Federal ID: Not reported  
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.  
Facility Type: STORAGE TERMINAL/PETROLEUM DISTRIBUTOR  
Owner Type: Corporate/Commercial  
Owner Sub Type: Not reported  
Owner: NIAGARA LUBRICANT CO INC  
164 CHANDLER STREET  
BUFFALO, NY 14207  
Owner Phone: (716) 874-2300  
Facility Phone: (716) 874-2300  
Operator: NIAGARA LUBRICANT CO INC  
Emergency Name: THOMAS R MCLEOD  
Emergency Phone: (716) 662-2741  
Total Tanks: 53  
Total Capacity: 262425  
Tank ID: Y42  
Capacity (Gal): 10000  
Missing Data for Tank : No data missing  
Tank Location: ABOVEGROUND  
Product Stored: EMPTY  
Tank Type: Steel/carbon steel  
Install Date: / /  
Tank Internal: NONE  
Tank External: PAINTED/ASPHALT COATING/NONE  
Tank Containment: CONCRETE DIKE/NONE  
Pipe Type: STEEL/IRON  
Pipe Location: Aboveground  
CBS Number: Not reported  
SWIS Code: 1402  
Previous PBS#: Not reported

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number  
EPA ID Number

NIAGARA LUBRICANT CO INC (Continued)

U003318611

Pipe Internal:	NONE	
Pipe External:	NONE/NONE	
Leak Detection:	NONE/NONE	
Overfill Protection:	None	
Dispenser Method:	Suction	
Date Tested:	/ /	Next Test Date: / /
Date Closed:	/ /	Test Method: Not reported
Updated:	True	Deleted: False
Date Inspected:	08/11/1993	Inspector: SIMON
Result of Inspection:	Not reported	
Mailing Name:	NIAGARA LUBRICANT CO INC	
Mailing Address:	164 CHANDLER STREET BUFFALO, NY 14207	
Mailing Contact:	Not reported	
Mailing Telephone:	(716) 874-2300	
Owner Mark:	First Owner	Expiration Date: 05/14/2005
Certification Flag:	False	Certification Date: 06/01/2000
Renew Flag:	False	Renew Date: / /
Lat/Long:	Not reported	
Dead Letter:	False	
Facility Screen:	No data missing	
Owner Screen:	No data missing	
Tank Screen:	No data missing	
Town or City:	BUFFALO (C)	
Town or City Code:	02	
County Code:	14	
Region:	9	
Fiscal Amount for Registration Fee is Correct:	True	
PBS Number:	9-502766	CBS Number: Not reported
SPDES Number:	Not reported	SWIS Code: 1402
Federal ID:	Not reported	Previous PBS#: Not reported
Facility Status:	1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.	
Facility Type:	STORAGE TERMINAL/PETROLEUM DISTRIBUTOR	
Owner Type:	Corporate/Commercial	
Owner Sub Type:	Not reported	
Owner:	NIAGARA LUBRICANT CO INC 164 CHANDLER STREET BUFFALO, NY 14207	
Owner Phone:	(716) 874-2300	
Facility Phone:	(716) 874-2300	
Operator:	NIAGARA LUBRICANT CO INC	
Emergency Name:	THOMAS R MCLEOD	
Emergency Phone:	(716) 662-2741	
Total Tanks:	53	
Total Capacity:	262425	
Tank ID:	Y47	
Capacity (Gal):	10000	
Missing Data for Tank:	No data missing	
Tank Location:	ABOVEGROUND	
Product Stored:	EMPTY	
Tank Type:	Steel/carbon steel	
Install Date:	/ /	
Tank Internal:	NONE	
Tank External:	PAINTED/ASPHALT COATING/NONE	
Tank Containment:	CONCRETE DIKE/NONE	

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

NIAGARA LUBRICANT CO INC (Continued)

EDR ID Number  
EPA ID Number

Database(s)

U003318611

Pipe Type: STEEL/IRON  
Pipe Location: Aboveground  
Pipe Internal: NONE  
Pipe External: NONE/NONE  
Leak Detection: NONE/NONE  
Overfill Protection: None  
Dispenser Method: Suction  
Date Tested: / /  
Date Closed: / /  
Updated: True  
Date Inspected: 08/11/1993  
Result of Inspection: Not reported  
Mailing Name: NIAGARA LUBRICANT CO INC  
Mailing Address: 164 CHANDLER STREET  
BUFFALO, NY 14207  
Mailing Contact: Not reported  
Mailing Telephone: (716) 874-2300  
Owner Mark: First Owner  
Certification Flag: False  
Renew Flag: False  
Lat/Long: Not reported  
Dead Letter: False  
Facility Screen: No data missing  
Owner Screen: No data missing  
Tank Screen: No data missing  
Town or City: BUFFALO (C)  
Town or City Code: 02  
County Code: 14  
Region: 9  
Fiscal Amount for Registration Fee is Correct: True  
Next Test Date: / /  
Test Method: Not reported  
Deleted: False  
Inspector: SIMON  
Expiration Date: 05/14/2005  
Certification Date: 06/01/2000  
Renew Date: / /  
PBS Number: 9-502766  
SPDES Number: Not reported  
Federal ID: Not reported  
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.  
Facility Type: STORAGE TERMINAL/PETROLEUM DISTRIBUTOR  
Owner Type: Corporate/Commercial  
Owner Sub Type: Not reported  
Owner: NIAGARA LUBRICANT CO INC  
164 CHANDLER STREET  
BUFFALO, NY 14207  
Owner Phone: (716) 874-2300  
Facility Phone: (716) 874-2300  
Operator: NIAGARA LUBRICANT CO INC  
Emergency Name: THOMAS R MCLEOD  
Emergency Phone: (716) 662-2741  
Total Tanks: 53  
Total Capacity: 262425  
Tank ID: Y48  
Capacity (Gal): 5000  
Missing Data for Tank : No data missing  
Tank Location: ABOVEGROUND  
Product Stored: EMPTY  
Tank Type: Steel/carbon steel  
Install Date: / /  
Tank Internal: NONE  
CBS Number: Not reported  
SWIS Code: 1402  
Previous PBS#: Not reported



Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

Site

MAP FINDINGS

Database(s)

EDR ID Number  
EPA ID Number

NIAGARA LUBRICANT CO INC (Continued)

U003318611

Tank External:	PAINTED/ASPHALT COATING/NONE	
Tank Containment:	CONCRETE DIKE/NONE	
Pipe Type:	STEEL/IRON	
Pipe Location:	Aboveground	
Pipe Internal:	NONE	
Pipe External:	NONE/NONE	
Leak Detection:	NONE/NONE	
Overfill Protection:	None	
Dispenser Method:	Suction	
Date Tested:	/ /	Next Test Date: / /
Date Closed:	/ /	Test Method: Not reported
Updated:	True	Deleted: False
Date Inspected:	08/11/1993	Inspector: SIMON
Result of Inspection:	Not reported	
Mailing Name:	NIAGARA LUBRICANT CO INC	
Mailing Address:	164 CHANDLER STREET BUFFALO, NY 14207	
Mailing Contact:	Not reported	
Mailing Telephone:	(716) 874-2300	
Owner Mark:	First Owner	Expiration Date: 05/14/2005
Certification Flag:	False	Certification Date: 06/01/2000
Renew Flag:	False	Renew Date: / /
Lat/Long:	Not reported	
Dead Letter:	False	
Facility Screen:	No data missing	
Owner Screen:	No data missing	
Tank Screen:	No data missing	
Town or City:	BUFFALO (C)	
Town or City Code:	02	
County Code:	14	
Region:	9	
Fiscal Amount for Registration Fee is Correct:	True	
PBS Number:	9-502766	CBS Number: Not reported
SPDES Number:	Not reported	SWIS Code: 1402
Federal ID:	Not reported	Previous PBS#: Not reported
Facility Status:	1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.	
Facility Type:	STORAGE TERMINAL/PETROLEUM DISTRIBUTOR	
Owner Type:	Corporate/Commercial	
Owner Sub Type:	Not reported	
Owner:	NIAGARA LUBRICANT CO INC 164 CHANDLER STREET BUFFALO, NY 14207	
Owner Phone:	(716) 874-2300	
Facility Phone:	(716) 874-2300	
Operator:	NIAGARA LUBRICANT CO INC	
Emergency Name:	THOMAS R MCLEOD	
Emergency Phone:	(716) 662-2741	
Total Tanks:	53	
Total Capacity:	262425	
Tank ID:	Y49	
Capacity (Gal):	12000	
Missing Data for Tank :	No data missing	
Tank Location:	ABOVEGROUND	
Product Stored:	EMPTY	
Tank Type:	Steel/carbon steel	

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

NIAGARA LUBRICANT CO INC (Continued)

EDR ID Number  
EPA ID Number

Database(s)

U003318611

Install Date: / /  
Tank Internal: NONE  
Tank External: PAINTED/ASPHALT COATING/NONE  
Tank Containment: CONCRETE DIKE/NONE  
Pipe Type: STEEL/IRON  
Pipe Location: Aboveground  
Pipe Internal: NONE  
Pipe External: NONE/NONE  
Leak Detection: NONE/NONE  
Overfill Protection: None  
Dispenser Method: Suction  
Date Tested: / /  
Date Closed: / /  
Updated: True  
Date Inspected: 08/11/1993  
Result of Inspection: Not reported  
Mailing Name: NIAGARA LUBRICANT CO INC  
Mailing Address: 164 CHANDLER STREET  
BUFFALO, NY 14207  
Mailing Contact: Not reported  
Mailing Telephone: (716) 874-2300  
Owner Mark: First Owner  
Certification Flag: False  
Renew Flag: False  
Lat/Long: Not reported  
Dead Letter: False  
Facility Screen: No data missing  
Owner Screen: No data missing  
Tank Screen: No data missing  
Town or City: BUFFALO (C)  
Town or City Code: 02  
County Code: 14  
Region: 9  
Fiscal Amount for Registration Fee is Correct: True  
Next Test Date: / /  
Test Method: Not reported  
Deleted: False  
Inspector: SIMON  
Expiration Date: 05/14/2005  
Certification Date: 06/01/2000  
Renew Date: / /  
PBS Number: 9-502766  
SPDES Number: Not reported  
Federal ID: Not reported  
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.  
Facility Type: STORAGE TERMINAL/PETROLEUM DISTRIBUTOR  
Owner Type: Corporate/Commercial  
Owner Sub Type: Not reported  
Owner: NIAGARA LUBRICANT CO INC  
164 CHANDLER STREET  
BUFFALO, NY 14207  
Owner Phone: (716) 874-2300  
Facility Phone: (716) 874-2300  
Operator: NIAGARA LUBRICANT CO INC  
Emergency Name: THOMAS R MCLEOD  
Emergency Phone: (716) 662-2741  
Total Tanks: 53  
Total Capacity: 262425  
Tank ID: Y50  
Capacity (Gal): 12000  
Missing Data for Tank : No data missing  
Tank Location: ABOVEGROUND  
CBS Number: Not reported  
SWIS Code: 1402  
Previous PBS#: Not reported

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

Site

MAP FINDINGS

Database(s)

EDR ID Number  
EPA ID Number

NIAGARA LUBRICANT CO INC (Continued)

U003318611

Product Stored: EMPTY  
Tank Type: Steel/carbon steel  
Install Date: / /  
Tank Internal: NONE  
Tank External: PAINTED/ASPHALT COATING/NONE  
Tank Containment: CONCRETE DIKE/NONE  
Pipe Type: STEEL/IRON  
Pipe Location: Aboveground  
Pipe Internal: NONE  
Pipe External: NONE/NONE  
Leak Detection: NONE/NONE  
Overfill Protection: None  
Dispenser Method: Suction  
Date Tested: / /  
Date Closed: / /  
Updated: True  
Date Inspected: 08/11/1993  
Result of Inspection: Not reported  
Mailing Name: NIAGARA LUBRICANT CO INC  
Mailing Address: 164 CHANDLER STREET  
BUFFALO, NY 14207  
Mailing Contact: Not reported  
Mailing Telephone: (716) 874-2300  
Owner Mark: First Owner  
Certification Flag: False  
Renew Flag: False  
Lat/Long: Not reported  
Dead Letter: False  
Facility Screen: No data missing  
Owner Screen: No data missing  
Tank Screen: No data missing  
Town or City: BUFFALO (C)  
Town or City Code: 02  
County Code: 14  
Region: 9  
Fiscal Amount for Registration Fee is Correct: True

Next Test Date: / /  
Test Method: Not reported  
Deleted: False  
Inspector: SIMON

Expiration Date: 05/14/2005  
Certification Date: 06/01/2000  
Renew Date: / /

PBS Number: 9-502766  
SPDES Number: Not reported  
Federal ID: Not reported  
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.  
Facility Type: STORAGE TERMINAL/PETROLEUM DISTRIBUTOR  
Owner Type: Corporate/Commercial  
Owner Sub Type: Not reported  
Owner: NIAGARA LUBRICANT CO INC  
164 CHANDLER STREET  
BUFFALO, NY 14207  
Owner Phone: (716) 874-2300  
Facility Phone: (716) 874-2300  
Operator: NIAGARA LUBRICANT CO INC  
Emergency Name: THOMAS R MCLEOD  
Emergency Phone: (716) 662-2741  
Total Tanks: 53  
Total Capacity: 262425  
Tank ID: Y51  
Capacity (Gal): 10000

CBS Number: Not reported  
SWIS Code: 1402  
Previous PBS#: Not reported

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation    Site

MAP FINDINGS

Database(s)    EDR ID Number  
EPA ID Number

NIAGARA LUBRICANT CO INC (Continued)

U003318611

Missing Data for Tank : No data missing  
Tank Location: ABOVEGROUND  
Product Stored: EMPTY  
Tank Type: Steel/carbon steel  
Install Date: / /  
Tank Internal: NONE  
Tank External: PAINTED/ASPHALT COATING/NONE  
Tank Containment: CONCRETE DIKE/NONE  
Pipe Type: STEEL/IRON  
Pipe Location: Aboveground  
Pipe Internal: NONE  
Pipe External: NONE/NONE  
Leak Detection: NONE/NONE  
Overfill Protection: None  
Dispenser Method: Suction  
Date Tested: / /  
Date Closed: / /  
Updated: True  
Date Inspected: 08/11/1993  
Result of Inspection: Not reported  
Mailing Name: NIAGARA LUBRICANT CO INC  
Mailing Address: 164 CHANDLER STREET  
BUFFALO, NY 14207  
Mailing Contact: Not reported  
Mailing Telephone: (716) 874-2300  
Owner Mark: First Owner  
Certification Flag: False  
Renew Flag: False  
Lat/Long: Not reported  
Dead Letter: False  
Facility Screen: No data missing  
Owner Screen: No data missing  
Tank Screen: No data missing  
Town or City: BUFFALO (C)  
Town or City Code: 02  
County Code: 14  
Region: 9  
Fiscal Amount for Registration Fee is Correct: True  
Next Test Date: / /  
Test Method: Not reported  
Deleted: False  
Inspector: SIMON  
Expiration Date: 05/14/2005  
Certification Date: 06/01/2000  
Renew Date: / /  
PBS Number: 9-502766  
SPDES Number: Not reported  
Federal ID: Not reported  
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.  
Facility Type: STORAGE TERMINAL/PETROLEUM DISTRIBUTOR  
Owner Type: Corporate/Commercial  
Owner Sub Type: Not reported  
Owner: NIAGARA LUBRICANT CO INC  
164 CHANDLER STREET  
BUFFALO, NY 14207  
Owner Phone: (716) 874-2300  
Facility Phone: (716) 874-2300  
Operator: NIAGARA LUBRICANT CO INC  
Emergency Name: THOMAS R MCLEOD  
Emergency Phone: (716) 662-2741  
Total Tanks: 53  
Total Capacity: 262425  
CBS Number: Not reported  
SWIS Code: 1402  
Previous PBS#: Not reported

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
EPA ID Number

NIAGARA LUBRICANT CO INC (Continued)

U003318611

Tank ID: F38  
Capacity (Gal): 875  
Missing Data for Tank : No data missing  
Tank Location: ABOVEGROUND  
Product Stored: LUBE OIL  
Tank Type: Steel/carbon steel  
Install Date: 04/01/1990  
Tank Internal: NONE  
Tank External: PAINTED/ASPHALT COATING/NONE  
Tank Containment: NONE/NONE  
Pipe Type: STEEL/IRON  
Pipe Location: Aboveground  
Pipe Internal: NONE  
Pipe External: NONE/NONE  
Leak Detection: NONE/NONE  
Overfill Protection: Product Level Gauge  
Dispenser Method: Suction  
Date Tested: / /  
Date Closed: / /  
Updated: True  
Date Inspected: 08/11/1993  
Result of Inspection: Not reported  
Mailing Name: NIAGARA LUBRICANT CO INC  
Mailing Address: 164 CHANDLER STREET  
BUFFALO, NY 14207  
Mailing Contact: Not reported  
Mailing Telephone: (716) 874-2300  
Owner Mark: First Owner  
Certification Flag: False  
Renew Flag: False  
Lat/Long: Not reported  
Dead Letter: False  
Facility Screen: No data missing  
Owner Screen: No data missing  
Tank Screen: No data missing  
Town or City: BUFFALO (C)  
Town or City Code: 02  
County Code: 14  
Region: 9  
Fiscal Amount for Registration Fee is Correct: True  
Next Test Date: / /  
Test Method: Not reported  
Deleted: False  
Inspector: SIMON  
Expiration Date: 05/14/2005  
Certification Date: 06/01/2000  
Renew Date: / /  
PBS Number: 9-502766  
SPDES Number: Not reported  
Federal ID: Not reported  
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.  
Facility Type: STORAGE TERMINAL/PETROLEUM DISTRIBUTOR  
Owner Type: Corporate/Commercial  
Owner Sub Type: Not reported  
Owner: NIAGARA LUBRICANT CO INC  
164 CHANDLER STREET  
BUFFALO, NY 14207  
Owner Phone: (716) 874-2300  
Facility Phone: (716) 874-2300  
Operator: NIAGARA LUBRICANT CO INC  
Emergency Name: THOMAS R MCLEOD  
Emergency Phone: (716) 662-2741  
CBS Number: Not reported  
SWIS Code: 1402  
Previous PBS#: Not reported

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
EPA ID Number

NIAGARA LUBRICANT CO INC (Continued)

U003318611

Total Tanks: 53  
Total Capacity: 262425  
Tank ID: F39  
Capacity (Gal): 6700  
Missing Data for Tank : No data missing  
Tank Location: ABOVEGROUND  
Product Stored: KEROSENE  
Tank Type: Steel/carbon steel  
Install Date: 04/01/1990  
Tank Internal: NONE  
Tank External: PAINTED/ASPHALT COATING/NONE  
Tank Containment: NONE/NONE  
Pipe Type: STEEL/IRON  
Pipe Location: Aboveground  
Pipe Internal: NONE  
Pipe External: NONE/NONE  
Leak Detection: NONE/NONE  
Overfill Protection: Product Level Gauge, None  
Dispenser Method: Suction  
Date Tested: / /  
Date Closed: / /  
Updated: True  
Date Inspected: 08/11/1993  
Result of Inspection: Not reported  
Mailing Name: NIAGARA LUBRICANT CO INC  
Mailing Address: 164 CHANDLER STREET  
BUFFALO, NY 14207  
Mailing Contact: Not reported  
Mailing Telephone: (716) 874-2300  
Owner Mark: First Owner  
Certification Flag: False  
Renew Flag: False  
Lat/Long: Not reported  
Dead Letter: False  
Facility Screen: No data missing  
Owner Screen: No data missing  
Tank Screen: No data missing  
Town or City: BUFFALO (C)  
Town or City Code: 02  
County Code: 14  
Region: 9  
Next Test Date: / /  
Test Method: Not reported  
Deleted: False  
Inspector: SIMON  
Expiration Date: 05/14/2005  
Certification Date: 06/01/2000  
Renew Date: / /  
Fiscal Amount for Registration Fee is Correct: True

A3  
SW  
< 1/8  
106 ft.  
Higher

QUALITY PETROLEUM PRODUCTS INC  
164 CHANDLER ST  
BUFFALO, NY 14207  
Site 3 of 5 in cluster A

RCRIS-SQG 1000286897  
FINDS NYD080330178

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

QUALITY PETROLEUM PRODUCTS INC (Continued)

EDR ID Number  
EPA ID Number

Database(s)

1000286897

RCRIS:

Owner: Not reported  
EPA ID: NYD080330178  
Classification: Small Quantity Generator  
Used Oil Recyc: No  
TSD Activities: Not reported  
Violation Status: No violations found

FINDS:

Other Pertinent Environmental Activity Identified at Site:  
AIRS Facility System (AIRS/AFS)  
Facility Registry System (FRS)  
Resource Conservation and Recovery Act Information system (RCRAINFO)

A4  
WSW  
< 1/8  
210 ft.  
Higher

G & R MACHINE & EQUIP.  
155 CHANDLER STREET  
BUFFALO, NY

NY Spills S102178454  
N/A

Site 4 of 5 in cluster A

SPILLS:

Spill Number:	9315395	Region of Spill:	9
Facility Contact:	Not reported	Facility Tele:	Not reported
Investigator:	MJS	SWIS:	14
Caller Name:	Not reported	Caller Agency:	Not reported
Caller Phone:	Not reported	Caller Extension:	Not reported
Notifier Name:	Not reported	Notifier Agency:	Not reported
Notifier Phone:	Not reported	Notifier Extension:	Not reported
Spiller Contact:	Not reported	Spiller Phone:	Not reported

Spiller: G & R MACHINE & EQUIP.  
Spiller Address: 155 CHANDLER STREET  
BUFFALO, NY

Spill Class: Known release that creates potential for fire or hazard. DEC Response.  
Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 10/06/1994

Spill Cause: Abandoned Drums

Water Affected: Not reported

Spill Notifier: Fire Department

Spill Date: 03/29/1994 10:00

Cleanup Ceased: 10/06/1994

Last Inspection: 19940601

Cleanup Meets Standard: True

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Date: Not reported

Enforcement Date: Not reported

Investigation Complete: Not reported

UST Involvement: False

Spill Record Last Update: 10/11/1994

Is Updated: False

Corrective Action Plan Submitted: Not reported

Date Spill Entered In Computer Data File: 03/31/1994

Date Region Sent Summary to Central Office: Not reported

Tank Test:

PBS Number: Not reported

Tank Number: Not reported

Test Method: Not reported

Capacity of Failed Tank: Not reported

Resource Affected: Air

Spill Source: Other Commercial/Industrial

PBS Number: Not reported

Reported to Dept: 03/29/1994 10:30

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

Site

MAP FINDINGS

Database(s)  
EDR ID Number  
EPA ID Number

G & R MACHINE & EQUIP. (Continued)

S102178454

Leak Rate Failed Tank: Not reported  
Gross Leak Rate: Not reported  
Material:  
Material Class Type: 2  
Quantity Spilled: 0  
Units: Not reported  
Unknown Qty Spilled: No  
Quantity Recovered: 0  
Unknown Qty Recovered: True  
Material: HYDROGEN SULFIDE  
Class Type: Hazardous  
Chem Abstract Service Number: HYDROGEN SULFIDE  
Last Date: Not reported  
Num Times Material Entry In File: 0  
Remarks: LEAKING CYLINDERS AT MACHINE SHOP.  
DEC Remarks: 03/31/94: MJS/SITE - MET W/GREGORY DEANGELIS MARGARET CHONG, EPA; PAUL SUOZZI, EP S; JACK SNIDERHAN, BUFFALO FIRE SAFETY; CLIFF PRIIRSIGKE. NO RSEMEN ENV. MONITORED AROUND CYLINDERS. NOTHING FOUND. 04/06/94: MJS T ELECON W/ MARGARET CHONG.. EPA WILL SEND LETTER TO RP IF DEC SEND REFER RAL TO EPA THRU AL ROCKMORE OR TOM VICKERSON ALBANY). EPS IS HAVING THRE E SUBS BID THE JOB. 04/06/94: MJS, RNL SPOKE W/ FRANK SHATTUCK. HE WIL L LOOK INTO APPLICABILITY OF CERCLA REGS FOR CYLINDERS. 04/07/94:: MJS , RNL SPOKE W/ PETER BUECHI. MR BUECHI INFORMS THAT THERE WAS A DISCUSSI ON B/T DEC AND C)BFLO AND BFLO WILL TAKE LEAD. MR BUECHI INFORMS NOT TO SEND DEC REFERRAL TO EPA. 04/11/94: RECEIVED REPORT FROM EPA. 05/10/ 94: RECEIVED LETTER FROM CLIFF PREISIGKE EMERG SERV) W/ COPY OF BILL T HEY SENT TO RP. 05/19/94: MJS TELECON W/ CLIFF PREISIGKE AND CHIEF SNI DERHAN. THEY ARE CHECKING STATUS OF CLEANUP. CITY IS UNDER IMPRESSION TH AT DEC WAS HANDLING SITUATION. MJS REFERRED BOTH PARTIES TO RNNL. 05/1 9/94: MJS SPOKE W/ RNL. RNL REFERRED CITY OF BFLO TO MARTY DOSTER. MR DO STER WAS INVOLVED W/ REACHING ORIGINAL AGREEMENT W/ CITY BFLO. 05/24/9 4: MJS MEMO TO FILE - NO FURTHER ACTION BY SPILL UNIT. MJS CLOSE FILE. 05/31/94: MJS INFORMEDBY MR BUECHI TO ATTEND MTG W/ CITY OF BFLO ON 6/2/ 94 REGARDING STATUS OF SITE AND WHO WILL ASSUME ENFORCEMENT ACTION. MJS TO INSPECT SITE ON 6/1/94 W/ CHIEF SNIDERHAN. 06/01/94: MJS SITE INSPE CT W/ CHIEF SNIDERHAN. ALL CYLINDERS STILL ON SITE. NOACTIVITY TO DATE. MR ROSEN OWNER) NOT AT SITE. 06/02/94: MJS/PJB/MLD MEETING W/ CITY OF BFLO AND ERIE COUNTY. BFLO F.D. WILL SEND ENFORCEMENT LETTER TO RP. CITY CAN REQUEST A REFERRAL TO EPA THRU DEC IF NO ACTION IS TAKEN BY RP. 10 /06/94: MJS REEVIEW FILE. SPILL RESPONSE HAS NO INVOLVEMENT AT THIS POIN T. CITY HAS MADE NO REQUEST FOR EPA INTERACTION. NO FURTHER ACTION REQUI RED. MJS CLOSE FILE.

A5  
WSW  
< 1/8  
210 ft.  
Higher

G AND R MACHINERY  
155 CHANDLER STREET  
BUFFALO, NY

Site 5 of 5 in cluster A

NY Spills S102174940  
N/A

SPILLS:

Spill Number:	9209547	Region of Spill:	9
Facility Contact:	Not reported	Facility Tele:	Not reported
Investigator:	RMC	SWIS:	14
Caller Name:	Not reported	Caller Agency:	Not reported
Caller Phone:	Not reported	Caller Extension:	Not reported
Notifier Name:	Not reported	Notifier Agency:	Not reported
Notifier Phone:	Not reported	Notifier Extension:	Not reported
Spiller Contact:	Not reported	Spiller Phone:	(716) 877-4044
Spiller:	G AND R MACHINERY		



Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation    Site

MAP FINDINGS

Database(s)    EDR ID Number  
EPA ID Number

G AND R MACHINERY (Continued)

S102174940

Spiller Address: 155 CHANDLER STREET  
BUFFALO, NY  
Spill Class: No spill occurred. No DEC Response. No corrective action required.  
Spill Closed Dt: 02/04/1993  
Spill Cause: Deliberate    Resource Affected: On Land  
Water Affected: Not reported    Spill Source: Other Commercial/Industrial  
Spill Notifier: Citizen    PBS Number: Not reported  
Spill Date: 11/01/1992 12:00    Reported to Dept: 11/17/1992 09:15  
Cleanup Ceased: 02/04/1993  
Last Inspection: 19930204  
Cleanup Meets Standard: True  
Recommended Penalty: Penalty Not Recommended  
Spiller Cleanup Date: Not reported  
Enforcement Date: Not reported  
Investigation Complete: Not reported  
UST Involvement: False  
Spill Record Last Update: 02/08/1993  
Is Updated: False  
Corrective Action Plan Submitted: Not reported  
Date Spill Entered In Computer Data File: 11/23/1992  
Date Region Sent Summary to Central Office: Not reported  
Tank Test:  
  PBS Number: Not reported  
  Tank Number: Not reported  
  Test Method: Not reported  
  Capacity of Failed Tank: Not reported  
  Leak Rate Failed Tank: Not reported  
  Gross Leak Rate: Not reported  
Material:  
  Material Class Type: 1  
  Quantity Spilled: 0  
  Units: Not reported  
  Unknown Qty Spilled: No  
  Quantity Recovered: 0  
  Unknown Qty Recovered: True  
  Material: PCB OIL  
  Class Type: Petroleum  
  Chem Abstract Service Number: PCB OIL  
  Last Date: 07/28/1994  
  Num Times Material Entry In File: 1229  
Remark: THIS IS CONNECTED WITH J.H. WILLIAMS SPILL NO. 9209548). MR. ROSEN IS AC  
CEPTING OIL AND COPPER TO BURN INSIDE HIS FACTORY.  
DEC Remarks: 01/11/93: RMC/SITE - WALKED PERIMETER. NO PROBLEM FOUND. RETURN FOR SITE  
WALK-OVER. 02/04/93: RMC/GENE SMITH/SITE INSPECTED BUILDING AND COURT  
YARD. NO PROBLEM FOUND. NO EVIDENCE OF WASTE OIL STORAGE OR OF THE BUR  
NING OF COPPER WIRE. SEVERAL BIINS OF STRIPPED WIRE AND INSULATION...CL  
OSE OUT.

B6  
SW  
< 1/8  
299 ft.  
Higher

BAKERY SALVAGE  
CHANDLER STREET  
BUFFALO, NY

NY Spills S102178266  
N/A

Site 1 of 3 in cluster B

SPILLS:

Spill Number: 9310705    Region of Spill: 9  
Facility Contact: Not reported    Facility Tele: Not reported  
Investigator: RMC    SWIS: 14  
Caller Name: Not reported    Caller Agency: Not reported

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

EDR ID Number  
EPA ID Number

Database(s)

BAKERY SALVAGE (Continued)

S102178266

Caller Phone: Not reported  
Notifier Name: Not reported  
Notifier Phone: Not reported  
Spiller Contact: Not reported  
Spiller: BAKERY SALVAGE  
Spiller Address: CHANDLER STREET  
BUFFALO, NY  
Spill Class: Possible release with minimal potential for fire or hazard or Known  
release with no damage. No DEC Response. No corrective action required.  
Spill Closed Dt: 12/16/1993  
Spill Cause: Housekeeping  
Water Affected: Not reported  
Spill Notifier: Local Agency  
Spill Date: 12/01/1993 12:10  
Cleanup Ceased: 12/16/1993  
Last Inspection: 19931216  
Cleanup Meets Standard: True  
Recommended Penalty: Penalty Not Recommended  
Spiller Cleanup Date: Not reported  
Enforcement Date: Not reported  
Investigation Complete: Not reported  
UST Involvement: False  
Spill Record Last Update: 01/20/1994  
Is Updated: False  
Corrective Action Plan Submitted: Not reported  
Date Spill Entered In Computer Data File: 12/06/1993  
Date Region Sent Summary to Central Office: Not reported  
Tank Test:  
PBS Number: Not reported  
Tank Number: Not reported  
Test Method: Not reported  
Capacity of Failed Tank: Not reported  
Leak Rate Failed Tank: Not reported  
Gross Leak Rate: Not reported  
Material:  
Material Class Type: 1  
Quantity Spilled: 0  
Units: Not reported  
Unknown Qty Spilled: No  
Quantity Recovered: 0  
Unknown Qty Recovered: True  
Material: WASTE OIL  
Class Type: Petroleum  
Chem Abstract Service Number: WASTE OIL  
Last Date: 09/27/1994  
Num Times Material Entry In File: 9509  
Remarks: AIR HAS ODOR, OIL SPILLAGE ON PROPERTY  
DEC Remarks: 12/16/93: RMC/DAVID OLSHAN/SITE WALKED SITE, FOUND NO PETROLEUM SPILLAGE.  
E. STRONG ODORS IN AND OFF SITE, SIGNIFICANT AMOUNT OF MUD IS TRACKED OF  
F SITE. ADVISED COUNCILMAN Z.S OFFICE OF INSPECTION REFER TO DOA.

B7  
SW  
< 1/8  
299 ft.  
Higher

SALVAGES  
CHANDLER STREET  
BUFFALO, NY

NY Spills S102177338  
N/A

Site 2 of 3 in cluster B

SPILLS:

Spill Number: 9003722

Region of Spill: 9

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation      Site

MAP FINDINGS

Database(s)      EDR ID Number  
EPA ID Number

**SALVAGES (Continued)**

**S102177338**

Facility Contact:	Not reported	Facility Tele:	Not reported
Investigator:	MF	SWIS:	14
Caller Name:	Not reported	Caller Agency:	Not reported
Caller Phone:	Not reported	Caller Extension:	Not reported
Notifier Name:	Not reported	Notifier Agency:	Not reported
Notifier Phone:	Not reported	Notifier Extension:	Not reported
Spiller Contact:	Not reported	Spiller Phone:	Not reported
Spiller:	NONE		
Spiller Address:	Not reported		
Spill Class:	Not reported		
Spill Closed Dt:	07/06/1990		
Spill Cause:	Deliberate	Resource Affected:	On Land
Water Affected:	Not reported	Spill Source:	Other Commercial/Industrial
Spill Notifier:	Citizen	PBS Number:	Not reported
Spill Date:	07/03/1990 08:00	Reported to Dept:	07/03/1990 09:15
Cleanup Ceased:	07/06/1990		
Last Inspection:	19900703		
Cleanup Meets Standard:	True		
Recommended Penalty:	Penalty Not Recommended		
Spiller Cleanup Date:	Not reported		
Enforcement Date:	Not reported		
Investigation Complete:	Not reported		
UST Involvement:	False		
Spill Record Last Update:	07/23/1990		
Is Updated:	False		
Corrective Action Plan Submitted:	Not reported		
Date Spill Entered In Computer Data File:	07/06/1990		
Date Region Sent Summary to Central Office:	Not reported		
Tank Test:			
PBS Number:	Not reported		
Tank Number:	Not reported		
Test Method:	Not reported		
Capacity of Failed Tank:	Not reported		
Leak Rate Failed Tank:	Not reported		
Gross Leak Rate:	Not reported		
Material:			
Material Class Type:	Not reported		
Quantity Spilled:	Not reported		
Units:	Not reported		
Unknown Qty Spilled:	Not reported		
Quantity Recovered:	Not reported		
Unknown Qty Recovered:	Not reported		
Material:	Not reported		
Class Type:	Not reported		
Chem Abstract Service Number:	Not reported		
Last Date:	Not reported		
Num Times Material Entry In File:	Not reported		
Remarks:	CITIZEN CLAIMS COMPANY DELIBERATELY DUMPING.		
DEC Remarks:	07/03/90: MF JASPEL 7/3/90 SITE VISIT, VARIOUS MATERIALS BEING DUMPED IN SIDE OF GUTTED STRUCTURE. DID NOT NOTICE ANY HAZ MATERIALS OR PETROLEUM PRODUCTS. OUTSIDE PEOPLE DUMPING. 07/06/90: MF NO SPILLAGE OR HAZ MATE RIALS FOUND, NO FUTHER ACTION NECCESSARY BY SPILLS. CONSTRUCTION DEBRIS DUMPING BY UNKNOWN PERSONS. 09/29/95: This is additional information about material spilled from the translation of the old spill file: JUNK, , TRASH.		

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

B8 TRUCK AT OLD BAKERY SALVA  
SW CHANDLER STREET  
< 1/8 BUFFALO, NY  
299 ft.  
Higher Site 3 of 3 in cluster B

Database(s) EDR ID Number  
EPA ID Number

NY Spills S104880949  
N/A

SPILLS:

Spill Number: 0075522 Region of Spill: 9  
Facility Contact: Not reported Facility Tele: Not reported  
Investigator: JFO SWIS: 14  
Caller Name: Not reported Caller Agency: Not reported  
Caller Phone: Not reported Caller Extension: Not reported  
Notifier Name: Not reported Notifier Agency: Not reported  
Notifier Phone: Not reported Notifier Extension: Not reported  
Spiller Contact: RYDER SHARED SERVICES Spiller Phone: (800) 947-9337  
Spiller: COMMONWEALTH OIL  
Spiller Address: HARROW, ONTARIO, CANADA  
Spill Class: Known release with minimal potential for fire or hazard. DEC Response.  
Willing Responsible Party. Corrective action taken.  
Spill Closed Dt: 01/08/2001  
Spill Cause: Traffic Accident Resource Affected: On Land  
Water Affected: Not reported Spill Source: Commercial Vehicle  
Spill Notifier: Fire Department PBS Number: Not reported  
Spill Date: 12/08/2000 15:25 Reported to Dept: 12/08/2000 15:25  
Cleanup Ceased: Not reported  
Last Inspection: 20001211  
Cleanup Meets Standard: True  
Recommended Penalty: Penalty Not Recommended  
Spiller Cleanup Date: Not reported  
Enforcement Date: Not reported  
Investigation Complete: Not reported  
UST Involvement: False  
Spill Record Last Update: 02/08/2001  
Is Updated: False  
Corrective Action Plan Submitted: Not reported  
Date Spill Entered In Computer Data File: 12/08/2000 15:26  
Date Region Sent Summary to Central Office: Not reported  
Tank Test:  
PBS Number: Not reported  
Tank Number: Not reported  
Test Method: Not reported  
Capacity of Failed Tank: Not reported  
Leak Rate Failed Tank: Not reported  
Gross Leak Rate: Not reported  
Material:  
Material Class Type: 1  
Quantity Spilled: 80  
Units: Gallons  
Unknown Qty Spilled: 80  
Quantity Recovered: 80  
Unknown Qty Recovered: False  
Material: DIESEL  
Class Type: Petroleum  
Chem Abstract Service Number: DIESEL  
Last Date: 07/28/1994  
Num Times Material Entry In File: 10625  
Remarks: ACCIDENT, ABOUT 80 GALLONS ON THE GROUND, REQUEST RESPONSE  
DEC Remarks: 12/08/00: JFO ON SITE, MET WITH TOM FITZPATRICK OF BFD, JERRY RIGHT THE  
TRUCK DRIVER. DRIVER DROVE INTO A LOT TO TURN AROUND AND HIT AN ENGINE

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
EPA ID Number

TRUCK AT OLD BAKERY SALVA (Continued)

S104880949

BLOCK RIPPING A HOLE IN HIS DIESEL TANK. THE FIRE DEPT SPREAD SPEEDY DRY ON THE SPILL AREA AND PLUGGED THE HOLE IN THE TANK. THE OWNER OF THE TRUCK, RYDER TRUCK LEASING, HIRED OP TECH TO CLEANUP THE SPILL. PAUL SUOZZI SHOWED UP ON SITE. HE WILL DRUM ALL THE SPEEDY DRY AND COVER THE SPILL AREA WITH PLASTIC AND PLACE THE DRUMS AND CONES ON THE PLASTIC. 12/09/00: JFO ON SITE, SPEEDY DRY HAS BEEN DRUMMED AND THE PLASTIC IS IN PLACE WITH CONES. I WILL VISIT SITE MONDAY. 12/11/00: JFO ON SITE, MET WITH PAUL SUOZZI. APPROX 150 TONS OF SOIL HAS BEEN PLACED ON PLASTIC FOR DISPOSAL. PAUL SAMPLED. THE SPILL AREA HAS BEEN EXCAVATED TO ABOUT 3 DEEP AND 20 X 20. THEY ARE BEGINNING TO BACKFILL. ANALYTICAL AND DISPOSAL RECEIPTS TO FOLLOW. 12/18/00: JFO RECEIVED THE ANALYTICAL FOR THE EXCAVATION 8021 AND 8270) BELOW STARS. RECEIPTS TO FOLLOW. 01/08/01: JFO RECEIVED DISPOSAL RECEIPTS FOR 124.51 TONS OF SOIL. NO FURTHER ACTION REQUIRED. CLOSED

C9  
WSW  
< 1/8  
316 ft.  
Higher

NIAGARA LUBRICANT  
142 CHANDLER  
BUFFALO, NY

NY Spills S105141312  
N/A

Site 1 of 5 in cluster C

SPILLS:

Spill Number:	0175250	Region of Spill:	9
Facility Contact:	LEON SMITH (PRESIDENT)	Facility Tele:	(716) 874-2300
Investigator:	JFO	SWIS:	14
Caller Name:	Not reported	Caller Agency:	Not reported
Caller Phone:	Not reported	Caller Extension:	Not reported
Notifier Name:	Not reported	Notifier Agency:	Not reported
Notifier Phone:	Not reported	Notifier Extension:	Not reported
Spiller Contact:	LEON SMITH	Spiller Phone:	(716) 874-2300
Spiller:	NIAGARA LUBRICANT		
Spiller Address:	164 CHANDLER STREET BUFFALO, NY 14207		

Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.

Spill Closed Dt: Not reported

Spill Cause: Unknown

Water Affected: Not reported

Spill Notifier: Citizen

Spill Date: 08/01/2001 12:00

Cleanup Ceased: Not reported

Last Inspection: 20010817

Cleanup Meets Standard: False

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Date: Not reported

Enforcement Date: Not reported

Investigation Complete: Not reported

UST Involvement: False

Spill Record Last Update: 11/27/2001

Is Updated: False

Corrective Action Plan Submitted: Not reported

Date Spill Entered In Computer Data File: 08/07/2001 14:45

Date Region Sent Summary to Central Office: Not reported

Tank Test:

PBS Number: Not reported

Tank Number: Not reported

Test Method: Not reported

Capacity of Failed Tank: Not reported

Leak Rate Failed Tank: Not reported

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
EPA ID Number

NIAGARA LUBRICANT (Continued)

S105141312

Gross Leak Rate: Not reported  
Material:  
Material Class Type: 1  
Quantity Spilled: 0  
Units: Gallons  
Unknown Qty Spilled: No  
Quantity Recovered: 0  
Unknown Qty Recovered: True  
Material: UNKNOWN PETROLEUM  
Class Type: Petroleum  
Chem Abstract Service Number: UNKNOWN PETROLEUM  
Last Date: 09/29/1994  
Num Times Material Entry In File: 16414

Remark: COMPLAINANT SAYS THAT OILY SUBSTANCE IS SEEPING UP OUT OF THE GROUND IN THE DRIVEWAY AND THAT IT WASHES INTO THE SEWER WHEN IT RAINS. CLAIMS THERE IS A SIGNIFICANT AMOUNT SEEPING UP AND THAT COMPANY HAS A GRAVEL PILE SITTING RIGHT NEXT TO AFFECTED AREA AND CONTINUALLY COVERS IT UP.

DEC Remarks: 08/07/01 JFO AND SAC ON SITE MET WITH LEON SMITH THE PRESIDENT OF THE COMPANY. HE HAD CALLED ENV SERVICE GROUP TO DO THE CLEANUP. IT WILL CONSIST OF DIGGING OUT THE DRIVEWAY BETWEEN 142 AND 146 CHANDLER ST. IT IS UNKNOWN HOW MUCH WAS SPILLED. ENV SRV GROUP WILL START THURSDAY. I WILL BE ON SITE FOR THE DIG. 08/08/01 JFO SENT TREATMENT LETTER TO MR SMITH. 08/10/01 JFO ON SITE MET WITH MIKE AND BOB LINHART BOTH OF ENV. SRV GROUP. THEY ARE DIGGING IN THE DRIVEWAY BETWEEN 142 AND 1150. THEY HAVE UNCOVERED A LOT OF OIL. IT LOOKS LIKE WASTE OIL AND HAS NO OIL OR. 08/11/01 JFO ON SITE NO ONE AVAILABLE AND NO ACTIVITY. 08/13/01 JFO ON SITE MET WITH MIKE AND BOB. THEY ARE DIGGING TO CLAY APPROX 3'). WHEN THEY DIG, PRODDUCT APPEARS IN THE HOLE. THEY ARE STAGING SOIL IN THE BACK LOT OUTSIDE THE FENCE. 08/14/01 JFO ON SITE MET WITH MIKE, BOB AND DAVE MENDEL. THEY HAVE DUG SEVERAL CUTOFF TRENCHES. OIL APPEARS EVERYWHERE EXCEPT BY THE BACK FENCE. THEY ARE DEWATERING THE EXCAVATION USING A 10,000 GALLON TANK ALREADY ON SITE. 08/16/01 JFO ON SITE MET WITH MIKE OF ESG. HE IS STILL DIGGING. THE CLAY BOTTOM IN THE EXCAVATION IS STAINED. OIL IS STILL SEEPING IN THE SIDES OF THE EXCAVATION IN SOME AREAS. APPROX 200 TONS OF SOIL IS STAGED ON PLASTIC AND COVERED. 08/17/01 JFO AND FG ON SITE MET WITH BOB LINHART SR AND DAVE MENDEL OF ESG ALONG WITH TOM MCLEOD OF NIAGARA LUB TO DISCUSS THEIR OPTIONS. SEVERAL OPTIONS WERE RAISED. 1. THEY CAN KEEP DIGGING AND CONSULT AN ENV. ATTY. 2. THEY CAN LET US DO THE WORK USING THE SPILL FUND 3. THEY CAN CONTACT PENNZOIL/QUAKER STATE TO SEE IF THEY WILL ACCEPT RESPONSIBILITY. BUT FIRST THEY MUST CHECK THEIR PURCHASE AGREEMENT TO SEE IF THEY BOUGHT THE TANKS AND ALL RESPONSIBILITY. TOM WILL CALL ME NEXT WEEK TO LET ME WHAT THEY WILL BE DOING. UNTIL THEN THEY WILL KEEP DIGGING AND STAGING THE SOIL. DAVE WILL CALL ME WHEN SECTIONS ARE COMPLETED AND READY FOR SAMPLING AND BACKFILLING. 08/29/01 JFO REC'D NOTIFICATION THAT THEY WILL BE REMOVING THE 20,000 GALLON ASPHALT TANK (UST) 8/31. 09/04/01 JFO ON SITE MET WITH MIKE. THE TANK HAS BEEN REMOVED. THE EXCAVATION LOOKS CLEAN. ALSO REC'D ANALYTICAL DATA (2 SAMPLES) INDICATING BENZO(a)PYRENE @ 167 PPB (61 PPB) IS THE ONLY COMPOUND OVER TAGMS. 09/05/01 JFO REC'D MORE ANALYTICAL RESULTS (2 SAMPLES) ALL BELOW TAGMS. I NEED A SKETCH OF THE SITE INDICATING WHERE THE SAMPLES WERE COLLECTED FROM. 09/10/01 JFO ON SITE THE SOUTH SIDE OF THE YARD HAS BEEN BACKFILLED. THE 20K GALLON ASPHALT TANK HAS BEEN CLEANED. THE ABOVEGROUND TANK (RAILROAD CAR) HAS BEEN CUT OPEN. IT CONTAINED TAR AND SCRAP WOOD. JFO BACK TO SITE SEVERAL TIMES NO ACTIVITY. 10/31/01 JFO CALL TO DAVE MENDEL OF ESG. HE SAID NIAGARA LUB IS GOING TO CLOSE THE REMAINING ABOVEGROUND TANKS. THEY WILL

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

NIAGARA LUBRICANT (Continued)

EDR ID Number  
EPA ID Number

Database(s)

S105141312

L CONTACT ESG WHEN THEY ARE DONE SO ESG CAN COMPLETE THE CLEANUP. JFO C  
ALL TO MR MCLEOD. I LEFT A MESSAGE ON HIS V-MAIL FOR HIM TO CALL ME.  
11/01/01 JFO TELCON WITH TOM MCLEOD. NIAGARA LUB WILL BE REMOVING THE  
TANKS SO THEY CAN SALVAGE SOME TANKS, VALVES AND OTHER EQUIPMENT. THEN  
ESG WILL BE ABLE TO FINISH CLEANUP. I TOLD MR MCLEOD THAT THE SOIL IN T  
HE BACK OF THE BUILDING IS CONTAMINATED AND NEEDED TO BE REMOVED. HE WI  
LL SEND IN A WORK PLAN ALONG WITH A SCHEDULE FOR THE WORK. 11/27/01  
JFO CALL FROM JOHN BANASZAK AN ENGINEER FROM NIAGARA LUB. HE WILL BE SU  
BBMITTING A WORK PLAN. I ALSO INFORMED OF THE SOIL CONTAMINATION BEHIND T  
HE BUILDING.

C10  
West  
< 1/8  
336 ft.  
Higher

K R K AUTO & BODY CENTER  
140 CHANDLER STREET  
BUFFALO, NY

NY Spills S102174772  
N/A

Site 2 of 5 in cluster C

SPILLS:

Spill Number:	9206018	Region of Spill:	9
Facility Contact:	Not reported	Facility Tele:	Not reported
Investigator:	MNP	SWIS:	14
Caller Name:	Not reported	Caller Agency:	Not reported
Caller Phone:	Not reported	Caller Extension:	Not reported
Notifier Name:	Not reported	Notifier Agency:	Not reported
Notifier Phone:	Not reported	Notifier Extension:	Not reported
Spiller Contact:	Not reported	Spiller Phone:	Not reported
Spiller:	K R K AUTO & BODY CENTER		
Spiller Address:	140 CHANDLER STREET BUFFALO, NY		

Spill Class: Possible release with minimal potential for fire or hazard or Known  
release with no damage. No DEC Response. No corrective action required.

Spill Closed Dt:	03/25/1993	Resource Affected:	On Land
Spill Cause:	Deliberate	Spill Source:	Other Commercial/Industrial
Water Affected:	Not reported	PBS Number:	Not reported
Spill Notifier:	Citizen	Reported to Dept:	08/24/1992 16:00
Spill Date:	08/01/1992 12:00		
Cleanup Ceased:	03/25/1993		
Last Inspection:	19930325		

Cleanup Meets Standard: True  
Recommended Penalty: Penalty Not Recommended  
Spiller Cleanup Date: Not reported  
Enforcement Date: Not reported  
Investigation Complete: Not reported  
UST Involvement: False  
Spill Record Last Update: 05/14/1993  
Is Updated: False

Corrective Action Plan Submitted: Not reported  
Date Spill Entered In Computer Data File: 09/03/1992  
Date Region Sent Summary to Central Office: Not reported

Tank Test:

PBS Number:	Not reported
Tank Number:	Not reported
Test Method:	Not reported
Capacity of Failed Tank:	Not reported
Leak Rate Failed Tank:	Not reported
Gross Leak Rate:	Not reported

Material:

Material Class Type:	1
Quantity Spilled:	0

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
EPA ID Number

K R K AUTO & BODY CENTER (Continued)

S102174772

Units: Not reported  
Unknown Qty Spilled: No  
Quantity Recovered: 0  
Unknown Qty Recovered: True  
Material: WASTE OIL  
Class Type: Petroleum  
Chem Abstract Service Number: WASTE OIL  
Last Date: 09/27/1994  
Num Times Material Entry In File: 9509  
Remarks: DUMPING OIL BY RAILROAD TRACKS BEHIND BLDG  
DEC Remarks: 03/25/93: 3/25/93 MNP INSP. MINOR SPILLAGE FROM OPERATIONS. NO FURTHER ACTION NEEDED, COMPLETE.

C11  
West  
< 1/8  
358 ft.  
Higher

FIRE AT BAKERY SALVAGE  
138 CHANDLER STREET  
BUFFALO, NY

NY Spills S103570448  
N/A

Site 3 of 5 in cluster C

SPILLS:

Spill Number:	9615033	Region of Spill:	9
Facility Contact:	Not reported	Facility Tele:	( ) -
Investigator:	MF	SWIS:	14
Caller Name:	Not reported	Caller Agency:	Not reported
Caller Phone:	Not reported	Caller Extension:	Not reported
Notifier Name:	Not reported	Notifier Agency:	Not reported
Notifier Phone:	Not reported	Notifier Extension:	Not reported
Spiller Contact:	DAVE OLSHAN	Spiller Phone:	(716) 877-4752
Spiller:	BAKERY SALVAGE		
Spiller Address:	138 CHANDLER STREET BUFFALO, NY		
Spill Class:	Possible release with minimal potential for fire or hazard or Known release with no damage. DEC Response. Willing Responsible Party. Corrective action taken.		
Spill Closed Dt:	03/31/1997		
Spill Cause:	Other	Resource Affected:	On Land
Water Affected:	Not reported	Spill Source:	Other Commercial/Industrial
Spill Notifier:	Fire Department	PBS Number:	Not reported
Spill Date:	03/29/1997 15:00	Reported to Dept:	03/29/1997 15:31
Cleanup Ceased:	03/31/1997		
Last Inspection:	19970329		
Cleanup Meets Standard:	True		
Recommended Penalty:	Penalty Not Recommended		
Spiller Cleanup Date:	Not reported		
Enforcement Date:	Not reported		
Investigation Complete:	Not reported		
UST Involvement:	False		
Spill Record Last Update:	03/31/1997		
Is Updated:	False		
Corrective Action Plan Submitted:	Not reported		
Date Spill Entered In Computer Data File:	03/29/1997		
Date Region Sent Summary to Central Office:	Not reported		
Tank Test:			
PBS Number:	Not reported		
Tank Number:	Not reported		
Test Method:	Not reported		
Capacity of Failed Tank:	Not reported		
Leak Rate Failed Tank:	Not reported		
Gross Leak Rate:	Not reported		



Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
EPA ID Number

FIRE AT BAKERY SALVAGE (Continued)

S103570448

Material:

Material Class Type: 3  
Quantity Spilled: 0  
Units: Gallons  
Unknown Qty Spilled: No  
Quantity Recovered: 0  
Unknown Qty Recovered: False  
Material: UNKNOWN NON-PETRO/NON-HAZ MATERIAL  
Class Type: Non Pet/Non Haz  
Chem Abstract Service Number: UNKNOWN NON-PETRO/NON-HAZ MATERIAL  
Last Date: 09/26/1994  
Num Times Material Entry In File: 921

Remarks: FIRE DESTROYED A BIOCELL AND SHOULD BE CHECKED

DEC Remarks: 03/29/97: MF S/V/GEORGE COATS, FIRE CHIEF/PAUL WAWKO, FOREMAN, BAKERY SALVAGE. FIRE IN BIO-CELL HORSE MANURE, WOOD CHIPS) FOR AIR DISCHARGE, FRIDAY, REIGNITED TODAY, DESTROYING ENTIRE BIO-CELL. BIO MATERIAL BEING SPREAD OUTSIDE WITH THE AID OF BUFFALO DPW, MAY HAVE TO BE DISPOSED OF. FIRE DEPT HOSEING AREA. BIO CELL IS INSIDE BUILDING. ALL PIPING TO CELL DESTROYED. THEY WILL NOT BE ABLE TO OPERATE, WET OPERATION. SPILL REFERRED TO DAR SOLID WASTE, DAR IS MONITORING FACILITY BIO MATERIAL WILL HAVE TO BE DISPOSED OF. NO FURTHER ACTION NECESSARY BY SPILLS. NO PETROLEUM OR HAZ MAT INVOLVED.

C12  
West  
< 1/8  
420 ft.  
Higher

BAKERY SALVAGE  
132 CHANDLER STREET  
BUFFALO, NY

NY Spills S104194522  
N/A

Site 4 of 5 in cluster C

SPILLS:

Spill Number: 9975385  
Facility Contact: Not reported  
Investigator: RMC  
Caller Name: Not reported  
Caller Phone: Not reported  
Notifier Name: Not reported  
Notifier Phone: Not reported  
Spiller Contact: DAVID OLSHAN  
Spiller: LACKAWANNA PRODUCTS  
Spiller Address: 8800 SHERIDAN DRIVE  
CLARENCE, NY 14031

Region of Spill: 9  
Facility Tele: ( ) -  
SWIS: 14  
Caller Agency: Not reported  
Caller Extension: Not reported  
Notifier Agency: Not reported  
Notifier Extension: Not reported  
Spiller Phone: (716) 633-1940

Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 11/12/1999

Spill Cause: Unknown

Water Affected: Not reported

Spill Notifier: Other

Spill Date: 08/30/1999 08:00

Cleanup Ceased: Not reported

Last Inspection: Not reported

Cleanup Meets Standard: True

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Date: Not reported

Enforcement Date: Not reported

Investigation Complete: Not reported

UST Involvement: False

Spill Record Last Update: 11/22/1999

Is Updated: False

Corrective Action Plan Submitted: Not reported

Resource Affected: On Land

Spill Source: Other Commercial/Industrial

PBS Number: Not reported

Reported to Dept: 08/30/1999 12:20

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

BAKERY SALVAGE (Continued)

EDR ID Number  
EPA ID Number

Database(s)

S104194522

Date Spill Entered In Computer Data File: 08/30/1999 12:23

Date Region Sent Summary to Central Office: Not reported

Tank Test:

PBS Number: Not reported  
Tank Number: Not reported  
Test Method: Not reported  
Capacity of Failed Tank: Not reported  
Leak Rate Failed Tank: Not reported  
Gross Leak Rate: Not reported

Material:

Material Class Type: 1  
Quantity Spilled: 0  
Units: Gallons  
Unknown Qty Spilled: No  
Quantity Recovered: 0  
Unknown Qty Recovered: True  
Material: UNKNOWN PETROLEUM  
Class Type: Petroleum  
Chem Abstract Service Number: UNKNOWN PETROLEUM  
Last Date: 09/29/1994  
Num Times Material Entry In File: 16414

Remark: DID PHASE ONE WHICH LEAD TO PHASE TWO, STAINING AND SOME PETROLEUM ODORS NOTED UPON DOING TEST PITS, REPORT TO FOLLOW

DEC Remarks: 09/01/99: RMC NOTE TO FILE, REPORT DUE 9/30 11/12/99: RMC REVIEWED RE PORT RECEIVED 10/20/99, REMOVED 60 TONS CONTAMINATED SOILS AROUND OLD AS TS LONG AGO REMOVED, TWO SAMPLES TAKEN, NO EXCEEDANCES 8021, TWO ESTIMATED VALUE HITS 8270, THEN RAN TCLP WITH NO EXCEEDANCES, NO FURTHER ACTION REQUIRED, LETTER, CLOSE OUT

C13  
West  
< 1/8  
441 ft.  
Higher

BAKERY SALVAGE

130 CHANDLER  
BUFFALO, NY

NY Spills S102245459  
N/A

Site 5 of 5 in cluster C

SPILLS:

Spill Number: 9603008  
Facility Contact: GARY HUNT  
Investigator: MNP  
Caller Name: Not reported  
Caller Phone: Not reported  
Notifier Name: Not reported  
Notifier Phone: Not reported  
Spiller Contact: DAVE OLSHAN  
Spiller: BAKERY SALVAGE  
Spiller Address: 138 CHANDLER  
BUFFALO, NY 14207

Region of Spill: 9  
Facility Tele: (716) 877-4752  
SWIS: 14  
Caller Agency: Not reported  
Caller Extension: Not reported  
Notifier Agency: Not reported  
Notifier Extension: Not reported  
Spiller Phone: (716) 877-4752

Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 07/07/1997

Spill Cause: Unknown

Water Affected: Not reported

Spill Notifier: Local Agency

Spill Date: 06/02/1996 17:30

Cleanup Ceased: Not reported

Last Inspection: 19961218

Cleanup Meets Standard: True

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Date: Not reported

Resource Affected: On Land

Spill Source: Other Commercial/Industrial

PBS Number: Not reported

Reported to Dept: 06/03/1996 11:56

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation     Site

MAP FINDINGS

Database(s)     EDR ID Number  
EPA ID Number

BAKERY SALVAGE (Continued)

S102245459

Enforcement Date: Not reported  
Investigation Complete: Not reported  
UST Involvement: False  
Spill Record Last Update: 07/10/1997  
Is Updated: False  
Corrective Action Plan Submitted: Not reported  
Date Spill Entered In Computer Data File: 06/03/1996  
Date Region Sent Summary to Central Office: Not reported

Tank Test:

PBS Number: Not reported  
Tank Number: Not reported  
Test Method: Not reported  
Capacity of Failed Tank: Not reported  
Leak Rate Failed Tank: Not reported  
Gross Leak Rate: Not reported

Material:

Material Class Type: 1  
Quantity Spilled: 0  
Units: Gallons  
Unknown Qty Spilled: No  
Quantity Recovered: 0  
Unknown Qty Recovered: True  
Material: WASTE OIL  
Class Type: Petroleum  
Chem Abstract Service Number: WASTE OIL  
Last Date: 09/27/1994  
Num Times Material Entry In File: 9509  
Material Class Type: 3  
Quantity Spilled: 0  
Units: Gallons  
Unknown Qty Spilled: No  
Quantity Recovered: 0  
Unknown Qty Recovered: False  
Material: ALGAE  
Class Type: Non Pet/Non Haz  
Chem Abstract Service Number: ALGAE  
Last Date: Not reported  
Num Times Material Entry In File: 54

Remark: inspector from SPCA went to site and saw some slime running from cracks in building. Dead birds found. Inspector visited site on 6/2/96 at 5:30 pm

DEC Remarks: 06/03/96: MNP INSP. MET W/ GARY HUNT FOREMAN) - BAKERY SALVAGE. THEY RECYCLE BAKERY BYPRODUCTS WASTE. WE WALKED AROUND MAIN MAINTENANCE BUILDINGS. FOOD WASTES NOTED ON GROUND OUTSIDE LOADING DOORS ON MAIN BLDG. OIL SPILLAGE AT WEST END OF MAINTENANCE BLDG. I REQUESTED CLEANUP OF OIL CONTAMINATED SOIL. ALSO, I OBSERVED WATER GREEN ALGAE IN FRONT OF MAIN BLDG. COMING FROM 2 CRACKS BY OVERHEAD DOOR. NO DEAD ANIMALS BIRDS OBSERVED DURING INSPECTION. 07/01/96: MNP TELECON W/ GARY HUNT - BAKERY SALVAGE. NO CLEANUP DONE YET, DEC SENDING LETTER REQUESTING CLEANUP. 12/13/96: MNP TELECON TO DAVE OLSHAN - BAKERY SALVAGE. NOT IN, STATUS OF DISPOSAL UNKNOWN. I AM TO CALL BACK MON. MORNING 12/16/96). 12/18/96: MNP INSP. CONTAMINATED SOIL PILE GONE. 07/02/97: MNP TELECON TO BAKERY SALVAGE AT 877-4752, BUT COMPANY BOUGHT BY ADVANCED ORGANICS. I SPOKE TO GARY POST, HE SAID DAVE OLSHAN FORMER OWNER OF BAKERY SALVAGE WOULD BE THE PERSON TO TALK TO. POST GAVE ME OLSHAN'S PHONE 633-1940. 07/02/97: MNP TELECON W/ DAVE OLSHAN. HE SAID SOIL WAS DISPOSED AT LAKE VIEW LANDFILL. HE WILL LOCATE DISPOSAL RECEIPT FAX COPY. IF HE CAN'T F

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

BAKERY SALVAGE (Continued)

EDR ID Number  
EPA ID Number

Database(s)

S102245459

IND WEIGH TICKET, I SUGGESTED HE CONTACT LAKE VIEW HAVE THEM FAX IT.  
07/07/97: RECEIVED FAX OF NON-HAZ WASTE MANIFESTS FROM DAVE OLSHAN. LAKE  
VIEW LANDFILL RECEIVED 58.23 TONS OF OIL CONTAMINATED SOIL ON 9/5/96. NO  
FURTHER ACTION, COMPLETE.

14  
East  
< 1/8  
489 ft.  
Higher

COMBINED SUPPLY & EQUIPMENT CO INC  
215 CHANDLER ST  
BUFFALO, NY 14207

RCRIS-SQG 1000163440  
FINDS NYD002110609

RCRIS:

Owner: MYRTLE W LEVINESS  
(212) 555-1212

EPA ID: NYD002110609

Contact: DONALD PATERSON  
(716) 873-2920

Classification: Handler transports wastes, but commercial status is unknown, Small Quantity  
Generator

Used Oil Recyc: No

TSD Activities: Not reported

Violation Status: No violations found

FINDS:

Other Pertinent Environmental Activity Identified at Site:

Facility Registry System (FRS)

Resource Conservation and Recovery Act Information system (RCRAINFO)

D15  
East  
1/8-1/4  
838 ft.  
Higher

BUFFALO WEAVING & BELTING CO  
260 CHANDLER ST  
BUFFALO, NY 14207

RCRIS-SQG 1000227736  
FINDS NYD002111375

Site 1 of 2 in cluster D

RCRIS:

Owner: VICTOR BALATA BELTING  
(212) 555-1212

EPA ID: NYD002111375

Contact: BOB MAXWELL  
(716) 875-7223

Classification: Small Quantity Generator

Used Oil Recyc: No

TSD Activities: Not reported

Violation Status: No violations found

NY MANIFEST

Additional detail is available in NY MANIFEST. Please contact your EDR Account Executive for more information.

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

**BUFFALO WEAVING & BELTING CO (Continued)**

EDR ID Number  
EPA ID Number

1000227736

**FINDS:**

Other Pertinent Environmental Activity Identified at Site:

AIRS Facility System (AIRS/AFS)  
Facility Registry System (FRS)  
National Compliance Database (NCDB)  
National Emissions Trends (NET)  
Resource Conservation and Recovery Act Information system (RCRAINFO)

D16  
East  
1/8-1/4  
838 ft.  
Higher

**PHARGO,LLC DBA BUFFALO WEAVING & BELTING CO**  
**260 CHANDLER ST**  
**BUFFALO, NY 14207**

UST U003316538  
N/A

Site 2 of 2 in cluster D

**PBS UST:**

PBS Number: 9-033383 CBS Number: Not reported  
SPDES Number: Not reported SWIS ID: 1402  
Operator: BUFFALO WEAVING & BELTING CO

(716) 875-7223  
Emergency Contact: ROBERT H MAXWELL  
(716) 875-7223

Total Tanks: 2  
Owner: PHARGO,LLC D/B/A/ BUFFALO WEAVING & BELTING CO  
260 CHANDLER ST  
BUFFALO, NY 14207  
(716) 875-7223

Owner Type: Corporate/Commercial  
Owner Mark: First Owner  
Owner Subtype: Not reported  
Mailing Address: BUFFALO WEAVING & BELTING CO  
ATTN: ROBERT H MAXWELL  
260 CHANDLER ST  
BUFFALO, NY 14207  
(716) 875-7223

Tank Status: In Service  
Capacity (gals): 10000  
Tank Location: UNDERGROUND, VAULTED, WITH ACCESS

Tank Id: 1 Install Date: 10/01/1953  
Tank Type: Steel/carbon steel Product Stored: NOS 5 OR 6 FUEL OIL  
Tank Internal: NONE Pipe Internal: NONE  
Pipe Location: Aboveground Pipe Type: STEEL/IRON  
Tank External: PAINTED/ASPHALT COATING

Missing Data for Tank: No Missing Data

Pipe External: NONE

Second Containment: VAULT

Leak Detection: OTHER

Overfill Prot: Product Level Gauge

Date Tested: Not reported

Date Closed: Not reported

Deleted: False

Dead Letter: False

FAMT: Fiscal amount for registration fee is correct

Total Capacity: 20000

Tank Screen: No data missing

Renew Flag: Renewal has not been printed

Certification Flag: False

Old PBS Number: Not reported

Inspected Date: 04/19/1995

Dispenser: Suction  
Next Test Date: Not reported  
Test Method: Not reported  
Updated: True  
Owner Screen: No data missing

Renewal Date: Not reported  
Federal ID: Not reported  
Facility Screen: No data missing  
Certification Date: 07/13/2001  
Expiration Date: 10/17/2006  
Inspector: JES

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

Site

MAP FINDINGS

Database(s)  
EDR ID Number  
EPA ID Number

PHARGO,LLC DBA BUFFALO WEAVING & BELTING CO (Continued)

U003316538

Inspection Result:	Not reported	
Lat/long:	Not reported	
Facility Type:	MANUFACTURING	
Town or City:	BUFFALO (C)	
Town or City Code:	02	
County Code:	14	
Region:	9	
PBS Number:	9-033383	CBS Number: Not reported
SPDES Number:	Not reported	SWIS ID: 1402
Operator:	BUFFALO WEAVING & BELTING CO (716) 875-7223	
Emergency Contact:	ROBERT H MAXWELL (716) 875-7223	
Total Tanks:	2	
Owner:	PHARGO,LLC D/B/A/ BUFFALO WEAVING & BELTING CO 260 CHANDLER ST BUFFALO, NY 14207 (716) 875-7223	
Owner Type:	Corporate/Commercial	
Owner Mark:	First Owner	
Owner Subtype:	Not reported	
Mailing Address:	BUFFALO WEAVING & BELTING CO ATTN: ROBERT H MAXWELL 260 CHANDLER ST BUFFALO, NY 14207 (716) 875-7223	
Tank Status:	In Service	
Capacity (gals):	10000	
Tank Location:	UNDERGROUND, VAULTED, WITH ACCESS	
Tank Id:	2	Install Date: 10/01/1953
Tank Type:	Steel/carbon steel	Product Stored: NOS 5 OR 6 FUEL OIL
Tank Internal:	NONE	Pipe Internal: NONE
Pipe Location:	Aboveground	Pipe Type: STEEL/IRON
Tank External:	PAINTED/ASPHALT COATING	
Missing Data for Tank:	No Missing Data	
Pipe External:	NONE	
Second Containment:	VAULT	
Leak Detection:	OTHER	
Overfill Prot:	Product Level Gauge	Dispenser: Suction
Date Tested:	Not reported	Next Test Date: Not reported
Date Closed:	Not reported	Test Method: Not reported
Deleted:	False	Updated: True
Dead Letter:	False	Owner Screen: No data missing
FAMT:	Fiscal amount for registration fee is correct	
Total Capacity:	20000	Renewal Date: Not reported
Tank Screen:	No data missing	Federal ID: Not reported
Renew Flag:	Renwal has not been printed	Facility Screen: No data missing
Certification Flag:	False	Certification Date:07/13/2001
Old PBS Number:	Not reported	Expiration Date: 10/17/2006
Inspected Date:	04/19/1995	Inspector: JES
Inspection Result:	Not reported	
Lat/long:	Not reported	
Facility Type:	MANUFACTURING	
Town or City:	BUFFALO (C)	
Town or City Code:	02	
County Code:	14	

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

PHARGO,LLC DBA BUFFALO WEAVING & BELTING CO (Continued)

EDR ID Number  
EPA ID Number

Database(s)

Region: 9

U003316538

17  
ESE  
1/8-1/4  
1283 ft.  
Higher

WASTE STREAM TECHNOLOGY INC  
302 GROTE ST  
BUFFALO, NY 14207

PADS 1000158988  
RCRIS-SQG NYD002110062  
FINDS  
AST

RCRIS:

Owner: WASTE STREAM TECH INC  
(212) 555-1212  
EPA ID: NYD002110062  
Contact: MICHAEL BARNHART  
(716) 876-5290

Classification: Small Quantity Generator  
Used Oil Recyc: No  
TSDF Activities: Not reported

Violation Status: No violations found

NY MANIFEST

Additional detail is available in NY MANIFEST. Please contact your EDR Account Executive for more information.

FINDS:

Other Pertinent Environmental Activity Identified at Site:

Biennial Reporting System (BRS)  
Facility Registry System (FRS)  
National Compliance Database (NCDB)  
Resource Conservation and Recovery Act Information system (RCRAINFO)

PBS AST:

PBS Number: 9-508527 CBS Number: Not reported  
SPDES Number: Not reported SWIS Code: 1402  
Federal ID: Not reported Previous PBS#: 507946  
Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist or not at the facility.  
Facility Type: OTHER  
Owner Type: Corporate/Commercial  
Owner Sub Type: Not reported  
Owner: WASTE STREAM TECHNOLOGY INC  
302 GROTE STREET  
BUFFALO, NY 14207  
Owner Phone: (716) 876-5290  
Facility Phone: (716) 876-5290  
Operator: WASTE STREAM TECHNOLOGY INC  
Emergency Name: JAMES B HYZY  
Emergency Phone: (716) 833-7439  
Total Tanks: 1  
Total Capacity: 15000  
Tank ID: 1  
Capacity (Gal): 15000  
Missing Data for Tank : No data missing  
Tank Location: ABOVEGROUND 10% OR MORE BELOW GROUND  
Product Stored: NOS 5 OR 6 FUEL OIL  
Tank Type: Steel/carbon steel  
Install Date: 05/01/1946  
Tank Internal: NONE  
Tank External: PAINTED/ASPHALT COATING/NONE  
Tank Containment: VAULT/NONE

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation    Site

MAP FINDINGS

Database(s)  
EDR ID Number  
EPA ID Number

WASTE STREAM TECHNOLOGY INC (Continued)

1000158988

Pipe Type: GALVANIZED STEEL  
Pipe Location: Aboveground  
Pipe Internal: NONE  
Pipe External: NONE/NONE  
Leak Detection: IN-TANK SYSTEM/NONE  
Overfill Protection: High Level Alarm, None  
Dispenser Method: Suction  
Date Tested: / /  
Date Closed: / /  
Updated: True  
Date Inspected: 08/11/1993  
Result of Inspection: Not reported  
Mailing Name: WASTE STREAM TECHNOLOGY INC  
Mailing Address: 302 GROTE STREET  
BUFFALO, NY 14207  
Mailing Contact: JAMES B. HYZY  
Mailing Telephone: (716) 876-5290  
Owner Mark: Third Owner  
Certification Flag: False  
Renew Flag: False  
Lat/Long: Not reported  
Dead Letter: False  
Facility Screen: No data missing  
Owner Screen: No data missing  
Tank Screen: No data missing  
Town or City: BUFFALO (C)  
Town or City Code: 02  
County Code: 14  
Region: 9  
Expiration Date: 12/03/2005  
Certification Date: 11/03/2000  
Renew Date: / /  
Next Test Date: / /  
Test Method: Not reported  
Deleted: False  
Inspector: SIMON  
Fiscal Amount for Registration Fee is Correct: True

PBS OWNHIST

Operator: GREATER BUFFALO PRESS INC  
Emergency: EUGENE MALCZEWSKI  
Emergency Tel: (716) 627-5062  
Facility Type: Not reported  
Facility Owner: GREATER BUFFALO PRESS INC  
Facility Address: 302 GROTE ST  
BUFFALO, NY 14207  
Inspector: Not reported  
Insp Result: Not reported  
Owner: GREATER BUFFALO PRESS INC  
Owner Tel: (716) 876-6410  
Owner Subtype: Not reported  
Mail Address: GREATER BUFFALO PRESS INC  
302 GROTE ST  
BUFFALO, NY 14207  
Not reported  
(716) 876-6410  
Owner Mark: First Owner  
Certify Date: 09/19/1992  
Total Capacity (Gal): 15000  
CBS Registration Num : Not reported  
SPDES Number: Not reported  
Lat/Long : Not reported  
County Facility: 1402  
Facility Phone : (716) 876-6410  
Num of Active Tanks : 1  
Old PBSNO: 384062  
Inspect Date: Not reported  
Federal ID: Not reported  
Owner Type: Not reported  
Expiration: 09/19/1992



Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

WASTE STREAM TECHNOLOGY INC (Continued)

EDR ID Number  
EPA ID Number

Database(s)

1000158988

Facility Owner: GREATER BUFFALO PRESS INC  
Facility Address: 302 GROTE ST  
BUFFALO, NY 14207  
Owner Phone: (716) 876-6410  
Facility Status: 1  
Certificate Needs Printed : Not reported  
Renewal Printed : False  
Pre-printed Renewal Form Last Printed : Not reported  
Fiscal Amt For Registration Fee Pbsrect: False  
Dt Ownership Transfer Occurr in Computer : Not reported  
Facility Record Updated: False

Operator: SULLIVAN GRAPHICS  
Emergency: DAVE PARADOWSKI  
Emergency Tel: (716) 874-4515 Old PBSNO: 507946  
Facility Type: Not reported  
Facility Owner: SULLIVAN GRAPHICS  
Facility Address: 302 GROTE STREET  
BUFFALO, NY 14207

Inspector: Not reported Inspect Date: Not reported  
Insp Result: Not reported Federal ID: Not reported  
Owner: SULLIVAN GRAPHICS  
Owner Tel: (615) 377-0377 Owner Type: Not reported  
Owner Subtype: Not reported  
Mail Address: SULLIVAN GRAPHICS  
100 WINNERS CIRCLE  
NASHVILLE, TN 37027  
Not reported  
(615) 377-0377

Owner Mark: Second Owner  
Certify Date: 10/29/1995 Expiration: 10/29/1995  
Total Capacity (Gal): 15000  
CBS Registration Num : Not reported  
SPDES Number: Not reported  
Lat/Long : Not reported  
County Facility: 1402  
Facility Phone : (716) 874-4973  
Num of Active Tanks : 1  
Facility Owner: SULLIVAN GRAPHICS  
Facility Address: 100 WINNERS CIRCLE  
NASHVILLE, TN 37027  
(615) 377-0377

Owner Phone: (615) 377-0377  
Facility Status: 1  
Certificate Needs Printed : Not reported  
Renewal Printed : False  
Pre-printed Renewal Form Last Printed : Not reported  
Fiscal Amt For Registration Fee Pbsrect: False  
Dt Ownership Transfer Occurr in Computer : Not reported  
Facility Record Updated: False

Operator: GREATER BUFFALO PRESS INC  
Emergency: EUGENE MALCZEWSKI  
Emergency Tel: (716) 627-5062 Old PBSNO: 384062  
Facility Type: Not reported  
Facility Owner: GREATER BUFFALO PRESS INC

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

WASTE STREAM TECHNOLOGY INC (Continued)

EDR ID Number  
EPA ID Number

Database(s)

1000158988

Facility Address: 302 GROTE ST  
BUFFALO, NY 14207

Inspector: Not reported      Inspect Date: Not reported  
Insp Result: Not reported      Federal ID: Not reported  
Owner: GREATER BUFFALO PRESS INC  
Owner Tel: (716) 876-6410      Owner Type: Not reported  
Owner Subtype: Not reported  
Mail Address: GREATER BUFFALO PRESS INC  
302 GROTE ST  
BUFFALO, NY 14207  
Not reported  
(716) 876-6410

Owner Mark: First Owner  
Certify Date: 09/19/1992      Expiration: 09/19/1992  
Total Capacity (Gal): 15000  
CBS Registration Num : Not reported  
SPDES Number: Not reported  
Lat/Long : Not reported  
County Facility: 1402  
Facility Phone : (716) 876-6410  
Num of Active Tanks : 1  
Facility Owner: GREATER BUFFALO PRESS INC  
Facility Address: 302 GROTE ST  
BUFFALO, NY 14207

Owner Phone: (716) 876-6410  
Facility Status: 1  
Certificate Needs Printed : Not reported  
Renewal Printed : False  
Pre-printed Renewal Form Last Printed : Not reported  
Fiscal Amt For Registration Fee Pbsrect: False  
Dt Ownership Transfer Occur in Computer : Not reported  
Facility Record Updated: False

Operator: SULLIVAN GRAPHICS  
Emergency: DAVE PARADOWSKI  
Emergency Tel: (716) 874-4515      Old PBSNO: 507946  
Facility Type: Not reported  
Facility Owner: SULLIVAN GRAPHICS  
Facility Address: 302 GROTE STREET  
BUFFALO, NY 14207

Inspector: Not reported      Inspect Date: Not reported  
Insp Result: Not reported      Federal ID: Not reported  
Owner: SULLIVAN GRAPHICS  
Owner Tel: (615) 377-0377      Owner Type: Not reported  
Owner Subtype: Not reported  
Mail Address: SULLIVAN GRAPHICS  
100 WINNERS CIRCLE  
NASHVILLE, TN 37027  
Not reported  
(615) 377-0377

Owner Mark: Second Owner  
Certify Date: 10/29/1995      Expiration: 10/29/1995  
Total Capacity (Gal): 15000  
CBS Registration Num : Not reported  
SPDES Number: Not reported  
Lat/Long : Not reported

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

WASTE STREAM TECHNOLOGY INC (Continued)

EDR ID Number  
EPA ID Number

Database(s)

1000158988

County Facility: 1402  
Facility Phone : (716) 874-4973  
Num of Active Tanks : 1  
Facility Owner: SULLIVAN GRAPHICS  
Facility Address: 100 WINNERS CIRCLE

NASHVILLE, TN 37027  
Owner Phone: (615) 377-0377  
Facility Status: 1  
Certificate Needs Printed : Not reported  
Renewal Printed : False  
Pre-printed Renewal Form Last Printed : Not reported  
Fiscal Amt For Registration Fee Pbsrect: False  
Dt Ownership Transfer Occurr in Computer : Not reported  
Facility Record Updated: False

E18  
SE  
1/8-1/4  
1305 ft.  
Higher

GAS STATION  
600 AMHERST ST  
BUFFALO, NY 14207

UST U003317018  
N/A

Site 1 of 8 in cluster E

PBS UST:

PBS Number: 9-220604 CBS Number: Not reported  
SPDES Number: Not reported SWIS ID: 1402  
Operator: CHESTER NIEDZIALOWSKI

Emergency Contact: CHESTER NIEDZIALOWSKI  
(716) 834-9035

Total Tanks: 0  
Owner: CHESTER NIEDZIALOWSKI  
600 AMHERST ST  
BUFFALO, NY 14207  
(716) 876-3592

Owner Type: Corporate/Commercial  
Owner Mark: First Owner  
Owner Subtype: Not reported  
Mailing Address: CHET'S SERVICE  
ATTN: CHESTER NIEDZIALOWSKI  
600 AMHERST ST  
BUFFALO, NY 14207  
(716) 876-3592

Tank Status: Closed - Removed

Capacity (gals): 1000

Tank Location: UNDERGROUND

Tank Id: 1

Tank Type: Steel/carbon steel

Tank Internal: NONE

Pipe Location: Underground

Tank External: NONE/NONE

Missing Data for Tank: No Missing Data

Pipe External: PAINTED/ASPHALT COATING/NONE

Second Containment: NONE/NONE

Leak Detection: NONE/NONE

Overfill Prot: Product Level Gauge, None

Date Tested: Not reported

Date Closed: 07/13/2001

Deleted: False

Dead Letter: False

Install Date: Not reported  
Product Stored: LEADED GASOLINE  
Pipe Internal: NONE  
Pipe Type: STEEL/IRON

Dispenser: Suction  
Next Test Date: Not reported  
Test Method: Not reported  
Updated: True  
Owner Screen: No data missing

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number  
EPA ID Number

GAS STATION (Continued)

U003317018

FAMT:	Fiscal amount for registration fee is correct	Renewal Date:	10/27/1992
Total Capacity:	0	Federal ID:	Not reported
Tank Screen:	0	Facility Screen:	No data missing
Renew Flag:	Renwal has been printed	Certification Date:	10/31/1997
Certification Flag:	False	Expiration Date:	07/20/1997
Old PBS Number:	Not reported	Inspector:	JES
Inspected Date:	07/07/1995		
Inspection Result:	Not reported		
Lat/long:	Not reported		
Facility Type:	RETAIL GASOLINE SALES		
Town or City:	BUFFALO (C)		
Town or City Code:	02		
County Code:	14		
Region:	9		
PBS Number:	9-220604	CBS Number:	Not reported
SPDES Number:	Not reported	SWIS ID:	1402
Operator:	CHESTER NIEDZIALOWSKI (716) 876-3592		
Emergency Contact:	CHESTER NIEDZIALOWSKI (716) 834-9035		
Total Tanks:	0		
Owner:	CHESTER NIEDZIALOWSKI 600 AMHERST ST BUFFALO, NY 14207 (716) 876-3592		
Owner Type:	Corporate/Commercial		
Owner Mark:	First Owner		
Owner Subtype:	Not reported		
Mailing Address:	CHET'S SERVICE ATTN: CHESTER NIEDZIALOWSKI 600 AMHERST ST BUFFALO, NY 14207 (716) 876-3592		
Tank Status:	Closed - Removed	Install Date:	Not reported
Capacity (gals):	6000	Product Stored:	LEADED GASOLINE
Tank Location:	UNDERGROUND	Pipe Internal:	NONE
Tank Id:	2	Pipe Type:	STEEL/IRON
Tank Type:	Steel/carbon steel		
Tank Internal:	NONE		
Pipe Location:	Underground		
Tank External:	PAINTED/ASPHALT COATING/NONE		
Missing Data for Tank:	No Missing Data		
Pipe External:	PAINTED/ASPHALT COATING/NONE		
Second Containment:	NONE/NONE		
Leak Detection:	NONE/NONE		
Overfill Prot:	Product Level Gauge, None	Dispenser:	Suction
Date Tested:	01/01/1990	Next Test Date:	Not reported
Date Closed:	07/13/2001	Test Method:	HORNER
Deleted:	False	Updated:	True
Dead Letter:	False	Owner Screen:	No data missing
FAMT:	Fiscal amount for registration fee is correct		
Total Capacity:	0	Renewal Date:	10/27/1992
Tank Screen:	0	Federal ID:	Not reported
Renew Flag:	Renwal has been printed	Facility Screen:	No data missing
Certification Flag:	False	Certification Date:	10/31/1997
Old PBS Number:	Not reported	Expiration Date:	07/20/1997

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

GAS STATION (Continued)

EDR ID Number  
EPA ID Number

Database(s)

U003317018

Inspected Date: 07/07/1995 Inspector: JES  
Inspection Result: Not reported  
Lat/long: Not reported  
Facility Type: RETAIL GASOLINE SALES  
Town or City: BUFFALO (C)  
Town or City Code: 02  
County Code: 14  
Region: 9

PBS Number: 9-220604 CBS Number: Not reported  
SPDES Number: Not reported SWIS ID: 1402  
Operator: CHESTER NIEDZIALOWSKI  
(716) 876-3592  
Emergency Contact: CHESTER NIEDZIALOWSKI  
(716) 834-9035

Total Tanks: 0  
Owner: CHESTER NIEDZIALOWSKI  
600 AMHERST ST  
BUFFALO, NY 14207  
(716) 876-3592  
Owner Type: Corporate/Commercial  
Owner Mark: First Owner  
Owner Subtype: Not reported  
Mailing Address: CHET'S SERVICE  
ATTN: CHESTER NIEDZIALOWSKI  
600 AMHERST ST  
BUFFALO, NY 14207  
(716) 876-3592

Tank Status: Closed - Removed  
Capacity (gals): 2000  
Tank Location: UNDERGROUND  
Tank Id: 3  
Tank Type: Steel/carbon steel  
Tank Internal: NONE  
Pipe Location: Underground  
Tank External: PAINTED/ASPHALT COATING/NONE  
Missing Data for Tank: No Missing Data  
Pipe External: PAINTED/ASPHALT COATING/NONE  
Second Containment: NONE/NONE  
Leak Detection: NONE/NONE

Install Date: Not reported  
Product Stored: UNLEADED GASOLINE  
Pipe Internal: NONE  
Pipe Type: STEEL/IRON

Overfill Prot: Product Level Gauge, None  
Date Tested: 01/01/1990  
Date Closed: 07/13/2001  
Deleted: False  
Dead Letter: False  
FAMT: Fiscal amount for registration fee is correct

Dispenser: Suction  
Next Test Date: Not reported  
Test Method: HORNER  
Updated: True  
Owner Screen: No data missing

Total Capacity: 0  
Tank Screen: 0  
Renew Flag: Renewal has been printed  
Certification Flag: False  
Old PBS Number: Not reported  
Inspected Date: 07/07/1995  
Inspection Result: Not reported  
Lat/long: Not reported  
Facility Type: RETAIL GASOLINE SALES  
Town or City: BUFFALO (C)  
Town or City Code: 02

Renewal Date: 10/27/1992  
Federal ID: Not reported  
Facility Screen: No data missing  
Certification Date: 10/31/1997  
Expiration Date: 07/20/1997  
Inspector: JES

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

GAS STATION (Continued)

EDR ID Number  
EPA ID Number

Database(s)

U003317018

County Code: 14  
Region: 9

E19  
SE  
1/8-1/4  
1315 ft.  
Higher

GEM-COR  
601 AMHERST ST  
BUFFALO, NY 14207

RCRIS-SQG 1000457980  
FINDS NYD986932721

Site 2 of 8 in cluster E

RCRIS:

Owner: THOMAS SPELLER  
(212) 555-1212  
EPA ID: NYD986932721  
Contact: BETTY MAERTEN  
(716) 876-9685

Classification: Small Quantity Generator  
Used Oil Recyc: No  
TSDF Activities: Not reported

Violation Status: Violations exist

Regulation Violated: 40 cfr 262.34  
Area of Violation: GENERATOR-ALL REQUIREMENTS (OVERSIGHT)  
Date Violation Determined: 10/07/1994  
Actual Date Achieved Compliance: 08/24/1996  
Enforcement Action: VERBAL INFORMAL  
Enforcement Action Date: 10/07/1994  
Penalty Type: Not reported

Regulation Violated: 40 cfr 262.34  
Area of Violation: GENERATOR-LAND BAN REQUIREMENTS  
Date Violation Determined: 10/07/1994  
Actual Date Achieved Compliance: 08/24/1996  
Enforcement Action: VERBAL INFORMAL  
Enforcement Action Date: 10/07/1994  
Penalty Type: Not reported

There are 2 violation record(s) reported at this site:

Evaluation	Area of Violation	Date of Compliance
Compliance Evaluation Inspection	GENERATOR-ALL REQUIREMENTS (OVERSIGHT)	19960824
	GENERATOR-LAND BAN REQUIREMENTS	19960824

NY MANIFEST

Additional detail is available in NY MANIFEST. Please contact your EDR Account Executive for more information.

FINDS:

Other Pertinent Environmental Activity Identified at Site:  
Facility Registry System (FRS)  
Resource Conservation and Recovery Act Information system (RCRAINFO)

E20  
SE  
1/8-1/4  
1315 ft.  
Higher

601 AMHERST STREET  
601 AMHERST STREET  
BUFFALO, NY

VCP S103843729  
N/A

Site 3 of 8 in cluster E

NY VCP:

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

601 AMHERST STREET (Continued)

EDR ID Number  
EPA ID Number

Database(s)

Facility ID V00084-9  
Agreement Type Remed.  
Date Signed 02/12/1997  
Volunteer Wegmans Food Market

S103843729

E21  
SE  
1/8-1/4  
1315 ft.  
Higher

PERSONNEL CONTRACTORS  
601 AMHERST ST SE 1ST FLOOR  
BUFFALO, NY 14207

RCRIS-SQG 1001119705  
FINDS NYR000029959

Site 4 of 8 in cluster E

RCRIS:

Owner: PERSONNEL CONTRACTORS  
(716) 877-7110  
EPA ID: NYR000029959  
Contact: RONALD NOWACK  
(716) 877-7110

Classification: Small Quantity Generator  
Used Oil Recyc: No  
TSDF Activities: Not reported  
Violation Status: No violations found

NY MANIFEST

Additional detail is available in NY MANIFEST. Please contact your EDR Account Executive for more information.

FINDS:

Other Pertinent Environmental Activity Identified at Site:  
Facility Registry System (FRS)  
Resource Conservation and Recovery Act Information system (RCRAINFO)

E22  
SE  
1/8-1/4  
1315 ft.  
Higher

MORRISON INDUSTRIES L P  
601 AMHERST ST  
BUFFALO, NY 14207

RCRIS-SQG 1000457697  
FINDS NYD986929586  
NY Spills

Site 5 of 8 in cluster E

RCRIS:

Owner: MORRISON INDUSTRIES L P  
(212) 555-1212  
EPA ID: NYD986929586  
Contact: MARK KOPASKIE  
(716) 875-7660

Classification: Small Quantity Generator  
Used Oil Recyc: No  
TSDF Activities: Not reported

Violation Status: Violations exist

Regulation Violated: Not reported  
Area of Violation: GENERATOR-ALL REQUIREMENTS (OVERSIGHT)  
Date Violation Determined: 10/03/1991  
Actual Date Achieved Compliance: 11/06/1992

Enforcement Action: INITIAL 3008(A) COMPLIANCE ORDER  
Enforcement Action Date: 12/05/1991  
Penalty Type: Proposed Monetary Penalty  
Enforcement Action: FINAL 3008(A) COMPLIANCE ORDER

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

MORRISON INDUSTRIES L P (Continued)

EDR ID Number  
EPA ID Number

Database(s)

1000457697

Enforcement Action Date: 03/06/1992  
Penalty Type: Proposed Monetary Penalty

There are 1 violation record(s) reported at this site:

Evaluation	Area of Violation	Date of Compliance
Compliance Evaluation Inspection	GENERATOR-ALL REQUIREMENTS (OVERSIGHT)	19921106

NY MANIFEST

Additional detail is available in NY MANIFEST. Please contact your EDR Account Executive for more information.

FINDS:

Other Pertinent Environmental Activity Identified at Site:  
Facility Registry System (FRS)  
Resource Conservation and Recovery Act Information system (RCRAINFO)

SPILLS:

Spill Number:	8901265	Region of Spill:	9
Facility Contact:	Not reported	Facility Tele:	Not reported
Investigator:	MJH	SWIS:	14
Caller Name:	Not reported	Caller Agency:	Not reported
Caller Phone:	Not reported	Caller Extension:	Not reported
Notifier Name:	Not reported	Notifier Agency:	Not reported
Notifier Phone:	Not reported	Notifier Extension:	Not reported
Spiller Contact:	Not reported	Spiller Phone:	(716) 875-7660
Spiller:	MORRISON INDUSTRIES		
Spiller Address:	601 AMHERST STREET BUFFALO, NY 14207		
Spill Class:	Not reported		
Spill Closed Dt:	11/20/1989		
Spill Cause:	Unknown	Resource Affected:	Groundwater
Water Affected:	Not reported	Spill Source:	Other Commercial/Industrial
Spill Notifier:	Other	PBS Number:	Not reported
Spill Date:	05/09/1989 10:30	Reported to Dept:	05/09/1989 10:45
Cleanup Ceased:	11/20/1989		
Last Inspection:	19890825		
Cleanup Meets Standard:	True		
Recommended Penalty:	Penalty Not Recommended		
Spiller Cleanup Date:	Not reported		
Enforcement Date:	Not reported		
Investigation Complete:	Not reported		
UST Involvement:	False		
Spill Record Last Update:	02/02/1990		
Is Updated:	False		
Corrective Action Plan Submitted:	Not reported		
Date Spill Entered In Computer Data File:	05/10/1989		
Date Region Sent Summary to Central Office:	12/07/1989		
Tank Test:			
PBS Number:	Not reported		
Tank Number:	Not reported		
Test Method:	Not reported		
Capacity of Failed Tank:	Not reported		
Leak Rate Failed Tank:	Not reported		
Gross Leak Rate:	Not reported		
Material:			
Material Class Type:	1		
Quantity Spilled:	0		
Units:	Gallons		



Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

MORRISON INDUSTRIES L P (Continued)

EDR ID Number  
EPA ID Number

Database(s)

1000457697

Unknown Qty Spilled: No  
Quantity Recovered: 0  
Unknown Qty Recovered: False  
Material: GASOLINE  
Class Type: Petroleum  
Chem Abstract Service Number: GASOLINE  
Last Date: 09/29/1994  
Num Times Material Entry In File: 21329  
Remark: NFG FOUND GASOLINE IN STONE SUBBASE OF PARKING LOT WHEN THEY EXCAVATED TO REPAIR GAS SERVICE  
DEC Remarks: 05/10/89: PROPERTY OWNER NOTIFIED OF PROBLEM WILL INVESTIGATE SOURCE OF CONTAMINATION. 05/22/89: MJH SITE VISIT PIT FILLED WITH WATER NO VISABLE SHEEN ON WATER SLIGHT ODOR DETECTED. 08/31/89: M. SORGI SITE INSPECTION 8/25/89 TANK REMOVED CONTAINED 2000 GALLONS FUEL OIL DID NOT FIND ANY CONTAMINATION IN EXCAVATION, MJH ADVISED NFG 8/30/89 TO COMPLETE LINE REPAIR, REPORT FROM MORRISON DUE. 11/20/89: NO FURTHER ACTION NEEDED REPORT RECEIVED FROM MORRISON INDUSTRIES.

E23  
SE  
1/8-1/4  
1315 ft.  
Higher

DESIGN FOR INDUSTRY  
601 AMHERST  
BUFFALO, NY 14207

RCRIS-SQG 1000252706  
FINDS NYD982534109

Site 6 of 8 in cluster E

RCRIS:

Owner: CHARTERS BRION  
(212) 555-1212  
EPA ID: NYD982534109  
Contact: DON FOX  
(716) 876-5122

Classification: Small Quantity Generator  
Used Oil Recyc: No  
TSDF Activities: Not reported

Violation Status: Violations exist

Regulation Violated: 40 cfr 262.34(a)(2)  
Area of Violation: GENERATOR-ALL REQUIREMENTS (OVERSIGHT)  
Date Violation Determined: 10/03/1994  
Actual Date Achieved Compliance: 11/17/1994

Enforcement Action: VERBAL INFORMAL  
Enforcement Action Date: 10/03/1994  
Penalty Type: Not reported

Regulation Violated: 262.34(c)(1)(II)  
Area of Violation: GENERATOR-LAND BAN REQUIREMENTS  
Date Violation Determined: 10/03/1994  
Actual Date Achieved Compliance: 11/17/1994

Enforcement Action: VERBAL INFORMAL  
Enforcement Action Date: 10/03/1994  
Penalty Type: Not reported

There are 2 violation record(s) reported at this site:

Evaluation	Area of Violation	Date of Compliance
Compliance Evaluation Inspection	GENERATOR-ALL REQUIREMENTS (OVERSIGHT)	19941117
	GENERATOR-LAND BAN REQUIREMENTS	19941117

NY MANIFEST

Additional detail is available in NY MANIFEST. Please contact your EDR Account Executive for more information.

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

DESIGN FOR INDUSTRY (Continued)

EDR ID Number  
EPA ID Number

Database(s)

1000252706

FINDS:

Other Pertinent Environmental Activity Identified at Site:  
Facility Registry System (FRS)  
Resource Conservation and Recovery Act Information system (RCRAINFO)

E24  
SE  
1/8-1/4  
1315 ft.  
Higher

MOHAWK INDUSTRIES INC  
601 AMHERST ST - SW COR  
BUFFALO, NY 14207

RCRIS-SQG 1000833454  
FINDS NYD987017597

Site 7 of 8 in cluster E

RCRIS:

Owner: COLE BERGEN  
(212) 555-1212  
EPA ID: NYD987017597  
Contact: JOSEPH PHELAN  
(716) 874-4371  
Classification: Small Quantity Generator  
Used Oil Recyc: No  
TSDF Activities: Not reported  
Violation Status: No violations found

FINDS:

Other Pertinent Environmental Activity Identified at Site:  
Facility Registry System (FRS)  
Resource Conservation and Recovery Act Information system (RCRAINFO)

E25  
SE  
1/8-1/4  
1315 ft.  
Higher

WEGMANS FOOD MARKETS  
601 AMHERST ST  
BUFFALO, NY 14207

RCRIS-SQG 1000268467  
FINDS NYD088419478

Site 8 of 8 in cluster E

RCRIS:

Owner: WEGMANS FOOD MARKETS INC  
(716) 464-4742  
EPA ID: NYD088419478  
Contact: MARY MCCABE  
(716) 464-4742  
Classification: Small Quantity Generator  
Used Oil Recyc: No  
TSDF Activities: Not reported  
Violation Status: No violations found

NY MANIFEST

Additional detail is available in NY MANIFEST. Please contact your EDR Account Executive for more information.

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

WEGMANS FOOD MARKETS (Continued)

EDR ID Number  
EPA ID Number

Database(s)

1000268467

FINDS:

Other Pertinent Environmental Activity Identified at Site:  
Biennial Reporting System (BRS)  
Facility Registry System (FRS)  
Resource Conservation and Recovery Act Information system (RCRAINFO)

26  
NW  
1/4-1/2  
1363 ft.  
Higher

HERTEL AVE  
S HERTEL RD 1000FTW MILITARY R  
BUFFALO, NY 14207

CERCLIS 1000399912  
FINDS NYD981560766

CERCLIS Classification Data:

Site Incident Category: Not reported  
Non NPL Status: Other  
Ownership Status: Other  
Site Description: FILL MATERIAL CONTAINING HEAVY METALS, PHENOLIC COMPOUNDS. ISOLATED OIL STAINS W/PCBS. SITE IS UNSECURED-CHILDREN USE IT AS A SHORTCUT HOME FROM SCHOOL. FILL MATERIAL CONTAINING HEAVY METALS, PHENOLIC COMPOUNDS. ISOLATED OIL STAINS W/PCBS. SITE IS UN SECURED-CHILDREN USE IT AS A SHORTCUT HOME FROM SCHOOL.  
Federal Facility: Not a Federal Facility  
NPL Status: Not on the NPL  
Other Cleanup Activity: State-Lead Cleanup

CERCLIS Assessment History:

Assessment: DISCOVERY Completed: 09/19/1986  
Assessment: PRELIMINARY ASSESSMENT Completed: 09/29/1986  
Assessment: SITE INSPECTION Completed: 08/04/1992  
Assessment: SITE REASSESSMENT Completed: 11/14/2002

CERCLIS Site Status:

NFRAP (No Further Remedial Action Planned)

FINDS:

Other Pertinent Environmental Activity Identified at Site:  
Comprehensive Environmental Response, Compensation and Liability Information System (CERCLIS)  
Facility Registry System (FRS)

27  
NNE  
1/4-1/2  
1601 ft.  
Higher

CITY OF BUFFALO PD  
669 HERTEL AVENUE  
BUFFALO, NY

LTANKS S102235992  
N/A

LTANKS:

Spill Number: 9602382  
Facility Contact: Not reported  
Investigator: JDC  
Caller Name: Not reported  
Caller Phone: Not reported  
Notifier Name: Not reported  
Notifier Phone: Not reported  
Spiller Contact: ROBERT O'HARE  
Spiller: CITY OF BUFFALO - DPW  
Spiller Address: 616 CITY HALL  
BUFFALO, NY 14202  
Region of Spill: 9  
Facility Tele: Not reported  
SWIS: 14  
Caller Agency: Not reported  
Caller Extension: Not reported  
Notifier Agency: Not reported  
Notifier Extension: Not reported  
Spiller Phone: (716) 851-5858  
Spill Class: Known release that creates potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.  
Spill Closed Dt: 11/12/1996  
Spill Cause: Tank Failure  
Water Affected: Not reported  
Spill Notifier: Other  
Resource Affected: Groundwater  
Spill Source: Other Commercial/Industrial  
PBS Number: Not reported

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

Database(s)  
EDR ID Number  
EPA ID Number

CITY OF BUFFALO PD (Continued)

S102235992

Spill Date: 05/20/1996 09:00  
Cleanup Ceased: 05/29/1996  
Last Inspection: 19960522  
Cleanup Meets Standard: True  
Recommended Penalty: Penalty Not Recommended  
Spiller Cleanup Date: Not reported  
Enforcement Date: Not reported  
Investigation Complete: Not reported  
UST Involvement: False  
Spill Record Last Update: 02/06/2001  
Is Updated: False  
Corrective Action Plan Submitted: Not reported  
Date Spill Entered In Computer Data File: 05/20/1996  
Date Region Sent Summary to Central Office: Not reported

Reported to Dept: 05/20/1996 09:25

Tank Test:  
PBS Number: Not reported  
Tank Number: Not reported  
Test Method: Not reported  
Capacity of Failed Tank: Not reported  
Leak Rate Failed Tank: Not reported  
Gross Leak Rate: Not reported

Material:  
Material Class Type: 1  
Quantity Spilled: 0  
Units: Gallons  
Unknown Qty Spilled: No  
Quantity Recovered: 0  
Unknown Qty Recovered: True  
Material: UNKNOWN PETROLEUM  
Class Type: Petroleum  
Chem Abstract Service Number: UNKNOWN PETROLEUM  
Last Date: 09/29/1994  
Num Times Material Entry In File: 16414

DEC Remarks: 05/21/96: JDC ON SITE AND MET W/ CHRIS NICTER, GENERAL CONTRACTOR AND ROGER BAILEY, IWS HIRED TO DO TANK REMOVALS. OBSERVED 1K GASOLINE TANK REMOVED W/ INDICATION OF MINOR CONTAMINATION IN THE EXCAVATION IN THE SOIL. S. WILL REMOVE MORE SOIL AND POSTTEST. APPROXIMATELY 5 YRDS OF SOIL HAS BEEN REMOVED AND STAGED FOR DISPOSAL. ADDITIONAL TANK INGROUND AND FILLED W/ CONCRETE. SOME WATER AND PRODUCT FOUND IN THE TANK, SUSPECT OLD GASOLINE. TANK WILL BE PUMPED OF AND REMOVED FROM THE GROUND. 5/22/96: JDC ON SITE AND MET W/ CHRIS NICTER, 4K TANK REMOVED, ALL CONCRETE FILL IN TANK IS CONTAMINATED AND WILL BE DISPOSED OF W/ CONTAMINATED SOILS. ALL CONTAMINATED MATERIALS ARE ON PLASTIC ON SITE. IWS WILL DO TANK CLEANING AND POST TESTING. H-NU RREADING FROM BOTH EXCAVATIONS WRE LESS THAN 50 PPM. 6/28/96: JDC INSPECTED AND FOUND TANK AREA BACKFILLED AND UNDER CONSTRUCTION. NEED DISPOSAL RECEIPTS. 9/5/96: JDC SENT LETTER REQUESTING SITE STATUS. 9/29/96: JDC TELCON W/ MR O HARE, HEHAS REQUESTED SITE STATUS INFORMATION FROM CONTRACTOR. WILL FORWARD WHEN COMPLETE. 11/12/96: JDC TELCON W/ ROGER BAILEY, IWS - FINAL TEST RESULTS INDICATED CLEAN W/ TANK EXCAVATION. DISPOSAL DOCUMENTS SATISFACTORY, NO FURTHER ACTION REQUIRED.

Spill Cause: abandoned tanks filled with concrete have petroleum in them spill faxed from region 9 on 05/20/96

28  
East  
1/4-1/2  
1790 ft.  
Higher

GIOIA PASTA  
1700 ELMWOOD AVE  
BUFFALO, NY 14207

RCRIS-SQG 1000245261  
FINDS NYD002110161  
LTANKS

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

GIOIA PASTA (Continued)

EDR ID Number  
EPA ID Number

Database(s)

1000245261

RCRIS:

Owner: BORDEN FOODS

(212) 555-1212

EPA ID: NYD002110161

Contact: WAYNE R TRUMEN

(716) 873-8600

Classification: Small Quantity Generator

Used Oil Recyc: No

TSDF Activities: Not reported

Violation Status: Violations exist

Regulation Violated: Not reported

Area of Violation: GENERATOR-ALL REQUIREMENTS (OVERSIGHT)

Date Violation Determined: 06/20/1995

Actual Date Achieved Compliance: 06/20/1995

Enforcement Action: WRITTEN INFORMAL

Enforcement Action Date: 06/20/1995

Penalty Type: Not reported

Regulation Violated: Not reported

Area of Violation: GENERATOR-LAND BAN REQUIREMENTS

Date Violation Determined: 06/20/1995

Actual Date Achieved Compliance: 06/20/1995

Enforcement Action: WRITTEN INFORMAL

Enforcement Action Date: 06/20/1995

Penalty Type: Not reported

There are 2 violation record(s) reported at this site:

<u>Evaluation</u>	<u>Area of Violation</u>	<u>Date of Compliance</u>
Compliance Evaluation Inspection	GENERATOR-ALL REQUIREMENTS (OVERSIGHT)	19950620
	GENERATOR-LAND BAN REQUIREMENTS	19950620

NY MANIFEST

Additional detail is available in NY MANIFEST. Please contact your EDR Account Executive for more information.

FINDS:

Other Pertinent Environmental Activity Identified at Site:

AIRS Facility System (AIRS/AFS)

Facility Registry System (FRS)

Resource Conservation and Recovery Act Information system (RCRAINFO)

Toxic Chemical Release Inventory System (TRIS)

LTANKS:

Spill Number: 9505011

Facility Contact: Not reported

Investigator: JDC

Caller Name: Not reported

Caller Phone: Not reported

Notifier Name: Not reported

Notifier Phone: Not reported

Spiller Contact: Not reported

Spiller: GIOIA

Spiller Address: 1700 ELMWOOD

BUFFALO, NY

Region of Spill: 9

Facility Tele: Not reported

SWIS: 14

Caller Agency: Not reported

Caller Extension: Not reported

Notifier Agency: Not reported

Notifier Extension: Not reported

Spiller Phone: (716) 873-8600

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
EPA ID Number

GIOIA PASTA (Continued)

1000245261

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.  
Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 10/11/1995

Spill Cause: Tank Failure Resource Affected: On Land

Water Affected: Not reported Spill Source: Other Commercial/Industrial

Spill Notifier: Responsible Party PBS Number: Not reported

Spill Date: 07/06/1995 12:00 Reported to Dept: 07/24/1995 12:00

Cleanup Ceased: 10/02/1995

Last Inspection: 19950727

Cleanup Meets Standard: False

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Date: Not reported

Enforcement Date: Not reported

Investigation Complete: Not reported

UST Involvement: False

Spill Record Last Update: 10/12/1995

Is Updated: False

Corrective Action Plan Submitted: Not reported

Date Spill Entered In Computer Data File: 07/28/1995

Date Region Sent Summary to Central Office: Not reported

Tank Test:

PBS Number: Not reported

Tank Number: Not reported

Test Method: Not reported

Capacity of Failed Tank: Not reported

Leak Rate Failed Tank: Not reported

Gross Leak Rate: Not reported

Material:

Material Class Type: 1

Quantity Spilled: 0

Units: Gallons

Unknown Qty Spilled: No

Quantity Recovered: 0

Unknown Qty Recovered: False

Material: #6 FUEL OIL

Class Type: Petroleum

Chem Abstract Service Number: #6 FUEL OIL

Last Date: 07/28/1994

Num Times Material Entry In File: 2190

DEC Remarks: 07/28/95: JDC MET W/ P RAPPL AND TOM HASEK, BLB ENGINEERS AND FOUND TANK  
OPENED W/ PRODUCT AND WATER IN BOTTOM. TANK UNDER CONCRETE FLOOR, NO REM  
OVAL POSSIBLE. REQUESTED WELLS AND TESTING OF GW. SENT LETTER. 10/02  
/95: REVIEWD TANK FIELD SAMPLE REESULTS DATED 9/15/95BY PARADIGM AND FOU  
ND LEVELS ACCEPTABLE FOR INACTIVE STATUS. SENT STATUS LETTER, NO FURTHER  
ACTION AT THIS TIME.

Spill Cause: POST TEST RESULTS ON ABANDONED TANK SHOWD HIGH LEVEL STARS VIOLATIONS

29  
East  
1/4-1/2  
1829 ft.  
Higher

SMITH METAL ARTS CO INC  
1721 ELMWOOD AVE  
BUFFALO, NY 14207

RCRIS-SQG 1000406214  
FINDS NYD002112191  
LTANKS

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

SMITH METAL ARTS CO INC (Continued)

EDR ID Number  
EPA ID Number

Database(s)

1000406214

RCRIS:

Owner: SMITH METAL ARTS CO INC  
(212) 555-1212  
EPA ID: NYD002112191  
Contact: JOHN ALEVRAS  
(716) 873-3083

Classification: Small Quantity Generator  
Used Oil Recyc: No  
TSDF Activities: Not reported  
Violation Status: No violations found

NY MANIFEST

Additional detail is available in NY MANIFEST. Please contact your EDR Account Executive for more information.

FINDS:

Other Pertinent Environmental Activity Identified at Site:  
Facility Registry System (FRS)  
Resource Conservation and Recovery Act Information system (RCRAINFO)  
Toxic Chemical Release Inventory System (TRIS)

LTANKS:

Spill Number: 8904514  
Facility Contact: Not reported  
Investigator: JDC  
Caller Name: Not reported  
Caller Phone: Not reported  
Notifier Name: Not reported  
Notifier Phone: Not reported  
Spiller Contact: Not reported  
Spiller: SMITH METAL PRODUCTS  
Spiller Address: 1721 ELMWOOD AVENUE  
BUFFALO, NY 14207

Region of Spill: 9  
Facility Tele: Not reported  
SWIS: 14  
Caller Agency: Not reported  
Caller Extension: Not reported  
Notifier Agency: Not reported  
Notifier Extension: Not reported  
Spiller Phone: (716) 873-3083

Spill Class: Not reported  
Spill Closed Dt: 03/13/1990  
Spill Cause: Tank Failure  
Water Affected: Not reported  
Spill Notifier: Affected Persons  
Spill Date: 08/04/1989 15:00  
Cleanup Ceased: 03/13/1990  
Last Inspection: 19890811

Resource Affected: Groundwater  
Spill Source: Other Commercial/Industrial  
PBS Number: Not reported  
Reported to Dept: 08/04/1989 16:00

Cleanup Meets Standard: True  
Recommended Penalty: Penalty Not Recommended  
Spiller Cleanup Date: Not reported  
Enforcement Date: Not reported  
Investigation Complete: Not reported  
UST Involvement: True  
Spill Record Last Update: 05/02/1990  
Is Updated: False  
Corrective Action Plan Submitted: Not reported  
Date Spill Entered In Computer Data File: 08/11/1989  
Date Region Sent Summary to Central Office: Not reported  
Tank Test:  
PBS Number: Not reported  
Tank Number: Not reported  
Test Method: Not reported  
Capacity of Failed Tank: Not reported

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

Site

Database(s)  
EDR ID Number  
EPA ID Number

SMITH METAL ARTS CO INC (Continued)

1000406214

Leak Rate Failed Tank: Not reported  
Gross Leak Rate: Not reported  
Material:  
Material Class Type: 1  
Quantity Spilled: 0  
Units: Gallons  
Unknown Qty Spilled: No  
Quantity Recovered: 0  
Unknown Qty Recovered: False  
Material: GASOLINE  
Class Type: Petroleum  
Chem Abstract Service Number: GASOLINE  
Last Date: 09/29/1994  
Num Times Material Entry In File: 21329  
DEC Remarks: 08/11/89: JDC FOUND OILY CONTAMINATED SOIL ASSOCIATED W/ UNKNOWN TANK ON SMITHMETAL PROPERTY. CHARGED MR DONALDSON W/ CLEANUP RESPONSIBILITIES, T O DATE HE HAS COMPLIED. AWAITING LAB ANALYSIS. 08/17/89: JDC RECIEVED CALL FROM MR BOECKEL, BMD WHO REPORTED TANK AND EXCAVATION HAS BEEN FIL LED BY NATIONAL FUEL W/ CRUSHED STONE. JDC WILL FOLLOWUP. 08/18/89: JD C CONTACTED JIM WALTERS, NAT FUEL WHO CONFIRMED THE BACK FILL ERROR. HE WAS INFORMED OF POSSIBLE DISPOSAL COST SHEARING FOR DISPOSAL IF TESST RE SULTS COME BACK NEGATIVE. SENT LETTER TO CONFIRM. 08/18/89: JDC TEECON W/ MR DONALDSON TO INFORM HIM OF BACKFILLING. SENT HIM ACOFY OF THE NATI ONAL FUEL GAS LETTER AT HIS REQUEST. WAITING ON DLAB ANALYSIS. 09/29/8 9: MR DONALDSON HAS ACCEPTEDD RESPONSIBILITY FOR TANK REMOVAL AND SOIL D ISPOSAL. DRAFTED LETTER OUTLINING CLEANUP RESPONSIBILITIES. ON DLAB ANAL YSIS. 10/06/89: JDC INSPECTED TANK AND FOUND IT IT DRY AND PETROLEUM F REE. TANK WILL BE FILLED W/ CONCRETE SLURRY. WILL CLOSE WHEN WWORK IS CO NFIRMED AND DISPOSAL IS MADE. 03/09/90: JDC CONTACTED AND DRAFTED LETT ER TO MR DONALDSON REQUESTING DISPOAL RECEIPTS. 03/13/90: RECEIVED DIS POSAL PAPERWORK, NO FURTHER ACTION REQUIRED BY THIS UNIT.  
Spill Cause: TANK FILLED W/ WATER DISCOVERED IN NATIONAL FUEL GAS EXCAVATION.

30  
South  
1/4-1/2  
1915 ft.  
Lower

MARCON ERECTORS INC  
1 HOWELL ST  
BUFFALO, NY 14207

SHWS 1001203131  
FINDS NYR000044909  
RCRIS-LQG

RCRIS:

Owner: MARCON ERECTORS INC  
(716) 873-1051  
EPA ID: NYR000044909  
Contact: DOUGLAS GIAMBRONE  
(716) 873-1051

Classification: Large Quantity Generator  
Used Oil Recyc: No  
TSDF Activities: Not reported



Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

Site

MAP FINDINGS

Database(s)  
EDR ID Number  
EPA ID Number

MARCON ERECTORS INC (Continued)

1001203131

Violation Status: Violations exist

Regulation Violated:	Not reported
Area of Violation:	GENERATOR-LAND BAN REQUIREMENTS
Date Violation Determined:	12/02/1997
Actual Date Achieved Compliance:	01/03/2002
Enforcement Action:	INITIAL 3008(A) COMPLIANCE ORDER
Enforcement Action Date:	03/27/1998
Penalty Type:	Proposed Monetary Penalty
Enforcement Action:	FINAL 3008(A) COMPLIANCE ORDER
Enforcement Action Date:	12/31/2000
Penalty Type:	Proposed Monetary Penalty
Regulation Violated:	Not reported
Area of Violation:	GENERATOR-ALL REQUIREMENTS (OVERSIGHT)
Date Violation Determined:	12/02/1997
Actual Date Achieved Compliance:	01/03/2002
Enforcement Action:	INITIAL 3008(A) COMPLIANCE ORDER
Enforcement Action Date:	03/27/1998
Penalty Type:	Proposed Monetary Penalty
Enforcement Action:	FINAL 3008(A) COMPLIANCE ORDER
Enforcement Action Date:	12/31/2000
Penalty Type:	Proposed Monetary Penalty

There are 2 violation record(s) reported at this site:

<u>Evaluation</u>	<u>Area of Violation</u>	<u>Date of Compliance</u>
Compliance Evaluation Inspection	GENERATOR-LAND BAN REQUIREMENTS	20020103
	GENERATOR-ALL REQUIREMENTS (OVERSIGHT)	20020103

NY MANIFEST

Additional detail is available in NY MANIFEST. Please contact your EDR Account Executive for more information.

FINDS:

Other Pertinent Environmental Activity Identified at Site:  
Biennial Reporting System (BRS)  
Facility Registry System (FRS)  
Resource Conservation and Recovery Act Information system (RCRAINFO)

SHWS:

EPA ID:	Not reported	Region:	9
Acres:	1.3	User:	Douglas Giambrone
Owner:	Douglas Giambrone 1 Howell Street Buffalo, NY 142		
Owner Type:	OW		
Operator:	Douglas Giambrone 1 Howell Street Buffalo, NY 14248		
Operator Type:	OP		
Classification:	SIGNIFICANT THREAT TO THE PUBLIC HEALTH OR ENVIRONMENT - ACTION REQUIRED.		
Depth to Groundwater:	Not reported		
Legal Action Type:	Consent Order		
Legal NY State:	X		
Legal Federal:	Not reported		
Legal state:	NE		

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

Database(s)  
EDR ID Number  
EPA ID Number

MARCON ERECTORS INC (Continued)

1001203131

Facility ID Number	915173
Dump:	Not reported
Pond:	Not reported
Structure:	Yes
Lagoon:	Not reported
Landfill:	Not reported
Lat/Long:	42° 56' 12" / 78° 53' 9"
Disposal Start:	unknown
Disposal Term:	unknown
Air Data:	Not reported
Air Violation:	Not reported
Ground Water Data:	Not reported
Surface Water Data:	Yes
SW Violation:	Not reported
Sediment Data:	Yes
Soil Data:	Yes
Soil Type:	Fill over lacustrine silt-rich clay over till.
Remediation Proposed:	Yes
Remediation Active:	Not reported
Remediation Design:	Not reported
Remediation Type:	Tank removals.
Quantity:	unknown
NPL Status:	—
Hazardous Waste:	Arochlor 1260 (PCBs) (B007 Waste)
Site Description:	<p>MarCon Erectors occupies a parcel of property approximately 1.3 acres in size in a mixed residential, commercial, industrial area. The site is a triangular shaped parcel of land with a multi-storied brick, frame and block building and a concrete containment area that has two, horizontal, 10,000 gallon, above ground storage tanks (AST) in saddles and one 25,000 gallon AST which has been cut down to about 18 inches in height. Recent operations of this facility was the re-manufacture of windows. Past uses of the facility included fuel blending operations by a company affiliated with Ashland Petroleum Company (approx. 1915 - 1971) and occupation by a roofing company, B. Hoffman Roofers 1971 to 1980. The site had been abandoned when MarCon purchased the property. The cut down tank contains sludge contaminated with VOCs and PCBs. The sludge in the cut off tank was covered with a polyethylene tarp. Sampling of this sludge revealed PCB contamination as high as 16,000 ppm. Sampling of the oil/water in the sludge within the cut off tank revealed PCB contamination as high as 122 ppm. There is evidence that the concrete containment structure has been compromised with indications of contamination on the floor and walls of the structure. Sampling directly outside of the cracks in the structure revealed PCB contamination as high as 5.8 ppm. There is no information on soils beneath the containment area. Additionally there is no information on the groundwater downgradient of the site. Improper removal practices during a sludge removal effort in 1997 has resulted in a RCRA enforcement action against the owner and contractor. An interim remedial measure (IRM) to remove source contamination was complete in early 2001. An immediate investigation work assignment (IIWA) was conducted in mid 2001 to determine soil and groundwater impacts. The IIWA indicates all PCB contamination has been removed but petroleum contamination exists both on and off-set. A ROD is anticipated early 2002.</p> <p>Environmental Problems: The exposed material within the cut-down 25,000 gallon AST has the potential to fill with precipitation and overflow into a compromised concrete containment area. Directly to the south of the site is a</p>

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

Site

MAP FINDINGS

Database(s)

EDR ID Number  
EPA ID Number

MARCON ERECTORS INC (Continued)

1001203131

Health Problems:

heavily used recreation pathway. 625 feet to the west is a play ground and an elementary school. Residential areas are directly to the north of the site. The potential for continued environmental degradation and human contact remains present as long as the site remains un-remediated. An elementary school, a playground, and a residential area are near the site. All PCB-contaminated sludges and soil have been removed and disposed off-site. The remedial activities at the site have eliminated potential exposure routes. Exposures via drinking water are not expected because public water serves the area.

31  
NW  
1/4-1/2  
1986 ft.  
Higher

NOCO ENERGY  
357 MILITARY ROAD  
BUFFALO, NY

LTANKS S102179266  
NY Spills N/A

SPILLS:

Spill Number:	9414325	Region of Spill:	9
Facility Contact:	Not reported	Facility Tele:	Not reported
Investigator:	MJS	SWIS:	14
Caller Name:	Not reported	Caller Agency:	Not reported
Caller Phone:	Not reported	Caller Extension:	Not reported
Notifier Name:	Not reported	Notifier Agency:	Not reported
Notifier Phone:	Not reported	Notifier Extension:	Not reported
Spiller Contact:	Not reported	Spiller Phone:	Not reported
Spiller:	UNKNOWN MOTORIST		
Spiller Address:	Not reported		
Spill Class:	Possible release with minimal potential for fire or hazard or Known release with no damage. DEC Response. Willing Responsible Party. Corrective action taken.		
Spill Closed Dt:	01/30/1995	Resource Affected:	On Land
Spill Cause:	Human Error	Spill Source:	Gas Station
Water Affected:	Not reported	PBS Number:	Not reported
Spill Notifier:	Responsible Party	Reported to Dept:	01/30/1995 11:50
Spill Date:	01/30/1995 11:00		
Cleanup Ceased:	01/30/1995		
Last Inspection:	Not reported		
Cleanup Meets Standard:	True		
Recommended Penalty:	Penalty Not Recommended		
Spiller Cleanup Date:	Not reported		
Enforcement Date:	Not reported		
Investigation Complete:	Not reported		
UST Involvement:	False		
Spill Record Last Update:	01/03/1996		
Is Updated:	False		
Corrective Action Plan Submitted:	Not reported		
Date Spill Entered In Computer Data File:	01/30/1995		
Date Region Sent Summary to Central Office:	Not reported		
Tank Test:			
PBS Number:	Not reported		
Tank Number:	Not reported		
Test Method:	Not reported		
Capacity of Failed Tank:	Not reported		
Leak Rate Failed Tank:	Not reported		
Gross Leak Rate:	Not reported		
Material:			
Material Class Type:	1		
Quantity Spilled:	5		
Units:	Gallons		

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation Site

MAP FINDINGS

Database(s)  
EDR ID Number  
EPA ID Number

NOCO ENERGY (Continued)

S102179266

Unknown Qty Spilled: 5  
Quantity Recovered: 5  
Unknown Qty Recovered: False  
Material: DIESEL  
Class Type: Petroleum  
Chem Abstract Service Number: DIESEL  
Last Date: 07/28/1994  
Num Times Material Entry In File: 10625  
Remarks: CUSTOMER DROVE AWAY W/ NOZZLE IN VEHICLE  
DEC Remarks: 01/30/95: MJS TELECON TO GARY ROESCH. 2 BAGS SPEEDI DRI USED. NOCO TOOK WASTE TO BIO FACILITY. MINOR AMOUNT. NO FURTHER ACTION REQUIRED. MJS CLOSURE FILE.

LTANKS:

Spill Number: 9203257  
Facility Contact: Not reported  
Investigator: SAC  
Caller Name: Not reported  
Caller Phone: Not reported  
Notifier Name: Not reported  
Notifier Phone: Not reported  
Spiller Contact: Not reported  
Spiller: NOCO ENERGY  
Spiller Address: 900 GRAND ISLAND BLVD  
TONAWANDA, NY 14150  
Spill Class: Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.  
Spill Closed Dt: 08/10/1993  
Spill Cause: Tank Failure  
Water Affected: Not reported  
Spill Notifier: Responsible Party  
Spill Date: 06/01/1992 12:00  
Cleanup Ceased: 08/10/1993  
Last Inspection: Not reported  
Cleanup Meets Standard: True  
Recommended Penalty: Penalty Not Recommended  
Spiller Cleanup Date: Not reported  
Enforcement Date: Not reported  
Investigation Complete: Not reported  
UST Involvement: True  
Spill Record Last Update: 08/11/1993  
Is Updated: False  
Corrective Action Plan Submitted: Not reported  
Date Spill Entered In Computer Data File: 06/18/1992  
Date Region Sent Summary to Central Office: Not reported  
Tank Test:  
PBS Number: Not reported  
Tank Number: Not reported  
Test Method: Not reported  
Capacity of Failed Tank: Not reported  
Leak Rate Failed Tank: Not reported  
Gross Leak Rate: Not reported  
Material:  
Material Class Type: 1  
Quantity Spilled: 0  
Units: Not reported  
Unknown Qty Spilled: No  
Quantity Recovered: 0  
Region of Spill: 9  
Facility Tele: Not reported  
SWIS: 14  
Caller Agency: Not reported  
Caller Extension: Not reported  
Notifier Agency: Not reported  
Notifier Extension: Not reported  
Spiller Phone: (716) 874-6200  
Resource Affected: On Land  
Spill Source: Gas Station  
PBS Number: Not reported  
Reported to Dept: 06/16/1992 12:30

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

NOCO ENERGY (Continued)

EDR ID Number  
EPA ID Number

Database(s)

S102179266

Unknown Qty Recovered: True  
Material: GASOLINE  
Class Type: Petroleum  
Chem Abstract Service Number: GASOLINE  
Last Date: 09/29/1994  
Num Times Material Entry In File: 21329  
DEC Remarks: 06/18/92: SAC TELECON W/GARY ROESCH OF NOCO, CONTENTS HAVE BEEN PUMPED OUT OF TANKS, THEY WILL BE PULLED NEAR THE END OF JULY, LETTER TO BE DRAFTED. 08/11/92: SAC TELECON W/GARY ROESCH OF NOCO ON 8/11/92, NOCO WILL RETEST TANKS AND THE LINES AT THE END OF AUGUST. 09/22/92: SAC MET G. ROESCH/NOCO 9/18/92, G. ROESCH SAID TANKS PASSED TIGHTNESS TEST, PRODUCT PUT BACK INTO TANKS, LETTER DRAFTED 9/22/92 REQUIRING TANK TEST RESULTS AND EXPLANATION WHY TANKS TOOK ON WATER. 05/01/93: 4/19/93 MEETING W/SSAC, RNL AND G. ROESCH/NOCO, G. ROESCH WILL SEND TANK TEST RESULTS AND EXPLANATION OF WHY TANKS TOOK ON WATER. 08/10/93: SAC RECEIVED COPY OF TEST RESULTS. HAD TO GO TO PBS FILE. NO FURTHER ACTION REQUIRED AT THIS TIME.  
Spill Cause: DURING EXCAVATION OF TANKS, WATER WAS NOTICED BEING TAKEN ON IN THE TANKS.

Spill Number:	9509621	Region of Spill:	9
Facility Contact:	GARY ROESCH	Facility Tele:	(716) 874-7250
Investigator:	MNP	SWIS:	14
Caller Name:	Not reported	Caller Agency:	Not reported
Caller Phone:	Not reported	Caller Extension:	Not reported
Notifier Name:	Not reported	Notifier Agency:	Not reported
Notifier Phone:	Not reported	Notifier Extension:	Not reported
Spiller Contact:	GARY ROESCH	Spiller Phone:	(716) 874-7250
Spiller:	NOCO ENERGY		
Spiller Address:	PO BOX 86 TONAWANDA, NY 14151		

Spill Class: Known release that creates potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.

Spill Closed Dt:	12/05/1995	Resource Affected:	Groundwater
Spill Cause:	Tank Failure	Spill Source:	Gas Station
Water Affected:	Not reported	PBS Number:	9-507571
Spill Notifier:	Responsible Party	Reported to Dept:	11/02/1995 11:20
Spill Date:	11/02/1995 10:00		
Cleanup Ceased:	Not reported		
Last Inspection:	19951129		

Cleanup Meets Standard: True  
Recommended Penalty: Penalty Not Recommended  
Spiller Cleanup Date: Not reported  
Enforcement Date: Not reported  
Investigation Complete: Not reported  
UST Involvement: True  
Spill Record Last Update: 12/10/1998  
Is Updated: False  
Corrective Action Plan Submitted: Not reported  
Date Spill Entered In Computer Data File: 11/03/1995  
Date Region Sent Summary to Central Office: Not reported  
Tank Test:

PBS Number:	Not reported
Tank Number:	Not reported
Test Method:	Not reported
Capacity of Failed Tank:	0
Leak Rate Failed Tank:	0.00
Gross Leak Rate:	Not reported

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
EPA ID Number

NOCO ENERGY (Continued)

S102179266

Material:  
Material Class Type: 1  
Quantity Spilled: 0  
Units: Gallons  
Unknown Qty Spilled: No  
Quantity Recovered: 0  
Unknown Qty Recovered: True  
Material: GASOLINE  
Class Type: Petroleum  
Chem Abstract Service Number: GASOLINE  
Last Date: 09/29/1994  
Num Times Material Entry In File: 21329  
Material Class Type: 1  
Quantity Spilled: 0  
Units: Gallons  
Unknown Qty Spilled: No  
Quantity Recovered: 0  
Unknown Qty Recovered: True  
Material: DIESEL  
Class Type: Petroleum  
Chem Abstract Service Number: DIESEL  
Last Date: 07/28/1994  
Num Times Material Entry In File: 10625  
Spill Cause: DISCOVERED GASOLINE CONTAMINATED SOIL DURING TANK REMOVAL 1-8000GAL DIE  
SEL 2-6000GAL GAS

The LTANKS database may contain additional details for this site.  
Please contact your EDR Account Executive for more information.

32  
WSW  
1/4-1/2  
2007 ft.  
Higher

CITY SERVICE TAXI  
1056 GRANT STREET  
BUFFALO, NY

LTANKS S100879051  
N/A

LTANKS:

Spill Number:	9312183	Region of Spill:	9
Facility Contact:	Not reported	Facility Tele:	Not reported
Investigator:	MF	SWIS:	14
Caller Name:	Not reported	Caller Agency:	Not reported
Caller Phone:	Not reported	Caller Extension:	Not reported
Notifier Name:	Not reported	Notifier Agency:	Not reported
Notifier Phone:	Not reported	Notifier Extension:	Not reported
Spiller Contact:	Not reported	Spiller Phone:	(800) 439-7006
Spiller:	CITY SERVICE TAXI		
Spiller Address:	980 GRANT STREET BUFFALO, NY 14207		
Spill Class:	Known release that creates a file or hazard. DEC Response. Unknown Responsible Party. Corrective action taken. (ISR)		
Spill Closed Dt:	02/28/1994		
Spill Cause:	Tank Failure	Resource Affected:	In Sewer
Water Affected:	Not reported	Spill Source:	Other Commercial/Industrial
Spill Notifier:	Fire Department	PBS Number:	Not reported
Spill Date:	01/16/1994 14:07	Reported to Dept:	01/16/1994 14:54
Cleanup Ceased:	02/28/1994		
Last Inspection:	19940208		
Cleanup Meets Standard:	True		
Recommended Penalty:	Penalty Not Recommended		
Spiller Cleanup Date:	Not reported		

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
EPA ID Number

CITY SERVICE TAXI (Continued)

S100879051

Enforcement Date: Not reported  
Investigation Complete: Not reported  
UST Involvement: True  
Spill Record Last Update: 04/22/1994  
Is Updated: False  
Corrective Action Plan Submitted: Not reported  
Date Spill Entered In Computer Data File: 01/18/1994  
Date Region Sent Summary to Central Office: 04/11/1994  
Tank Test:  
PBS Number: Not reported  
Tank Number: Not reported  
Test Method: Not reported  
Capacity of Failed Tank: Not reported  
Leak Rate Failed Tank: Not reported  
Gross Leak Rate: Not reported  
Material:  
Material Class Type: 1  
Quantity Spilled: 0  
Units: Gallons  
Unknown Qty Spilled: No  
Quantity Recovered: 0  
Unknown Qty Recovered: False  
Material: GASOLINE  
Class Type: Petroleum  
Chem Abstract Service Number: GASOLINE  
Last Date: 09/29/1994  
Num Times Material Entry In File: 21329  
Spill Cause: STRONG GASOLINE ODORS IN STORE

The LTANKS database may contain additional details for this site.  
Please contact your EDR Account Executive for more information.

33  
ESE  
1/4-1/2  
2072 ft.  
Higher

CITGO  
1602 ELMWOOD AVENUE  
BUFFALO, NY

LTANKS S100155367  
N/A

LTANKS:

Spill Number: 9004510  
Facility Contact: Not reported  
Investigator: MEL  
Caller Name: Not reported  
Caller Phone: Not reported  
Notifier Name: Not reported  
Notifier Phone: Not reported  
Spiller Contact: Not reported  
Spiller: CITGO  
Spiller Address: 1602 ELMWOOD AVENUE  
BUFFALO, NY  
Spill Class: Not reported  
Spill Closed Dt: 08/13/1990  
Spill Cause: Tank Failure  
Water Affected: Not reported  
Spill Notifier: Other  
Spill Date: 07/24/1990 08:00  
Cleanup Ceased: 07/25/1990  
Last Inspection: 19900725  
Cleanup Meets Standard: True  
Region of Spill: 9  
Facility Tele: Not reported  
SWIS: 14  
Caller Agency: Not reported  
Caller Extension: Not reported  
Notifier Agency: Not reported  
Notifier Extension: Not reported  
Spiller Phone: Not reported  
Resource Affected: Groundwater  
Spill Source: Gas Station  
PBS Number: Not reported  
Reported to Dept: 07/24/1990 08:25

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
EPA ID Number

CITGO (Continued)

S100155367

Recommended Penalty: Penalty Not Recommended  
Spiller Cleanup Date: Not reported  
Enforcement Date: Not reported  
Investigation Complete: Not reported  
UST Involvement: True  
Spill Record Last Update: 12/04/1990  
Is Updated: False  
Corrective Action Plan Submitted: Not reported  
Date Spill Entered In Computer Data File: 08/13/1990  
Date Region Sent Summary to Central Office: Not reported  
Tank Test:  
PBS Number: Not reported  
Tank Number: Not reported  
Test Method: Not reported  
Capacity of Failed Tank: Not reported  
Leak Rate Failed Tank: Not reported  
Gross Leak Rate: Not reported

Material:

Material Class Type: 1  
Quantity Spilled: 0  
Units: Gallons  
Unknown Qty Spilled: No  
Quantity Recovered: 0  
Unknown Qty Recovered: False  
Material: GASOLINE  
Class Type: Petroleum  
Chem Abstract Service Number: GASOLINE  
Last Date: 09/29/1994  
Num Times Material Entry In File: 21329

DEC Remarks: 07/25/90: MEL / RNL / MJH / JES CONFERRED AND DECIDED THAT BULK STORAGE WILL FOLLOW UP ON SITE. NO FURTHER SPILL INVOLVEMENT NECESSARY, RECOMMEN D FILE BE CLOSED. 07/25/90: MEL/RNL INSPECTION. SAND BACKFILL IN EXCAV ATION HAD SLIGHT ODOR, NO SHEEN PRRODUCED IN SEVERAL SAMPLES. INSTRUCTED CONTRACTOR TO KEEP ANY CONTAMINATED SOIL SEPARATE, AND TO CALL DEC IF AN Y FOUND.

Spill Cause: CONTRACTOR FOUND CONTAMINATED SOIL WHEN TANKS REMOVED.

34  
ENE  
1/4-1/2  
2100 ft.  
Higher

MOD-PAC CORP  
1801 ELMWOOD AVE  
BUFFALO, NY 14207

RCRIS-SQG 1000912018  
FINDS NY0000379248  
UST  
LTANKS

RCRIS:

Owner: MOD-PAC CORP  
(716) 873-0640  
EPA ID: NY0000379248  
Contact: STEVE ANDERSON  
(716) 873-0640

Classification: Small Quantity Generator  
Used Oil Recyc: No  
TSDF Activities: Not reported



Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

MOD-PAC CORP (Continued)

EDR ID Number  
EPA ID Number

Database(s)

1000912018

Violation Status: Violations exist

Regulation Violated: Not reported  
Area of Violation: GENERATOR-ALL REQUIREMENTS (OVERSIGHT)  
Date Violation Determined: 05/02/1995  
Actual Date Achieved Compliance: 05/16/1995

Enforcement Action: WRITTEN INFORMAL  
Enforcement Action Date: 05/02/1995  
Penalty Type: Not reported

Regulation Violated: Not reported  
Area of Violation: GENERATOR-LAND BAN REQUIREMENTS  
Date Violation Determined: 05/02/1995  
Actual Date Achieved Compliance: 05/16/1995

Enforcement Action: WRITTEN INFORMAL  
Enforcement Action Date: 05/02/1995  
Penalty Type: Not reported

Regulation Violated: Not reported  
Area of Violation: GENERATOR-MANIFEST REQUIREMENTS  
Date Violation Determined: 05/02/1995  
Actual Date Achieved Compliance: 05/16/1995

Enforcement Action: WRITTEN INFORMAL  
Enforcement Action Date: 05/02/1995  
Penalty Type: Not reported

There are 3 violation record(s) reported at this site:

Evaluation	Area of Violation	Date of Compliance
Compliance Evaluation Inspection	GENERATOR-ALL REQUIREMENTS (OVERSIGHT)	19950516
	GENERATOR-LAND BAN REQUIREMENTS	19950516
	GENERATOR-MANIFEST REQUIREMENTS	19950516

NY MANIFEST

Additional detail is available in NY MANIFEST. Please contact your EDR Account Executive for more information.

FINDS:

Other Pertinent Environmental Activity Identified at Site:

Facility Registry System (FRS)  
Resource Conservation and Recovery Act Information system (RCRAINFO)  
Toxic Chemical Release Inventory System (TRIS)

LTANKS:

Spill Number:	9505712	Region of Spill:	9
Facility Contact:	Not reported	Facility Tele:	Not reported
Investigator:	JFO	SWIS:	14
Caller Name:	Not reported	Caller Agency:	Not reported
Caller Phone:	Not reported	Caller Extension:	Not reported
Notifier Name:	Not reported	Notifier Agency:	Not reported
Notifier Phone:	Not reported	Notifier Extension:	Not reported
Spiller Contact:	KEVIN KEANE	Spiller Phone:	(716) 873-0640
Spiller:	MOD-PAC CORP		
Spiller Address:	1801 ELMWOOD AVENUE BUFFALO, NY 14207		
Spill Class:	Known release that creates potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.		
Spill Closed Dt:	08/14/1996		
Spill Cause:	Tank Failure	Resource Affected:	Groundwater

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

MOD-PAC CORP (Continued)

1000912018

Water Affected: Not reported  
Spill Notifier: Citizen  
Spill Date: 08/09/1995 08:00  
Cleanup Ceased: Not reported  
Last Inspection: 19960523  
Cleanup Meets Standard: False  
Recommended Penalty: Penalty Not Recommended  
Spiller Cleanup Date: Not reported  
Enforcement Date: Not reported  
Investigation Complete: Not reported  
UST Involvement: False  
Spill Record Last Update: 05/02/2001  
Is Updated: False  
Corrective Action Plan Submitted: Not reported  
Date Spill Entered In Computer Data File: 08/11/1995  
Date Region Sent Summary to Central Office: Not reported  
Tank Test:  
PBS Number: Not reported  
Tank Number: Not reported  
Test Method: Not reported  
Capacity of Failed Tank: 0  
Leak Rate Failed Tank: 0.00  
Gross Leak Rate: Not reported  
Material:  
Material Class Type: 1  
Quantity Spilled: 0  
Units: Gallons  
Unknown Qty Spilled: No  
Quantity Recovered: 0  
Unknown Qty Recovered: True  
Material: #6 FUEL OIL  
Class Type: Petroleum  
Chem Abstract Service Number: #6 FUEL OIL  
Last Date: 07/28/1994  
Num Times Material Entry In File: 2190  
Spill Cause: CONRAIL EMPLOYEE COMPLAINED OF OILY WATER SLUGE IN VICINITY OF RAIL SIDING LEADING UP TO LOADING DOCK AT ARMOR BOX

The LTANKS database may contain additional details for this site.  
Please contact your EDR Account Executive for more information.

PBS UST:

PBS Number: 9-224499  
SPDES Number: Not reported  
Operator: MOD-PAC CORP  
(716) 873-0640  
Emergency Contact: KEVIN KEANE VP  
(716) 873-0640  
Total Tanks: 0  
Owner: MOD-PAC CORP  
1801 ELMWOOD AVE  
BUFFALO, NY 14216  
(716) 873-0640  
Owner Type: Corporate/Commercial  
Owner Mark: First Owner  
Owner Subtype: Mobil Oil Company  
Mailing Address: MOD-PAC CORP  
ATTN: KEVIN KEANE

CBS Number: Not reported  
SWIS ID: 1402

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

Site

MAP FINDINGS

Database(s)  
EDR ID Number  
EPA ID Number

MOD-PAC CORP (Continued)

1000912018

1801 ELMWOOD AVE  
BUFFALO, NY 14216  
(716) 873-0640

Tank Status:	Closed - In Place	Install Date:	Not reported
Capacity (gals):	6000	Product Stored:	NOS 5 OR 6 FUEL OIL
Tank Location:	UNDERGROUND	Pipe Internal:	Not reported
Tank Id:	1E	Pipe Type:	STEEL/IRON
Tank Type:	Steel/carbon steel		
Tank Internal:	Not reported		
Pipe Location:	1		
Tank External:	Not reported		
Missing Data for Tank:	Minor Data Missing		
Pipe External:	Not reported		
Second Containment:	NONE		
Leak Detection:	NONE		
Overfill Prot:	None	Dispenser:	Suction
Date Tested:	Not reported	Next Test Date:	Not reported
Date Closed:	10/01/1995	Test Method:	Not reported
Deleted:	False	Updated:	True
Dead Letter:	False	Owner Screen:	No data missing
FAMT:	Fiscal amount for registration fee is correct		
Total Capacity:	0	Renewal Date:	10/27/1992
Tank Screen:	0	Federal ID:	Not reported
Renew Flag:	Renwal has been printed	Facility Screen:	No data missing
Certification Flag:	False	Certification Date:	01/15/1993
Old PBS Number:	Not reported	Expiration Date:	08/17/1997
Inspected Date:	Not reported	Inspector:	Not reported
Inspection Result:	Not reported		
Lat/long:	Not reported		
Facility Type:	MANUFACTURING		
Town or City:	BUFFALO (C)		
Town or City Code:	02		
County Code:	14		
Region:	9		
PBS Number:	9-224499	CBS Number:	Not reported
SPDES Number:	Not reported	SWIS ID:	1402
Operator:	MOD-PAC CORP (716) 873-0640		
Emergency Contact:	KEVIN KEANE VP (716) 873-0640		
Total Tanks:	0		
Owner:	MOD-PAC CORP 1801 ELMWOOD AVE BUFFALO, NY 14216 (716) 873-0640		
Owner Type:	Corporate/Commercial		
Owner Mark:	First Owner		
Owner Subtype:	Mobil Oil Company		
Mailing Address:	MOD-PAC CORP ATTN: KEVIN KEANE 1801 ELMWOOD AVE BUFFALO, NY 14216 (716) 873-0640		
Tank Status:	Closed - In Place		
Capacity (gals):	7500		
Tank Location:	UNDERGROUND		

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

MOD-PAC CORP (Continued)

1000912018

Tank Id:	2C	Install Date:	Not reported
Tank Type:	Steel/carbon steel	Product Stored:	NOS 5 OR 6 FUEL OIL
Tank Internal:	Not reported	Pipe Internal:	Not reported
Pipe Location:	1	Pipe Type:	STEEL/IRON
Tank External:	Not reported		
Missing Data for Tank:	Minor Data Missing		
Pipe External:	Not reported		
Second Containment:	NONE		
Leak Detection:	NONE		
Overfill Prot:	None	Dispenser:	Suction
Date Tested:	Not reported	Next Test Date:	Not reported
Date Closed:	10/01/1995	Test Method:	Not reported
Deleted:	False	Updated:	True
Dead Letter:	False	Owner Screen:	No data missing
FAMT:	Fiscal amount for registration fee is correct		
Total Capacity:	0	Renewal Date:	10/27/1992
Tank Screen:	0	Federal ID:	Not reported
Renew Flag:	Renwal has been printed	Facility Screen:	No data missing
Certification Flag:	False	Certification Date:	01/15/1993
Old PBS Number:	Not reported	Expiration Date:	08/17/1997
Inspected Date:	Not reported	Inspector:	Not reported
Inspection Result:	Not reported		
Lat/long:	Not reported		
Facility Type:	MANUFACTURING		
Town or City:	BUFFALO (C)		
Town or City Code:	02		
County Code:	14		
Region:	9		
PBS Number:	9-224499	CBS Number:	Not reported
SPDES Number:	Not reported	SWIS ID:	1402
Operator:	MOD-PAC CORP (716) 873-0640		
Emergency Contact:	KEVIN KEANE VP (716) 873-0640		
Total Tanks:	0		
Owner:	MOD-PAC CORP 1801 ELMWOOD AVE BUFFALO, NY 14216 (716) 873-0640		
Owner Type:	Corporate/Commercial		
Owner Mark:	First Owner		
Owner Subtype:	Mobil Oil Company		
Mailing Address:	MOD-PAC CORP ATTN: KEVIN KEANE 1801 ELMWOOD AVE BUFFALO, NY 14216 (716) 873-0640		
Tank Status:	Closed - In Place	Install Date:	Not reported
Capacity (gals):	4500	Product Stored:	NOS 5 OR 6 FUEL OIL
Tank Location:	UNDERGROUND	Pipe Internal:	Not reported
Tank Id:	3W	Pipe Type:	STEEL/IRON
Tank Type:	Steel/carbon steel		
Tank Internal:	Not reported		
Pipe Location:	1		
Tank External:	Not reported		
Missing Data for Tank:	Minor Data Missing		

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
EPA ID Number

MOD-PAC CORP (Continued)

1000912018

Pipe External:	Not reported	Dispenser:	Suction
Second Containment:	NONE	Next Test Date:	Not reported
Leak Detection:	NONE	Test Method:	Not reported
Overfill Prot:	None	Updated:	True
Date Tested:	Not reported	Owner Screen:	No data missing
Date Closed:	10/01/1995	Renewal Date:	10/27/1992
Deleted:	False	Federal ID:	Not reported
Dead Letter:	False	Facility Screen:	No data missing
FAMT:	Fiscal amount for registration fee is correct	Certification Date:	01/15/1993
Total Capacity:	0	Expiration Date:	08/17/1997
Tank Screen:	0	Inspector:	Not reported
Renew Flag:	Renwal has been printed		
Certification Flag:	False		
Old PBS Number:	Not reported		
Inspected Date:	Not reported		
Inspection Result:	Not reported		
Lat/long:	Not reported		
Facility Type:	MANUFACTURING		
Town or City:	BUFFALO (C)		
Town or City Code:	02		
County Code:	14		
Region:	9		

35  
NE  
1/4-1/2  
2157 ft.  
Higher

CURBELL INC  
777 HERTEL AVE  
BUFFALO, NY 14207

UST U003316241  
LTANKS N/A

LTANKS:

Spill Number:	9875152	Region of Spill:	9
Facility Contact:	Not reported	Facility Tele:	Not reported
Investigator:	FG	SWIS:	14
Caller Name:	Not reported	Caller Agency:	Not reported
Caller Phone:	Not reported	Caller Extension:	Not reported
Notifier Name:	Not reported	Notifier Agency:	Not reported
Notifier Phone:	Not reported	Notifier Extension:	Not reported
Spiller Contact:	ANDY BOZEK	Spiller Phone:	(716) 873-9508
Spiller:	CURBELL INC		
Spiller Address:	777 HERTEL AVENUE BUFFALO, NY 14207		
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.		
Spill Closed Dt:	10/28/1998	Resource Affected:	Groundwater
Spill Cause:	Tank Failure	Spill Source:	Other Commercial/Industrial
Water Affected:	Not reported	PBS Number:	9-004367
Spill Notifier:	Other	Reported to Dept:	10/28/1998 12:00
Spill Date:	10/27/1998 12:00		
Cleanup Ceased:	Not reported		
Last Inspection:	Not reported		
Cleanup Meets Standard:	False		
Recommended Penalty:	Penalty Not Recommended		
Spiller Cleanup Date:	Not reported		
Enforcement Date:	Not reported		
Investigation Complete:	Not reported		
UST Involvement:	False		
Spill Record Last Update:	10/08/1999		
Is Updated:	False		
Corrective Action Plan Submitted:	Not reported		

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
EPA ID Number

**CURBELL INC (Continued)**

**U003316241**

Date Spill Entered In Computer Data File: 10/29/1998 10:49

Date Region Sent Summary to Central Office: Not reported

**Tank Test:**

PBS Number: Not reported  
Tank Number: Not reported  
Test Method: Not reported  
Capacity of Failed Tank: Not reported  
Leak Rate Failed Tank: Not reported  
Gross Leak Rate: Not reported

**Material:**

Material Class Type: 1  
Quantity Spilled: 0  
Units: Gallons  
Unknown Qty Spilled: No  
Quantity Recovered: 0  
Unknown Qty Recovered: True  
Material: #6 FUEL OIL  
Class Type: Petroleum  
Chem Abstract Service Number: #6 FUEL OIL  
Last Date: 07/28/1994  
Num Times Material Entry In File: 2190

DEC Remarks: 10/28/98 EXCAVATION ANALYTICAL RESULTS FOR THE 3000 GALLON FUEL OIL TANK PULLS SHOWS 1,2,4 TRIMETHYLBENZENE AT 5.5 PPB FOR TCLP 8021 RESULTS. THIS SLIGHTLY EXCEEDS THE STARS GUIDANCE OF 5 PPB. THE SITE IS TO BE MADE INACTIVE. NO FURTHER ACTION REQUIRED.

Spill Cause: EXCAVATION SAMPLE RESULTS FROM TANK PULL OF TWO 3000 GALLON FUEL OIL UST S SLIGHTLY EXCEED THE STARS GUIDANCE.

**PBS UST:**

PBS Number: 9-004367 CBS Number: Not reported  
SPDES Number: Not reported SWIS ID: 1402  
Operator: CURBELL INC

(716) 873-9508  
Emergency Contact: ANDY BOZEK  
(716) 626-4067

Total Tanks: 0

Owner: CURBELL INC  
7 COBHAM DRIVE  
ORCHARD PARK, NY 14127  
(716) 667-3377

Owner Type: Corporate/Commercial

Owner Mark: First Owner

Owner Subtype: Not reported

Mailing Address: CURBELL INC  
ATTN: ANDY BOZEK  
777 HERTEL AVE  
P.O. BOX 750  
BUFFALO, NY 14207  
(716) 873-9508

Tank Status: Closed - Removed

Capacity (gals): 2500

Tank Location: UNDERGROUND

Tank Id: 1

Tank Type: Steel/carbon steel

Tank Internal: NONE

Pipe Location: Underground

Tank External: NONE

Missing Data for Tank: No Missing Data

Install Date: 06/01/1968  
Product Stored: NOS 5 OR 6 FUEL OIL  
Pipe Internal: NONE  
Pipe Type: STEEL/IRON

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation Site

MAP FINDINGS

Database(s)  
EDR ID Number  
EPA ID Number

CURBELL INC (Continued)

U003316241

Pipe External:	NONE	Dispenser:	Gravity
Second Containment:	NONE	Next Test Date:	Not reported
Leak Detection:	NONE	Test Method:	Not reported
Overfill Prot:	Product Level Gauge	Updated:	True
Date Tested:	Not reported	Owner Screen:	No data missing
Date Closed:	10/01/1998	Renewal Date:	Not reported
Deleted:	False	Federal ID:	Not reported
Dead Letter:	False	Facility Screen:	No data missing
FAMT:	Fiscal amount for registration fee is correct	Certification Date:	08/30/1996
Total Capacity:	0	Expiration Date:	10/02/2001
Tank Screen:	0	Inspector:	JES
Renew Flag:	Renewal has not been printed		
Certification Flag:	False		
Old PBS Number:	Not reported		
Inspected Date:	04/10/1995		
Inspection Result:	Not reported		
Lat/long:	Not reported		
Facility Type:	MANUFACTURING		
Town or City:	BUFFALO (C)		
Town or City Code:	02		
County Code:	14		
Region:	9		
PBS Number:	9-004367	CBS Number:	Not reported
SPDES Number:	Not reported	SWIS ID:	1402
Operator:	CURBELL INC (716) 873-9508		
Emergency Contact:	ANDY BOZEK (716) 626-4067		
Total Tanks:	0		
Owner:	CURBELL INC 7 COBHAM DRIVE ORCHARD PARK, NY 14127 (716) 667-3377		
Owner Type:	Corporate/Commercial		
Owner Mark:	First Owner		
Owner Subtype:	Not reported		
Mailing Address:	CURBELL INC ATTN: ANDY BOZEK 777 HERTEL AVE P.O. BOX 750 BUFFALO, NY 14207 (716) 873-9508		
Tank Status:	Closed - Removed	Install Date:	06/01/1968
Capacity (gals):	2500	Product Stored:	NOS 5 OR 6 FUEL OIL
Tank Location:	UNDERGROUND	Pipe Internal:	NONE
Tank Id:	2	Pipe Type:	STEEL/IRON
Tank Type:	Steel/carbon steel		
Tank Internal:	NONE		
Pipe Location:	Underground		
Tank External:	NONE		
Missing Data for Tank:	No Missing Data		
Pipe External:	NONE		
Second Containment:	NONE		
Leak Detection:	NONE		
Overfill Prot:	Product Level Gauge	Dispenser:	Gravity
Date Tested:	Not reported	Next Test Date:	Not reported

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

Site

MAP FINDINGS

Database(s)

EDR ID Number  
EPA ID Number

**CURBELL INC (Continued)**

**U003316241**

Date Closed:	10/01/1998	Test Method:	Not reported
Deleted:	False	Updated:	True
Dead Letter:	False	Owner Screen:	No data missing
FAMT:	Fiscal amount for registration fee is correct		
Total Capacity:	0	Renewal Date:	Not reported
Tank Screen:	0	Federal ID:	Not reported
Renew Flag:	Renwal has not been printed	Facility Screen:	No data missing
Certification Flag:	False	Certification Date:	08/30/1996
Old PBS Number:	Not reported	Expiration Date:	10/02/2001
Inspected Date:	04/10/1995	Inspector:	JES
Inspection Result:	Not reported		
Lat/long:	Not reported		
Facility Type:	MANUFACTURING		
Town or City:	BUFFALO (C)		
Town or City Code:	02		
County Code:	14		
Region:	9		

36  
NW  
1/4-1/2  
2365 ft.  
Higher

**AMERICAN BRASS  
70 SAYRE AVENUE  
BUFFALO, NY**

**LTANKS 1000358802  
NY Spills N/A**

**SPILLS:**

Spill Number:	9605497	Region of Spill:	9
Facility Contact:	PAUL BODEKOR	Facility Tele:	(716) 879-6865
Investigator:	MNP	SWIS:	14
Caller Name:	Not reported	Caller Agency:	Not reported
Caller Phone:	Not reported	Caller Extension:	Not reported
Notifier Name:	Not reported	Notifier Agency:	Not reported
Notifier Phone:	Not reported	Notifier Extension:	Not reported
Spiller Contact:	PAUL BODEKOR	Spiller Phone:	(716) 879-6865
Spiller:	OUTOKUMPU AMERICAN BRASS		
Spiller Address:	PO BOX 981 BUFFALO, NY 14240		
Spill Class:	Known release with minimal potential for fire or hazard. DEC Response. Willing Responsible Party. Corrective action taken.		
Spill Closed Dt:	12/18/1996		
Spill Cause:	1	Resource Affected:	On Land
Water Affected:	Not reported	Spill Source:	Not reported
Spill Notifier:	Not reported	PBS Number:	Not reported
Spill Date:	07/29/1996 10:30	Reported to Dept:	07/29/1996 10:50
Cleanup Ceased:	Not reported		
Last Inspection:	19961218		
Cleanup Meets Standard:	True		
Recommended Penalty:	Penalty Not Recommended		
Spiller Cleanup Date:	Not reported		
Enforcement Date:	Not reported		
Investigation Complete:	Not reported		
UST Involvement:	False		
Spill Record Last Update:	02/07/1997		
Is Updated:	False		
Corrective Action Plan Submitted:	Not reported		
Date Spill Entered In Computer Data File:	07/29/1996		
Date Region Sent Summary to Central Office:	Not reported		
Tank Test:			
PBS Number:	Not reported		
Tank Number:	Not reported		



Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

AMERICAN BRASS (Continued)

EDR ID Number  
EPA ID Number

Database(s)

1000358802

Test Method: Not reported  
Capacity of Failed Tank: Not reported  
Leak Rate Failed Tank: Not reported  
Gross Leak Rate: Not reported  
Material:  
Material Class Type: 1  
Quantity Spilled: 0  
Units: Gallons  
Unknown Qty Spilled: No  
Quantity Recovered: 0  
Unknown Qty Recovered: False  
Material: HYDRAULIC OIL  
Class Type: Petroleum  
Chem Abstract Service Number: HYDRAULIC OIL  
Last Date: 07/28/1994  
Num Times Material Entry In File: 1846  
Material Class Type: 2  
Quantity Spilled: 0  
Units: Gallons  
Unknown Qty Spilled: No  
Quantity Recovered: 0  
Unknown Qty Recovered: False  
Material: COPPER  
Class Type: Hazardous  
Chem Abstract Service Number: COPPER  
Last Date: Not reported  
Num Times Material Entry In File: 0  
Remark: COOPER WASTE SPILLING FROM WASTE CONTAINERS. MATERIAL SPILLING ON GROUND FLOWING INTO ROADSIDE DITCH. MODERN LANDFILL ON SITE PICKING UP CONTAINERS  
DEC Remarks: 07/29/96: MNP DISCUSSIONS W/ FRANK KELLY - SOLID WASTE. MODERN LANDFILL HAS NON-HAZ WASTE PERMITS FOR AMERICAN BRASS. MATERIAL SPILLED PROBABLY NON-HAZ. 07/31/96: MNP INSP. MET W/ PAUL BODEKOR - AMERICAN BRASS. COPPER MUD STAGED IN ROLLOFF CONTAINERS NORTH OF MAIN BLDG. COPPER MUD IS GENERATED FROM PROCESS WHICH CONTAINS WASTE COPPER HYDRAULIC OIL. ONE ROLLOFF LEAKED ON GROUND NEARBY DITCH. MODERN DISPOSAL CLEANED UP MOST OF SPILLAGE PUT CONTAMINATED SOIL IN A ROLLOFF ON SITE. OIL STILL AROUND ROLLOFF IN ADJACENT DITCH. MODERN TO COMPLETE REMAINING CLEANUP AFTER ROLLOFFS ARE GONE, EXPECT TO BE DONE BW/IN 2 WEEKS. ROLLOFFS OF COPPER MUD TO BE HAULED FOR RECYCLING AS PLANNED. ROLLOFFS OF CONTAMINATED SOIL TO BE TESTED FOR DISPOSAL. I REQUESTED MSDS FOR COPPER MUD HYDRAULIC OIL, BODEKOR AGREED TO SEND COPY. NOTE: I REMINDED PAUL BODEKOR OF REQUIRED SPILL NOTIFICATION TO DEC W/IN 2 HOURS. 12/18/96: MNP INSP. MET W. PAUL BODEKOR - AMERICAN BRASS. SPILL CLEANUP SATISFACTORY. I PICKED UP THE DISPOSAL RECEIPT. NO FURTHER ACTION NEEDED, COMPLETE.

LTANKS:

Spill Number:	9003847	Region of Spill:	9
Facility Contact:	Not reported	Facility Tele:	Not reported
Investigator:	JDC	SWIS:	14
Caller Name:	Not reported	Caller Agency:	Not reported
Caller Phone:	Not reported	Caller Extension:	Not reported
Notifier Name:	Not reported	Notifier Agency:	Not reported
Notifier Phone:	Not reported	Notifier Extension:	Not reported
Spiller Contact:	Not reported	Spiller Phone:	(716) 879-7800
Spiller:	AMERICAN BRASS		
Spiller Address:	70 SAYRE STREET BUFFALO, NY 14207		

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
EPA ID Number

AMERICAN BRASS (Continued)

1000358802

Spill Class: Not reported  
Spill Closed Dt: 12/17/1990  
Spill Cause: Tank Failure  
Water Affected: Not reported  
Spill Notifier: Responsible Party  
Spill Date: 07/06/1990 14:45  
Cleanup Ceased: 12/17/1990  
Last Inspection: 19900711  
Cleanup Meets Standard: True  
Recommended Penalty: Penalty Not Recommended  
Spiller Cleanup Date: Not reported  
Enforcement Date: Not reported  
Investigation Complete: Not reported  
UST Involvement: True  
Spill Record Last Update: 12/17/1990  
Is Updated: False  
Corrective Action Plan Submitted: Not reported  
Date Spill Entered In Computer Data File: 07/13/1990  
Date Region Sent Summary to Central Office: Not reported  
Tank Test:  
PBS Number: Not reported  
Tank Number: Not reported  
Test Method: Not reported  
Capacity of Failed Tank: Not reported  
Leak Rate Failed Tank: Not reported  
Gross Leak Rate: Not reported  
Material:  
Material Class Type: 1  
Quantity Spilled: 0  
Units: Gallons  
Unknown Qty Spilled: No  
Quantity Recovered: 0  
Unknown Qty Recovered: False  
Material: GASOLINE  
Class Type: Petroleum  
Chem Abstract Service Number: GASOLINE  
Last Date: 09/29/1994  
Num Times Material Entry In File: 21329  
DEC Remarks: 07/11/90: JDC INSPECTED EXCAVATION AND FOUND NO CONTAMINATION. WILL CLOS  
E UPON RECIEPT OF SOIL DISPOSAL. 12/11/90: MJH SENT LETTER REQUESTING  
DISPOSAL RECIEPTS. 12/17/90: DISPOSAL RECIEPTS NO FURTHER ACTION NEEDED  
Spill Cause: TANK TEST FAILURE, TANK REMOVAL

37  
WNW  
1/4-1/2  
2506 ft.  
Higher

MORGAN CHEMICALS INC  
373 HERTEL AVE  
BUFFALO, NY 14207

CERCLIS 1000232550  
FINDS NYD000694257  
RCRIS-LQG

CERCLIS Classification Data:

Site Incident Category: Not reported  
Non NPL Status: Removal Only Site (No Site Assessment Work Needed)  
Ownership Status: Not reported  
Site Description: Storgae of organic solvents, corrosives, and contaminated materials in  
deteriorating containers in an unsafe manner. EPA to perform an  
emergency response to determine the site's eligibility for a CERCLA  
removal action.  
Federal Facility: Not a Federal Facility  
NPL Status: Not on the NPL

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

Site

MAP FINDINGS

Database(s)  
EDR ID Number  
EPA ID Number

**MORGAN CHEMICALS INC (Continued)**

**1000232550**

**CERCLIS Assessment History:**

Assessment:	ADMIN ORDER ON CONSENT	Completed:	08/06/1997
Assessment:	REMOVAL NEGOTIATIONS	Completed:	08/06/1997
Assessment:	REMOVAL ASSESSMENT	Completed:	09/18/1997
Assessment:	PRP REMOVAL	Completed:	12/04/1998
Assessment:	REMOVAL	Completed:	03/11/1999

**CERCLIS Site Status:**

Cleaned up

**RCRIS:**

Owner: MORGAN CHEMICALS INC  
(716) 632-4000  
EPA ID: NYD000694257  
Contact: RONALD SADKIN  
(716) 632-4000

Classification: Large Quantity Generator  
Used Oil Recyc: No  
TSDF Activities: Not reported

**BIENNIAL REPORTS:**

Last Biennial Reporting Year: 1999

Waste	Quantity (Lbs)	Waste	Quantity (Lbs)
D001	312844.04	D002	42660.55
D004	45412.84	D005	83431.19
D006	117431.19	D007	117431.19
D008	155045.87	D009	34403.67
D010	57339.45	D018	326146.79
D019	282110.09	D028	289908.26
D029	285779.82	D030	291743.12
D032	241743.12	D033	234403.67
D039	1376.15	D040	1376.15
D043	1376.15		

Violation Status: No violations found

**NY MANIFEST**

Additional detail is available in NY MANIFEST. Please contact your EDR Account Executive for more information.

**FINDS:**

Other Pertinent Environmental Activity Identified at Site:

Biennial Reporting System (BRS)  
Comprehensive Environmental Response, Compensation and Liability Information System (CERCLIS)  
Facility Registry System (FRS)  
Resource Conservation and Recovery Act Information system (RCRAINFO)

38  
NW  
1/4-1/2  
2607 ft.  
Higher

**ANACONDA COMPANY/AMERICAN BRASS**  
446 MILITARY ROAD  
BUFFALO, NY 14204

SHWS S104541696  
N/A

**SHWS:**

EPA ID:	NYD000632083	Region:	9
Acres:	13	User:	Anaconda Company
Owner:	Outokumpu/American Brass, Inc. 70 Sayre Street / PO Box 981 Buffalo, NY 142		
Owner Type:	OW		
Operator:	Anaconda Company		

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

Site

MAP FINDINGS

Database(s)

EDR ID Number  
EPA ID Number

**ANACONDA COMPANY/AMERICAN BRASS (Continued)**

**S104541696**

446 Military Road  
Buffalo, NY 14204

Operator Type: OP

Classification: DOES NOT PRESENT A SIGNIFICANT THREAT TO THE PUBLIC HEALTH OR THE ENVIRONMENT - ACTION MAY BE DEFERRED.

Depth to Groundwater: Range: 1 to 45 feet.

Legal Action Type: Not reported

Legal NY State: Not reported

Legal Federal: Not reported

Legal state: Not reported

Facility ID Number 915007

Dump: Not reported

Pond: Not reported

Structure: Not reported

Lagoon: Not reported

Landfill: Yes

Lat/Long: 42° 57' 5" / 78° 53' 31"

Disposal Start: 1930

Disposal Term: 1970

Air Data: Not reported

Air Violation: Not reported

Ground Water Data: Yes

Surface Water Data: Not reported

SW Violation: Not reported

Sediment Data: Not reported

Soil Data: Yes

Soil Type: Silt-rich clay with trace sand and gravel.

Remediation Proposed: Not reported

Remediation Active: Not reported

Remediation Design: Not reported

Remediation Type: IRM-PCB contaminated soil removal.

Quantity: unknown

unknown

unknown

unknown

NPL Status: —

Hazardous Waste: PCBs {(Arochlor 1254) (B007 Waste)}

Cadmium (D006 Waste)

Lead

(D008 Waste)

Arsenic (D004 Waste)

Site Description: The American Brass Company has produced copper and copper alloy since 1907. Processes used include metal casting, hot and cold rolling, annealing, slitting, milling, pickling and finishing. In 1979, a NYS Hazardous Waste Survey Report stated that wastes generated by the facility included spent oils, coal ashes, nickel and copper bearing slag, baghouse dust, spent refractories, scrap wood, saw dust and metal oxides. All wastes, with the exception of the waste oils were disposed in a section of the north end of the property. The survey reported that approximately 27,000 tons of metal slag and 21,600 tons of coal ash were disposed in the fill area. Veteran American Brass workers claim that buried drums exist in the northern disposal area as well. In 1988, the company conducted an investigation of the active manufacturing facility that indicated high levels of PCBs, cadmium, lead and arsenic in the soil in the area of the manufacturing facility. A Phase I and a Preliminary Site Assessment (PSA) were conducted separately on the area at the north end of the property which did not

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation     Site

MAP FINDINGS

EDR ID Number  
EPA ID Number

ANACONDA COMPANY/AMERICAN BRASS (Continued)

S104541696

detect any hazardous waste. This area was removed from the site description since no hazardous waste could be documented. The PCB contaminated soil was removed from the site in 1995. A comprehensive Supplemental Remedial Investigation Report and Feasibility Study was submitted in January 1997. The Feasibility Study proposes to cap the remaining area containing cadmium and lead. In 1999, the Company conducted additional soil testing for arsenic in an area adjacent to the Baseball fields north of the facility. The results of this additional work showed a small area that contained arsenic levels above background. This area is proposed to be removed during remedial activities. The company also submitted an application for a Voluntary Clean-up Agreement and additionally submitted a Remedial Action Work Plan to implement the recommendations of the Feasibility Study in 2001. The company has capped several areas which contained elevated levels of metals with asphalt.

Environmental Problems: Localized surface soils are heavily contaminated with PCBs, cadmium, lead and arsenic. Perched groundwater is contaminated with lead as well. The perched water table and the secondary water table are separated by a 30 ft. clay layer, and do not appear to be hydraulically connected. The site does not currently pose a significant threat to the environment.

Health Problems: The site is located in a mixed industrial/residential area in the City of Buffalo. Exposures to contaminated groundwater via drinking water are not expected because the area is served with public water and there are no known private wells to exist nearby. The site is graded and partially covered with coal ash material and cinders. There are baseball fields that are used by a community recreation association on a portion of the site. Surface soils in the ball-field area contain metals at levels generally representative of background conditions. Elevated levels of metals were found in on-site subsurface soils during test pit and soil boring investigations. To prevent potential human exposures to buried contaminants, subsurface soils should not be disturbed.

39  
SSW  
1/2-1  
5241 ft.  
Higher

PEOPLES GASLIGHT & COKE CO.  
BRADLEY & DART  
BUFFALO, NY

Coal Gas     G000000534  
N/A

COAL GAS SITE DESCRIPTION:

Site is on the northeastern corner of Bradley and Dart. Site extends north to the Scajaquada Creek and west past the end of Danford. Site owned by Buffalo Gaslight Co. Not in use by 1900.

©Copyright 1993 Real Property Scan, Inc.

ORPHAN SUMMARY

City	EDR ID	Site Name	Site Address	Zip	Database(s)
BUFFALO	S104278929	BUFFALO POLICE RADIO TOWE	ROUTE 198 WB		LTANKS
BUFFALO	S102175597	BRENTON - BLUE LIQUID	ROUTE 198		NY Spills
BUFFALO	S102178515	TAR ON ROAD	ROUTE 198		NY Spills
BUFFALO	S104953303	CITY OF BFLO PARKS DEPT	ROUTE 198 SCAJAUADA EXPR		NY Spills
BUFFALO	S100493920	UNKNOWN TRUCK	ROUTE 198 EAST		LTANKS
BUFFALO	S104787619	WARD TRUCKING	ROUTE 198 EB		NY Spills
BUFFALO	S104652248	UPS/BUFFALO NIAGARA AIRPO	AERO DRIVE		NY Spills
BUFFALO	S103562203	SUNY AT BUFFALO	ATCHISON HALL SUNYAB		NY Spills
BUFFALO	S102174491	BUFFALO RIVER	BABCOCK STREET		NY Spills
BUFFALO	S102174705	BUFFALO RIVER	BAILEY AVENUE BRIDGE		NY Spills
BUFFALO	S102179192	BUFFALO RIVER DISCHARGE	BERTHA STREET		NY Spills
BUFFALO	1000981455	B M H A - JASPER PARRISH BLOCK 1	BLOCK BOUNDED BY HERTEL	14207	RCRIS-SQG, FINDS
BUFFALO	S104651411	BUFFALO FIRE HOUSE #22	1528 BROADWAY / WICK ST		NY Spills
BUFFALO	S102245196	BUFFALO STREETS & SANITAT	BROADWAY		NY Spills
BUFFALO	S102174044	BOAT SUNK BUFFALO HARBOR	BUFFALO HARBOR - ROUTE 5		NY Spills
BUFFALO	S103562029	BUFFALO STATE COLLEGE	BUFFALO STATE COLLEGE		NY Spills
BUFFALO	S102179410	BUFFALO RIVER/ CROSSROADS	BUFFALO RIVER AT CROSSROA		NY Spills
BUFFALO	S102174801	SHEEN ON BUFFALO RIVER	BUFFALO RIVER		NY Spills
BUFFALO	S103571410	ASHLAND OIL HAZ WASTE SIT	BUSH STREET		NY Spills
BUFFALO	S102403018	CITY OF BUFFALO	SOUTH CABLE		NY Spills
BUFFALO	S102177247	BARGE BUFFALO RIVER	CHILDS STREET, BUFFALO R.		NY Spills
BUFFALO	S103036175	FIRE ENGINE #13 FIRE DEPT	COURT / STATE STREETS		NY Spills
BUFFALO	1001482754	NYSDOT BIN 1-02273-0	DEERFIELD AVE BRG OVER RTE 33	14207	FINDS, RCRIS-LQG
BUFFALO	S102176021	BUFFALO SEWER AUTHORITY	DELAWARE AVENUE		NY Spills
BUFFALO	S103274137	BUFFALO PUBLIC SCHOOL	SOUTH DIVISION STREET		NY Spills
BUFFALO	1001482776	NYSDOT BIN 1-02281-0	DODGE ST OVER RTE 33	14207	FINDS, RCRIS-LQG
BUFFALO	1001482756	NYSDOT BIN 1-02277-0	EDISON PED BRG OVER RTE 33	14207	FINDS, RCRIS-LQG
BUFFALO	S103482424	BUFFALO FUEL TRUCK	ELMWOOD AVENUE		NY Spills
BUFFALO	S102174374	BUFFALO FOUNDRY	ELMWOOD AVENUE		NY Spills
BUFFALO	S102178217	BUFFALO NAVAL SERV. PARK	ERIE STREET (ERIE BASIN)		NY Spills
BUFFALO	S102179484	CITY OF BUFFALO	EXCHANGE STREET		NY Spills
BUFFALO	S104621322	BUFFALO FIRE HOUSE #10	GANSON STREET		LTANKS
BUFFALO	S102178803	BUFFALO RIVER	GANSON STREET		NY Spills
BUFFALO	S103036106	OIL ON BUFFALO RIVER	GANSON STREET		NY Spills
BUFFALO	S103484170	CITY OF BUFFALO TRUCK	202 GLADSTONE STREET		NY Spills
BUFFALO	S103484116	BUFFALO WESTSIDE POST OFC	GRANT STREET		NY Spills
BUFFALO	S105236086	BUFFALO STATE COLLEGE	GRANT @ LETCHWORTH-SW-CNR		NY Spills
BUFFALO	S103562128	SAFETY KLEEN CORP.	HERTEL AVENUE		NY Spills
BUFFALO	S103562488	CONRAIL	HERTEL AVENUE		NY Spills
BUFFALO	S103829643	TRUCK ACCIDENT	HERTEL NEAR ELMWOOD		NY Spills
BUFFALO	S102177678	BUFFALO AND PITTSBURGH RR	HOPKINS - TIFT RR YARD		NY Spills
BUFFALO	1001482750	NYSDOT BIN 1-02271-0	HOSPITAL DR OVER RTE 33	14207	FINDS, RCRIS-LQG
BUFFALO	S104952225	SHEEN ON SCAJAUADA	HOWELL STREET		NY Spills

ORPHAN SUMMARY

City	EDR ID	Site Name	Site Address	Zip	Database(s)
BUFFALO	S103035293	MARCON ERECTORS	HOWELL STREET		NY Spills
BUFFALO	S102174833	OIL ON BUFFALO RIVER	LEE STREET AT RIVER		NY Spills
BUFFALO	S102175865	SUNY AT BUFFALO	MAIN STREET		NY Spills
BUFFALO	S103569884	BUFFALO INNER HARBOR	MAIN SCOTT STREETS		NY Spills
BUFFALO	S102175713	BUFFALO RIVER	MARINA BUFFALO RIVER		NY Spills
BUFFALO	S104507083	NATIONAL RECYCLING TRUCK	1190 NB AT ROUTE 198		NY Spills
BUFFALO	S102173988	BUFFALO RAILROAD	READING / COLGATE		NY Spills
BUFFALO	S102174090	SCAJAQUADA CREEK	SCAJAQUADA EXPRY - RT 198		NY Spills
BUFFALO	S105057386	SUNY BUFFALO NORTH CAMPUS	SERVICE CENTER RD		NY Spills
BUFFALO	S103038227	BUFFALO GENERAL HOSPITAL	NORTH STREET		LTANKS
BUFFALO	S104516304	BUFFALO FIRE HOUSE #26	TONAWANDA STREET		LTANKS
BUFFALO	S102175429	BUFFALO NEWS	WASHINGTON STREET		NY Spills
GRAND ISLAND	1000305945	WBEN RADIO	BEAVER ISLAND PKWY & BUSH RD	14207	RCRIS-SQG, FINDS

## EPA Waste Codes Addendum

Code	Description
D001	IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.
D002	A WASTE WHICH HAS A PH OF LESS THAN 2 OR GREATER THAN 12.5 IS CONSIDERED TO BE A CORROSIVE HAZARDOUS WASTE. SODIUM HYDROXIDE, A CAUSTIC SOLUTION WITH A HIGH PH, IS OFTEN USED BY INDUSTRIES TO CLEAN OR DEGREASE PARTS. HYDROCHLORIC ACID, A SOLUTION WITH A LOW PH, IS USED BY MANY INDUSTRIES TO CLEAN METAL PARTS PRIOR TO PAINTING. WHEN THESE CAUSTIC OR ACID SOLUTIONS BECOME CONTAMINATED AND MUST BE DISPOSED, THE WASTE WOULD BE A CORROSIVE HAZARDOUS WASTE.
D004	ARSENIC
D005	BARIUM
D006	CADMIUM
D007	CHROMIUM
D008	LEAD
D009	MERCURY
D010	SELENIUM
D018	BENZENE
D019	CARBON TETRACHLORIDE
D028	1,2-DICHLOROETHANE
D029	1,1-DICHLOROETHYLENE
D030	2,4-DINITROTOLUENE
D032	HEXACHLOROBENZENE
D033	HEXACHLOROBUTADIENE
D039	TETRACHLOROETHYLENE
D040	TRICHLOROETHYLENE
D043	VINYL CHLORIDE



## GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

To maintain currency of the following federal and state databases, EDR contacts the appropriate governmental agency on a monthly or quarterly basis, as required.

**Elapsed ASTM days:** Provides confirmation that this EDR report meets or exceeds the 90-day updating requirement of the ASTM standard.

### FEDERAL ASTM STANDARD RECORDS

#### **NPL: National Priority List**

Source: EPA

Telephone: N/A

National Priorities List (Superfund). The NPL is a subset of CERCLIS and identifies over 1,200 sites for priority cleanup under the Superfund Program. NPL sites may encompass relatively large areas. As such, EDR provides polygon coverage for over 1,000 NPL site boundaries produced by EPA's Environmental Photographic Interpretation Center (EPIC) and regional EPA offices.

Date of Government Version: 01/29/03

Date Made Active at EDR: 03/04/03

Database Release Frequency: Semi-Annually

Date of Data Arrival at EDR: 02/04/03

Elapsed ASTM days: 28

Date of Last EDR Contact: 02/04/03

#### **NPL Site Boundaries**

Sources:

EPA's Environmental Photographic Interpretation Center (EPIC)

Telephone: 202-564-7333

EPA Region 1

Telephone 617-918-1143

EPA Region 3

Telephone 215-814-5418

EPA Region 4

Telephone 404-562-8033

EPA Region 6

Telephone: 214-655-6659

EPA Region 8

Telephone: 303-312-6774

#### **Proposed NPL: Proposed National Priority List Sites**

Source: EPA

Telephone: N/A

Date of Government Version: 01/29/03

Date Made Active at EDR: 03/04/03

Database Release Frequency: Semi-Annually

Date of Data Arrival at EDR: 02/04/03

Elapsed ASTM days: 28

Date of Last EDR Contact: 02/04/03

#### **CERCLIS: Comprehensive Environmental Response, Compensation, and Liability Information System**

Source: EPA

Telephone: 703-413-0223

CERCLIS contains data on potentially hazardous waste sites that have been reported to the USEPA by states, municipalities, private companies and private persons, pursuant to Section 103 of the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA). CERCLIS contains sites which are either proposed to or on the National Priorities List (NPL) and sites which are in the screening and assessment phase for possible inclusion on the NPL.

Date of Government Version: 03/19/03

Date Made Active at EDR: 04/08/03

Database Release Frequency: Quarterly

Date of Data Arrival at EDR: 03/24/03

Elapsed ASTM days: 15

Date of Last EDR Contact: 03/24/03

#### **CERCLIS-NFRAP: CERCLIS No Further Remedial Action Planned**

Source: EPA

Telephone: 703-413-0223

As of February 1995, CERCLIS sites designated "No Further Remedial Action Planned" (NFRAP) have been removed from CERCLIS. NFRAP sites may be sites where, following an initial investigation, no contamination was found, contamination was removed quickly without the need for the site to be placed on the NPL, or the contamination was not serious enough to require Federal Superfund action or NPL consideration. EPA has removed approximately 25,000 NFRAP sites to lift the unintended barriers to the redevelopment of these properties and has archived them as historical records so EPA does not needlessly repeat the investigations in the future. This policy change is part of the EPA's Brownfields Redevelopment Program to help cities, states, private investors and affected citizens to promote economic redevelopment of unproductive urban sites.

## GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 03/19/03  
Date Made Active at EDR: 04/08/03  
Database Release Frequency: Quarterly

Date of Data Arrival at EDR: 03/24/03  
Elapsed ASTM days: 15  
Date of Last EDR Contact: 03/24/03

### **CORRACTS:** Corrective Action Report

Source: EPA  
Telephone: 800-424-9346  
CORRACTS identifies hazardous waste handlers with RCRA corrective action activity.

Date of Government Version: 01/15/03  
Date Made Active at EDR: 03/04/03  
Database Release Frequency: Semi-Annually

Date of Data Arrival at EDR: 01/21/03  
Elapsed ASTM days: 42  
Date of Last EDR Contact: 03/10/03

### **RCRIS:** Resource Conservation and Recovery Information System

Source: EPA/NTIS  
Telephone: 800-424-9346  
Resource Conservation and Recovery Information System. RCRIS includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA).

Date of Government Version: 09/09/02  
Date Made Active at EDR: 10/28/02  
Database Release Frequency: Varies

Date of Data Arrival at EDR: 09/24/02  
Elapsed ASTM days: 34  
Date of Last EDR Contact: 03/07/03

### **ERNS:** Emergency Response Notification System

Source: National Response Center, United States Coast Guard  
Telephone: 202-260-2342  
Emergency Response Notification System. ERNS records and stores information on reported releases of oil and hazardous substances.

Date of Government Version: 12/31/01  
Date Made Active at EDR: 07/15/02  
Database Release Frequency: Annually

Date of Data Arrival at EDR: 07/02/02  
Elapsed ASTM days: 13  
Date of Last EDR Contact: 01/27/03

## **FEDERAL ASTM SUPPLEMENTAL RECORDS**

### **BRS:** Biennial Reporting System

Source: EPA/NTIS  
Telephone: 800-424-9346  
The Biennial Reporting System is a national system administered by the EPA that collects data on the generation and management of hazardous waste. BRS captures detailed data from two groups: Large Quantity Generators (LQG) and Treatment, Storage, and Disposal Facilities.

Date of Government Version: 12/31/99  
Database Release Frequency: Biennially

Date of Last EDR Contact: 03/17/03  
Date of Next Scheduled EDR Contact: 06/16/03

### **CONSENT:** Superfund (CERCLA) Consent Decrees

Source: EPA Regional Offices  
Telephone: Varies  
Major legal settlements that establish responsibility and standards for cleanup at NPL (Superfund) sites. Released periodically by United States District Courts after settlement by parties to litigation matters.

Date of Government Version: N/A  
Database Release Frequency: Varies

Date of Last EDR Contact: N/A  
Date of Next Scheduled EDR Contact: N/A

### **ROD:** Records Of Decision

Source: EPA  
Telephone: 703-416-0223  
Record of Decision. ROD documents mandate a permanent remedy at an NPL (Superfund) site containing technical and health information to aid in the cleanup.

## GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 01/09/03  
Database Release Frequency: Annually

Date of Last EDR Contact: 01/07/03  
Date of Next Scheduled EDR Contact: 04/07/03

### **DELISTED NPL:** National Priority List Deletions

Source: EPA  
Telephone: N/A

The National Oil and Hazardous Substances Pollution Contingency Plan (NCP) establishes the criteria that the EPA uses to delete sites from the NPL. In accordance with 40 CFR 300.425.(e), sites may be deleted from the NPL where no further response is appropriate.

Date of Government Version: 01/29/03  
Database Release Frequency: Quarterly

Date of Last EDR Contact: 02/04/03  
Date of Next Scheduled EDR Contact: 05/05/03

### **FINDS:** Facility Index System/Facility Identification Initiative Program Summary Report

Source: EPA  
Telephone: N/A

Facility Index System. FINDS contains both facility information and 'pointers' to other sources that contain more detail. EDR includes the following FINDS databases in this report: PCS (Permit Compliance System), AIRS (Aerometric Information Retrieval System), DOCKET (Enforcement Docket used to manage and track information on civil judicial enforcement cases for all environmental statutes), FURS (Federal Underground Injection Control), C-DOCKET (Criminal Docket System used to track criminal enforcement actions for all environmental statutes), FFIS (Federal Facilities Information System), STATE (State Environmental Laws and Statutes), and PADS (PCB Activity Data System).

Date of Government Version: 01/14/03  
Database Release Frequency: Quarterly

Date of Last EDR Contact: 01/06/03  
Date of Next Scheduled EDR Contact: 04/07/03

### **HMIRS:** Hazardous Materials Information Reporting System

Source: U.S. Department of Transportation  
Telephone: 202-366-4555

Hazardous Materials Incident Report System. HMIRS contains hazardous material spill incidents reported to DOT.

Date of Government Version: 11/30/02  
Database Release Frequency: Annually

Date of Last EDR Contact: 01/23/03  
Date of Next Scheduled EDR Contact: 04/21/03

### **MLTS:** Material Licensing Tracking System

Source: Nuclear Regulatory Commission  
Telephone: 301-415-7169

MLTS is maintained by the Nuclear Regulatory Commission and contains a list of approximately 8,100 sites which possess or use radioactive materials and which are subject to NRC licensing requirements. To maintain currency, EDR contacts the Agency on a quarterly basis.

Date of Government Version: 01/16/03  
Database Release Frequency: Quarterly

Date of Last EDR Contact: 01/06/03  
Date of Next Scheduled EDR Contact: 04/07/03

### **MINES:** Mines Master Index File

Source: Department of Labor, Mine Safety and Health Administration  
Telephone: 303-231-5959

Date of Government Version: 09/10/02  
Database Release Frequency: Semi-Annually

Date of Last EDR Contact: 03/31/03  
Date of Next Scheduled EDR Contact: 06/30/03

### **NPL LIENS:** Federal Superfund Liens

Source: EPA  
Telephone: 205-564-4267

Federal Superfund Liens. Under the authority granted the USEPA by the Comprehensive Environmental Response, Compensation and Liability Act (CERCLA) of 1980, the USEPA has the authority to file liens against real property in order to recover remedial action expenditures or when the property owner receives notification of potential liability. USEPA compiles a listing of filed notices of Superfund Liens.

## GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 10/15/91  
Database Release Frequency: No Update Planned

Date of Last EDR Contact: 02/27/03  
Date of Next Scheduled EDR Contact: 05/26/03

### **PADS: PCB Activity Database System**

Source: EPA

Telephone: 202-564-3887

PCB Activity Database. PADS identifies generators, transporters, commercial storers and/or brokers and disposers of PCB's who are required to notify the EPA of such activities.

Date of Government Version: 12/12/02  
Database Release Frequency: Annually

Date of Last EDR Contact: 02/10/03  
Date of Next Scheduled EDR Contact: 05/12/03

### **RAATS: RCRA Administrative Action Tracking System**

Source: EPA

Telephone: 202-564-4104

RCRA Administration Action Tracking System. RAATS contains records based on enforcement actions issued under RCRA pertaining to major violators and includes administrative and civil actions brought by the EPA. For administration actions after September 30, 1995, data entry in the RAATS database was discontinued. EPA will retain a copy of the database for historical records. It was necessary to terminate RAATS because a decrease in agency resources made it impossible to continue to update the information contained in the database.

Date of Government Version: 04/17/95  
Database Release Frequency: No Update Planned

Date of Last EDR Contact: 03/10/03  
Date of Next Scheduled EDR Contact: 06/09/03

### **TRIS: Toxic Chemical Release Inventory System**

Source: EPA

Telephone: 202-260-1531

Toxic Release Inventory System. TRIS identifies facilities which release toxic chemicals to the air, water and land in reportable quantities under SARA Title III Section 313.

Date of Government Version: 12/31/00  
Database Release Frequency: Annually

Date of Last EDR Contact: 03/25/03  
Date of Next Scheduled EDR Contact: 06/23/03

### **TSCA: Toxic Substances Control Act**

Source: EPA

Telephone: 202-260-5521

Toxic Substances Control Act. TSCA identifies manufacturers and importers of chemical substances included on the TSCA Chemical Substance Inventory list. It includes data on the production volume of these substances by plant site.

Date of Government Version: 12/31/98  
Database Release Frequency: Every 4 Years

Date of Last EDR Contact: 03/06/03  
Date of Next Scheduled EDR Contact: 06/09/03

### **FTTS INSP: FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)**

Source: EPA

Telephone: 202-564-2501

Date of Government Version: 01/28/03  
Database Release Frequency: Quarterly

Date of Last EDR Contact: 06/24/03  
Date of Next Scheduled EDR Contact: 06/23/03

### **SSTS: Section 7 Tracking Systems**

Source: EPA

Telephone: 202-564-5008

Section 7 of the Federal Insecticide, Fungicide and Rodenticide Act, as amended (92 Stat. 829) requires all registered pesticide-producing establishments to submit a report to the Environmental Protection Agency by March 1st each year. Each establishment must report the types and amounts of pesticides, active ingredients and devices being produced, and those having been produced and sold or distributed in the past year.

Date of Government Version: 12/31/00  
Database Release Frequency: Annually

Date of Last EDR Contact: 01/21/03  
Date of Next Scheduled EDR Contact: 04/21/03

## GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

### **FTTS: FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)**

Source: EPA/Office of Prevention, Pesticides and Toxic Substances

Telephone: 202-564-2501

FTTS tracks administrative cases and pesticide enforcement actions and compliance activities related to FIFRA, TSCA and EPCRA (Emergency Planning and Community Right-to-Know Act). To maintain currency, EDR contacts the Agency on a quarterly basis.

Date of Government Version: 01/28/03

Database Release Frequency: Quarterly

Date of Last EDR Contact: 03/24/03

Date of Next Scheduled EDR Contact: 06/23/03

### **STATE OF NEW YORK ASTM STANDARD RECORDS**

#### **SHWS: Inactive Hazardous Waste Disposal Sites in New York State**

Source: Department of Environmental Conservation

Telephone: 518-402-9553

State Hazardous Waste Sites. State hazardous waste site records are the states' equivalent to CERCLIS. These sites may or may not already be listed on the federal CERCLIS list. Priority sites planned for cleanup using state funds (state equivalent of Superfund) are identified along with sites where cleanup will be paid for by potentially responsible parties. Available information varies by state.

Date of Government Version: 04/01/02

Date Made Active at EDR: 11/12/02

Database Release Frequency: Annually

Date of Data Arrival at EDR: 10/22/02

Elapsed ASTM days: 21

Date of Last EDR Contact: 02/24/03

#### **SWF/LF: Facility Register**

Source: Department of Environmental Conservation

Telephone: 518-457-2051

Solid Waste Facilities/Landfill Sites. SWF/LF type records typically contain an inventory of solid waste disposal facilities or landfills in a particular state. Depending on the state, these may be active or inactive facilities or open dumps that failed to meet RCRA Subtitle D Section 4004 criteria for solid waste landfills or disposal sites.

Date of Government Version: 12/31/01

Date Made Active at EDR: 04/18/02

Database Release Frequency: Semi-Annually

Date of Data Arrival at EDR: 03/28/02

Elapsed ASTM days: 21

Date of Last EDR Contact: 02/05/03

#### **LTANKS: Spills Information Database**

Source: Department of Environmental Conservation

Telephone: 518-402-9549

Leaking Storage Tank Incident Reports. These records contain an inventory of reported leaking storage tank incidents reported from 4/1/86 through the most recent update. They can be either leaking underground storage tanks or leaking aboveground storage tanks. The causes of the incidents are tank test failures, tank failures or tank overfills.

Date of Government Version: 01/01/02

Date Made Active at EDR: 03/22/02

Database Release Frequency: Varies

Date of Data Arrival at EDR: 02/20/02

Elapsed ASTM days: 30

Date of Last EDR Contact: 01/28/03

#### **UST: Petroleum Bulk Storage (PBS) Database**

Source: Department of Environmental Conservation

Telephone: 518-402-9549

Facilities that have petroleum storage capacities in excess of 1,100 gallons and less than 400,000 gallons.

Date of Government Version: 01/01/02

Date Made Active at EDR: 03/22/02

Database Release Frequency: Varies

Date of Data Arrival at EDR: 02/20/02

Elapsed ASTM days: 30

Date of Last EDR Contact: 01/28/03

#### **CBS UST: Chemical Bulk Storage Database**

Source: NYSDEC

Telephone: 518-402-9549

Facilities that store regulated hazardous substances in underground tanks of any size

## GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 01/01/02  
Date Made Active at EDR: 03/22/02  
Database Release Frequency: Varies

Date of Data Arrival at EDR: 02/20/02  
Elapsed ASTM days: 30  
Date of Last EDR Contact: 01/28/03

### **MOSF UST:** Major Oil Storage Facilities Database

Source: NYSDEC

Telephone: 518-402-9549

Facilities that may be onshore facilities or vessels, with petroleum storage capacities of 400,000 gallons or greater.

Date of Government Version: 01/01/02  
Date Made Active at EDR: 03/22/02  
Database Release Frequency: Varies

Date of Data Arrival at EDR: 02/20/02  
Elapsed ASTM days: 30  
Date of Last EDR Contact: 01/28/03

### **VCP:** Voluntary Cleanup Agreements

Source: Department of Environmental Conservation

Telephone: 518-402-9711

The voluntary remedial program uses private monies to get contaminated sites remediated to levels allowing for the sites' productive use. The program covers virtually any kind of site and contamination.

Date of Government Version: 03/03/03  
Date Made Active at EDR: 04/15/03  
Database Release Frequency: Semi-Annually

Date of Data Arrival at EDR: 03/24/03  
Elapsed ASTM days: 22  
Date of Last EDR Contact: 03/18/03

### **SWRCY:** Registered Recycling Facility List

Source: Department of Environmental Conservation

Telephone: 518-402-8705

A listing of recycling facilities.

Date of Government Version: 07/17/00  
Date Made Active at EDR: 09/13/00  
Database Release Frequency: Semi-Annually

Date of Data Arrival at EDR: 08/24/00  
Elapsed ASTM days: 20  
Date of Last EDR Contact: 02/19/03

### **SWTIRE:** Registered Waste Tire Storage & Facility List

Source: Department of Environmental Conservation

Telephone: 518-402-8694

Date of Government Version: 11/01/02  
Date Made Active at EDR: 03/04/03  
Database Release Frequency: Annually

Date of Data Arrival at EDR: 02/18/03  
Elapsed ASTM days: 14  
Date of Last EDR Contact: 02/18/03

## **STATE OF NEW YORK ASTM SUPPLEMENTAL RECORDS**

### **HSWDS:** Hazardous Substance Waste Disposal Site Inventory

Source: Department of Environmental Conservation

Telephone: 518-402-9564

The list includes any known or suspected hazardous substance waste disposal sites. Also included are sites delisted from the Registry of Inactive Hazardous Waste Disposal Sites and non-registry sites which U.S. EPA Preliminary Assessment (PA) reports or Site Investigation (SI) reports were prepared.

Date of Government Version: 09/01/02  
Database Release Frequency: Annually

Date of Last EDR Contact: 03/03/03  
Date of Next Scheduled EDR Contact: 06/02/03

### **AST:** Petroleum Bulk Storage

Source: Department of Environmental Conservation

Telephone: 518-402-9549

Registered Aboveground Storage Tanks.

Date of Government Version: 01/01/02  
Database Release Frequency: Varies

Date of Last EDR Contact: 01/28/03  
Date of Next Scheduled EDR Contact: 04/28/03

## GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

### **CBS AST:** Chemical Bulk Storage Database

Source: NYSDEC

Telephone: 518-402-9549

Facilities that store regulated hazardous substances in aboveground tanks with capacities of 185 gallons or greater, and/or in underground tanks of any size.

Date of Government Version: 01/01/02

Database Release Frequency: Varies

Date of Last EDR Contact: 01/28/03

Date of Next Scheduled EDR Contact: 04/28/03

### **MOSF AST:** Major Oil Storage Facilities Database

Source: NYSDEC

Telephone: 518-402-9549

Facilities that may be onshore facilities or vessels, with petroleum storage capacities of 400,000 gallons or greater.

Date of Government Version: 01/01/02

Database Release Frequency: Varies

Date of Last EDR Contact: 01/28/03

Date of Next Scheduled EDR Contact: 04/28/03

### **SPILLS:** Spills Information Database

Source: Department of Environmental Conservation

Telephone: 518-402-9549

Data collected on spills reported to NYSDEC as required by one or more of the following: Article 12 of the Navigation Law, 6 NYCRR Section 613.8 (from PBS regs), or 6 NYCRR Section 595.2 (from CBS regs). It includes spills active as of April 1, 1986, as well as spills occurring since this date.

Date of Government Version: 01/01/02

Database Release Frequency: Varies

Date of Last EDR Contact: 01/28/03

Date of Next Scheduled EDR Contact: 04/28/03

### **MANIFEST:** Facility and Manifest Data

Source: Department of Environmental Conservation

Telephone: 518-402-8651

Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a TSD facility.

Date of Government Version: 09/12/02

Database Release Frequency: Annually

Date of Last EDR Contact: 03/03/03

Date of Next Scheduled EDR Contact: 06/02/03

## **LOCAL RECORDS**

### **CORTLAND COUNTY:**

#### **Cortland County Storage Tank Listing**

Source: Cortland County Health Department

Telephone: 607-753-5035

Date of Government Version: 11/15/02

Database Release Frequency: Quarterly

Date of Last EDR Contact: 03/03/03

Date of Next Scheduled EDR Contact: 06/02/03

#### **Cortland County Storage Tank Listing**

Source: Cortland County Health Department

Telephone: 607-753-5035

Date of Government Version: 11/15/02

Database Release Frequency: Quarterly

Date of Last EDR Contact: 03/03/03

Date of Next Scheduled EDR Contact: 06/02/03

### **NASSAU COUNTY:**

## GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

### Registered Tank Database

Source: Nassau County Health Department  
Telephone: 516-571-3314

Date of Government Version: 01/06/03  
Database Release Frequency: Quarterly

Date of Last EDR Contact: 02/03/03  
Date of Next Scheduled EDR Contact: 05/05/03

### Registered Tank Database

Source: Nassau County Health Department  
Telephone: 516-571-3314

Date of Government Version: 01/06/03  
Database Release Frequency: Quarterly

Date of Last EDR Contact: 02/03/03  
Date of Next Scheduled EDR Contact: 05/05/03

### Storage Tank Database

Source: Nassau County Office of the Fire Marshal  
Telephone: 516-572-1000

Date of Government Version: N/A  
Database Release Frequency: Varies

Date of Last EDR Contact: N/A  
Date of Next Scheduled EDR Contact: N/A

### Storage Tank Database

Source: Nassau County Office of the Fire Marshal  
Telephone: 516-572-1000

Date of Government Version: 11/22/02  
Database Release Frequency: Varies

Date of Last EDR Contact: 02/11/03  
Date of Next Scheduled EDR Contact: 05/12/03

## ROCKLAND COUNTY:

### Petroleum Bulk Storage Database

Source: Rockland County Health Department  
Telephone: 914-364-2605

Date of Government Version: 01/23/03  
Database Release Frequency: Quarterly

Date of Last EDR Contact: 01/06/03  
Date of Next Scheduled EDR Contact: 04/07/03

### Petroleum Bulk Storage Database

Source: Rockland County Health Department  
Telephone: 914-364-2605

Date of Government Version: 01/23/03  
Database Release Frequency: Quarterly

Date of Last EDR Contact: 01/06/03  
Date of Next Scheduled EDR Contact: 04/07/03

## SUFFOLK COUNTY:

### Storage Tank Database

Source: Suffolk County Department of Health Services  
Telephone: 631-854-2521

Date of Government Version: 12/31/01  
Database Release Frequency: Annually

Date of Last EDR Contact: 03/06/03  
Date of Next Scheduled EDR Contact: 06/02/03

### Storage Tank Database

Source: Suffolk County Department of Health Services  
Telephone: 631-854-2521

Date of Government Version: 12/31/01  
Database Release Frequency: Annually

Date of Last EDR Contact: 03/06/03  
Date of Next Scheduled EDR Contact: 06/02/03



## GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

### WESTCHESTER COUNTY:

#### Listing of Storage Tanks

Source: Westchester County Department of Health  
Telephone: 914-813-5161  
Listing of underground storage tanks in Westchester County.

Date of Government Version: 01/24/03  
Database Release Frequency: Varies

Date of Last EDR Contact: 03/03/03  
Date of Next Scheduled EDR Contact: 06/02/03

#### Listing of Storage Tanks

Source: Westchester County Department of Health  
Telephone: 914-813-5161  
Listing of aboveground storage tanks in Westchester County.

Date of Government Version: 01/24/03  
Database Release Frequency: Varies

Date of Last EDR Contact: 03/03/03  
Date of Next Scheduled EDR Contact: 06/02/03

### EDR PROPRIETARY HISTORICAL DATABASES

**Former Manufactured Gas (Coal Gas) Sites:** The existence and location of Coal Gas sites is provided exclusively to EDR by Real Property Scan, Inc. ©Copyright 1993 Real Property Scan, Inc. For a technical description of the types of hazards which may be found at such sites, contact your EDR customer service representative.

#### **Disclaimer Provided by Real Property Scan, Inc.**

The information contained in this report has predominantly been obtained from publicly available sources produced by entities other than Real Property Scan. While reasonable steps have been taken to insure the accuracy of this report, Real Property Scan does not guarantee the accuracy of this report. Any liability on the part of Real Property Scan is strictly limited to a refund of the amount paid. No claim is made for the actual existence of toxins at any site. This report does not constitute a legal opinion.

### STATE OF NEW YORK BROWNFIELDS DATABASES RECORDS

#### **Brownfields:** Brownfields Site List

Source: Department of Environmental Conservation  
Telephone: 518-402-9764

Date of Government Version: 05/22/02  
Database Release Frequency: Semi-Annually

Date of Last EDR Contact: 03/28/03  
Date of Next Scheduled EDR Contact: 06/16/03

#### **VCP:** Voluntary Cleanup Agreements

Source: Department of Environmental Conservation  
Telephone: 518-402-9711

The voluntary remedial program uses private monies to get contaminated sites remediated to levels allowing for the sites' productive use. The program covers virtually any kind of site and contamination.

Date of Government Version: 03/03/03  
Database Release Frequency: Semi-Annually

Date of Last EDR Contact: 03/18/03  
Date of Next Scheduled EDR Contact: 06/16/03

### OTHER DATABASE(S)

Depending on the geographic area covered by this report, the data provided in these specialty databases may or may not be complete. For example, the existence of wetlands information data in a specific report does not mean that all wetlands in the area covered by the report are included. Moreover, the absence of any reported wetlands information does not necessarily mean that wetlands do not exist in the area covered by the report.

## GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

**Oil/Gas Pipelines:** This data was obtained by EDR from the USGS in 1994. It is referred to by USGS as GeoData Digital Line Graphs from 1:100,000-Scale Maps. It was extracted from the transportation category including some oil, but primarily gas pipelines.

**Sensitive Receptors:** There are individuals deemed sensitive receptors due to their fragile immune systems and special sensitivity to environmental discharges. These sensitive receptors typically include the elderly, the sick, and children. While the location of all sensitive receptors cannot be determined, EDR indicates those buildings and facilities - schools, daycares, hospitals, medical centers, and nursing homes - where individuals who are sensitive receptors are likely to be located.

**Flood Zone Data:** This data, available in select counties across the country, was obtained by EDR in 1999 from the Federal Emergency Management Agency (FEMA). Data depicts 100-year and 500-year flood zones as defined by FEMA.

**NWI:** National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 2002 from the U.S. Fish and Wildlife Service.

### STREET AND ADDRESS INFORMATION

© 2003 Geographic Data Technology, Inc., Rel. 07/2001. This product contains proprietary and confidential property of Geographic Data Technology, Inc. Unauthorized use, including copying for other than testing and standard backup procedures, of this product is expressly prohibited.

## **GEOCHECK®- PHYSICAL SETTING SOURCE ADDENDUM**

### **TARGET PROPERTY ADDRESS**

BUFFALO WEAVING AND BELTING CO  
260 CHANDLER STREET  
BUFFALO, NY 14207

### **TARGET PROPERTY COORDINATES**

Latitude (North):	42.943501 - 42° 56' 36.6"
Longitude (West):	78.885201 - 78° 53' 6.7"
Universal Transverse Mercator:	Zone 17
UTM X (Meters):	672539.4
UTM Y (Meters):	4756495.5

EDR's GeoCheck Physical Setting Source Addendum has been developed to assist the environmental professional with the collection of physical setting source information in accordance with ASTM 1527-00, Section 7.2.3. Section 7.2.3 requires that a current USGS 7.5 Minute Topographic Map (or equivalent, such as the USGS Digital Elevation Model) be reviewed. It also requires that one or more additional physical setting sources be sought when (1) conditions have been identified in which hazardous substances or petroleum products are likely to migrate to or from the property, and (2) more information than is provided in the current USGS 7.5 Minute Topographic Map (or equivalent) is generally obtained, pursuant to local good commercial or customary practice, to assess the impact of migration of recognized environmental conditions in connection with the property. Such additional physical setting sources generally include information about the topographic, hydrologic, hydrogeologic, and geologic characteristics of a site, and wells in the area.

Assessment of the impact of contaminant migration generally has two principle investigative components:

1. Groundwater flow direction, and
2. Groundwater flow velocity.

Groundwater flow direction may be impacted by surface topography, hydrology, hydrogeology, characteristics of the soil, and nearby wells. Groundwater flow velocity is generally impacted by the nature of the geologic strata. EDR's GeoCheck Physical Setting Source Addendum is provided to assist the environmental professional in forming an opinion about the impact of potential contaminant migration.

## **GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY**

### **GROUNDWATER FLOW DIRECTION INFORMATION**

Groundwater flow direction for a particular site is best determined by a qualified environmental professional using site-specific well data. If such data is not reasonably ascertainable, it may be necessary to rely on other sources of information, such as surface topographic information, hydrologic information, hydrogeologic data collected on nearby properties, and regional groundwater flow information (from deep aquifers).

### **TOPOGRAPHIC INFORMATION**

Surface topography may be indicative of the direction of surficial groundwater flow. This information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

#### **USGS TOPOGRAPHIC MAP ASSOCIATED WITH THIS SITE**

Target Property: 2442078-H8 BUFFALO NW, NY CA10  
Source: USGS 7.5 min quad index

#### **GENERAL TOPOGRAPHIC GRADIENT AT TARGET PROPERTY**

Target Property: General South

Source: General Topographic Gradient has been determined from the USGS Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified.

### **HYDROLOGIC INFORMATION**

Surface water can act as a hydrologic barrier to groundwater flow. Such hydrologic information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

Refer to the Physical Setting Source Map following this summary for hydrologic information (major waterways and bodies of water).

#### **FEMA FLOOD ZONE**

Target Property County  
ERIE, NY

FEMA Flood  
Electronic Data  
YES - refer to the Overview Map and Detail Map

Flood Plain Panel at Target Property: 3602300015B

Additional Panels in search area: Not Reported

#### **NATIONAL WETLAND INVENTORY**

NWI Quad at Target Property  
BUFFALO NW

NWI Electronic  
Data Coverage  
YES - refer to the Overview Map and Detail Map

### **HYDROGEOLOGIC INFORMATION**

Hydrogeologic information obtained by installation of wells on a specific site can often be an indicator of groundwater flow direction in the immediate area. Such hydrogeologic information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

## GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

### Site-Specific Hydrogeological Data\*:

Search Radius: 2.0 miles  
Status: Not found

### AQUIFLOW®

Search Radius: 2.000 Miles.

EDR has developed the AQUIFLOW Information System to provide data on the general direction of groundwater flow at specific points. EDR has reviewed reports submitted by environmental professionals to regulatory authorities at select sites and has extracted the date of the report, groundwater flow direction as determined hydrogeologically, and the depth to water table.

MAP ID	LOCATION FROM TP	GENERAL DIRECTION GROUNDWATER FLOW
8	1/2 - 1 Mile ESE	E

For additional site information, refer to Physical Setting Source Map Findings.

### GROUNDWATER FLOW VELOCITY INFORMATION

Groundwater flow velocity information for a particular site is best determined by a qualified environmental professional using site specific geologic and soil strata data. If such data are not reasonably ascertainable, it may be necessary to rely on other sources of information, including geologic age identification, rock stratigraphic unit and soil characteristics data collected on nearby properties and regional soil information. In general, contaminant plumes move more quickly through sandy-gravelly types of soils than silty-clayey types of soils.

### GEOLOGIC INFORMATION IN GENERAL AREA OF TARGET PROPERTY

Geologic information can be used by the environmental professional in forming an opinion about the relative speed at which contaminant migration may be occurring.

#### ROCK STRATIGRAPHIC UNIT

Era: Paleozoic  
System: Silurian  
Series: Upper Silurian (Cayugan)  
Code: S3 (decoded above as Era, System & Series)

#### GEOLOGIC AGE IDENTIFICATION

Category: Stratified Sequence

Geologic Age and Rock Stratigraphic Unit Source: P.G. Schruben, R.E. Arndt and W.J. Bawiec, Geology of the Conterminous U.S. at 1:2,500,000 Scale - a digital representation of the 1974 P.B. King and H.M. Beikman Map, USGS Digital Data Series DDS - 11 (1994).

### DOMINANT SOIL COMPOSITION IN GENERAL AREA OF TARGET PROPERTY

The U.S. Department of Agriculture's (USDA) Soil Conservation Service (SCS) leads the National Cooperative Soil Survey (NCSS) and is responsible for collecting, storing, maintaining and distributing soil survey information for privately owned lands in the United States. A soil map in a soil survey is a representation of soil patterns in a landscape. Soil maps for STATSGO are compiled by generalizing more detailed (SSURGO) soil survey maps. The following information is based on Soil Conservation Service STATSGO data.

## GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

Soil Component Name: URBAN LAND

Soil Surface Texture: variable

Hydrologic Group: Not reported

Soil Drainage Class: Not reported

Hydric Status: Soil does not meet the requirements for a hydric soil.

Corrosion Potential - Uncoated Steel: Not Reported

Depth to Bedrock Min: > 10 inches

Depth to Bedrock Max: > 10 inches

Soil Layer Information							
Layer	Boundary		Soil Texture Class	Classification		Permeability Rate (in/hr)	Soil Reaction (pH)
	Upper	Lower		AASHTO Group	Unified Soil		
1	0 inches	6 inches	variable	Not reported	Not reported	Max: 0.00 Min: 0.00	Max: 0.00 Min: 0.00

### OTHER SOIL TYPES IN AREA

Based on Soil Conservation Service STATSGO data, the following additional subinvariant soil types may appear within the general area of target property.

Soil Surface Textures: silt loam  
loamy fine sand  
channery - silt loam

Surficial Soil Types: silt loam  
loamy fine sand  
channery - silt loam

Shallow Soil Types: loam  
silt loam  
channery - silt loam

Deeper Soil Types: silt loam  
fine sand  
silty clay  
unweathered bedrock  
very channery - loam  
gravelly - loam

### ADDITIONAL ENVIRONMENTAL RECORD SOURCES

According to ASTM E 1527-00, Section 7.2.2, "one or more additional state or local sources of environmental records may be checked, in the discretion of the environmental professional, to enhance and supplement federal and state sources... Factors to consider in determining which local or additional state records, if any, should be checked include (1) whether they are reasonably ascertainable, (2) whether they are sufficiently useful, accurate, and complete in light of the objective of the records review (see 7.1.1), and (3) whether they are obtained, pursuant to local, good commercial or customary practice." One of the record sources listed in Section 7.2.2 is water well information. Water well information can be used to assist the environmental professional in assessing sources that may impact groundwater flow direction, and in forming an opinion about the impact of contaminant migration on nearby drinking water wells.

## GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

### WELL SEARCH DISTANCE INFORMATION

<u>DATABASE</u>	<u>SEARCH DISTANCE (miles)</u>
Federal USGS	1.000
Federal FRDS PWS	Nearest PWS within 1 mile
State Database	1.000

### FEDERAL USGS WELL INFORMATION

<u>MAP ID</u>	<u>WELL ID</u>	<u>LOCATION FROM TP</u>
A1	USGS0757959	1/4 - 1/2 Mile NE
A2	USGS0757290	1/2 - 1 Mile ENE
3	USGS0757292	1/2 - 1 Mile WNW
4	USGS0757311	1/2 - 1 Mile SSE
5	USGS0757316	1/2 - 1 Mile NE
6	USGS0757302	1/2 - 1 Mile South
7	USGS0757308	1/2 - 1 Mile SE
B9	USGS0757310	1/2 - 1 Mile SE
10	USGS0757984	1/2 - 1 Mile NNE
B11	USGS0757947	1/2 - 1 Mile SE

### FEDERAL FRDS PUBLIC WATER SUPPLY SYSTEM INFORMATION

<u>MAP ID</u>	<u>WELL ID</u>	<u>LOCATION FROM TP</u>
No PWS System Found		

Note: PWS System location is not always the same as well location.

### STATE DATABASE WELL INFORMATION

<u>MAP ID</u>	<u>WELL ID</u>	<u>LOCATION FROM TP</u>
No Wells Found		



# PHYSICAL SETTING SOURCE MAP - 0962135.1s



- County Boundary
- Major Roads
- Contour Lines
- Earthquake epicenter, Richter 5 or greater
- Water Wells
- Public Water Supply Wells
- Cluster of Multiple Icons

- Groundwater Flow Direction
- Indeterminate Groundwater Flow at Location
- Groundwater Flow Varies at Location
- Closest Hydrogeological Data

**TARGET PROPERTY:** Buffalo Weaving and Belting Co  
**ADDRESS:** 260 Chandler Street  
**CITY/STATE/ZIP:** Buffalo NY 14207  
**LAT/LONG:** 42.9435 / 78.8852

**CUSTOMER:** Benchmark Environmental, PLLC  
**CONTACT:** Bryan Hann  
**INQUIRY #:** 0962135.1s  
**DATE:** April 17, 2003 6:15 pm



## GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID  
Direction  
Distance  
Elevation

Database EDR ID Number

A1  
NE  
1/4 - 1/2 Mile  
Higher

FED USGS USGS0757959

Agency:	USGS	Site ID:	425652078524101
Site Name:	E 861		
Dec. Latitude:	42.94784		
Dec. Longitude:	-78.87781		
Coord Sys:	NAD83		
State:	NY		
County:	Erie County		
Altitude:	598.0		
Hydrologic code:	04120104		
Topographic:	Not Reported		
Site Type:	Ground-water other than Spring		
Const Date:	19740118	Inven Date:	19740118
Well Type:	Test hole, not completed as a well		
Primary Aquifer:	Not Reported		
Aquifer type:	Not Reported	Well depth:	Not Reported
Hole depth:	300	Source:	D
Project no:	Not Reported		

A2  
ENE  
1/2 - 1 Mile  
Higher

FED USGS USGS0757290

Agency:	USGS	Site ID:	425651078523601
Site Name:	E 414		
Dec. Latitude:	42.94756		
Dec. Longitude:	-78.87642		
Coord Sys:	NAD83		
State:	NY		
County:	Erie County		
Altitude:	598		
Hydrologic code:	Not Reported		
Topographic:	Not Reported		
Site Type:	Ground-water other than Spring		
Const Date:	Not Reported	Inven Date:	19880612
Well Type:	Test hole, not completed as a well		
Primary Aquifer:	Not Reported		
Aquifer type:	Not Reported	Well depth:	Not Reported
Hole depth:	Not Reported	Source:	Not Reported
Project no:	Not Reported		

3  
WNW  
1/2 - 1 Mile  
Higher

FED USGS USGS0757292

## GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Agency:	USGS	Site ID:	425653078534201
Site Name:	E 417		
Dec. Latitude:	42.94811		
Dec. Longitude:	-78.89476		
Coord Sys:	NAD83		
State:	NY		
County:	Erie County		
Altitude:	599		
Hydrologic code:	Not Reported		
Topographic:	Not Reported		
Site Type:	Ground-water other than Spring		
Const Date:	Not Reported	Inven Date:	19880612
Well Type:	Test hole, not completed as a well		
Primary Aquifer:	Not Reported		
Aquifer type:	Not Reported	Well depth:	Not Reported
Hole depth:	Not Reported	Source:	Not Reported
Project no:	Not Reported		

4  
SSE  
1/2 - 1 Mile  
Higher

FED USGS USGS0757311

Agency:	USGS	Site ID:	425604078525501
Site Name:	E 392		
Dec. Latitude:	42.9345		
Dec. Longitude:	-78.8817		
Coord Sys:	NAD83		
State:	NY		
County:	Erie County		
Altitude:	603		
Hydrologic code:	Not Reported		
Topographic:	Not Reported		
Site Type:	Ground-water other than Spring		
Const Date:	Not Reported	Inven Date:	19880612
Well Type:	Test hole, not completed as a well		
Primary Aquifer:	Not Reported		
Aquifer type:	Not Reported	Well depth:	Not Reported
Hole depth:	Not Reported	Source:	Not Reported
Project no:	Not Reported		

5  
NE  
1/2 - 1 Mile  
Higher

FED USGS USGS0757316

Agency:	USGS	Site ID:	425704078523701
Site Name:	E 427		
Dec. Latitude:	42.95117		
Dec. Longitude:	-78.8767		
Coord Sys:	NAD83		
State:	NY		
County:	Erie County		
Altitude:	597		
Hydrologic code:	Not Reported		
Topographic:	Not Reported		
Site Type:	Ground-water other than Spring		
Const Date:	Not Reported	Inven Date:	19880612
Well Type:	Test hole, not completed as a well		
Primary Aquifer:	Not Reported		
Aquifer type:	Not Reported	Well depth:	Not Reported
Hole depth:	Not Reported	Source:	Not Reported
Project no:	Not Reported		

# GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID  
Direction  
Distance  
Elevation

Database EDR ID Number

6  
South  
1/2 - 1 Mile  
Higher

FED USGS USGS0757302

Agency:	USGS	Site ID:	425556078530401
Site Name:	E 381		
Dec. Latitude:	42.93228		
Dec. Longitude:	-78.8842		
Coord Sys:	NAD83		
State:	NY		
County:	Erie County		
Altitude:	593		
Hydrologic code:	Not Reported		
Topographic:	Not Reported		
Site Type:	Ground-water other than Spring		
Const Date:	Not Reported	Inven Date:	19880612
Well Type:	Test hole, not completed as a well		
Primary Aquifer:	Not Reported		
Aquifer type:	Not Reported	Well depth:	Not Reported
Hole depth:	Not Reported	Source:	Not Reported
Project no:	Not Reported		

7  
SE  
1/2 - 1 Mile  
Lower

FED USGS USGS0757308

Agency:	USGS	Site ID:	425559078523201
Site Name:	E 388		
Dec. Latitude:	42.93311		
Dec. Longitude:	-78.87531		
Coord Sys:	NAD83		
State:	NY		
County:	Erie County		
Altitude:	580		
Hydrologic code:	Not Reported		
Topographic:	Not Reported		
Site Type:	Ground-water other than Spring		
Const Date:	Not Reported	Inven Date:	19880612
Well Type:	Test hole, not completed as a well		
Primary Aquifer:	Not Reported		
Aquifer type:	Not Reported	Well depth:	Not Reported
Hole depth:	Not Reported	Source:	Not Reported
Project no:	Not Reported		

8  
ESE  
1/2 - 1 Mile  
Higher

Site ID:	9402194		
Groundwater Flow:	E		
Shallowest Water Table Depth:	Not Reported	AQUIFLOW	60517
Deepest Water Table Depth:	Not Reported		
Average Water Table Depth:	Not Reported		
Date:	04/01/1994		

# GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID  
Direction  
Distance  
Elevation

Database EDR ID Number

B9  
SE  
1/2 - 1 Mile  
Lower

FED USGS USGS0757310

Agency:	USGS	Site ID:	425601078522101
Site Name:	E 390		
Dec. Latitude:	42.93367		
Dec. Longitude:	-78.87226		
Coord Sys:	NAD83		
State:	NY		
County:	Erie County		
Altitude:	579.6		
Hydrologic code:	04120103		
Topographic:	Not Reported		
Site Type:	Spring		
Const Date:	19770430	Inven Date:	Not Reported
Well Type:	Spring		
Primary Aquifer:	Not Reported		
Aquifer type:	Not Reported	Well depth:	17.0
Hole depth:	22.0	Source:	D
Project no:	Not Reported		

10  
NNE  
1/2 - 1 Mile  
Higher

FED USGS USGS0757984

Agency:	USGS	Site ID:	425719078522901
Site Name:	E 448		
Dec. Latitude:	42.95534		
Dec. Longitude:	-78.87448		
Coord Sys:	NAD83		
State:	NY		
County:	Erie County		
Altitude:	607		
Hydrologic code:	Not Reported		
Topographic:	Not Reported		
Site Type:	Ground-water other than Spring		
Const Date:	Not Reported	Inven Date:	19880502
Well Type:	Test hole, not completed as a well		
Primary Aquifer:	Not Reported		
Aquifer type:	Not Reported	Well depth:	Not Reported
Hole depth:	Not Reported	Source:	Not Reported
Project no:	Not Reported		

B11  
SE  
1/2 - 1 Mile  
Lower

FED USGS USGS0757947

## GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Agency:	USGS	Site ID:	425602078521501
Site Name:	E 391		
Dec. Latitude:	42.93395		
Dec. Longitude:	-78.87059		
Coord Sys:	NAD83		
State:	NY		
County:	Erie County		
Altitude:	583.5		
Hydrologic code:	04120103		
Topographic:	Not Reported		
Site Type:	Ground-water other than Spring		
Const Date:	19810203	Inven Date:	Not Reported
Well Type:	Single well, other than collector or Rainey type		
Primary Aquifer:	Not Reported		
Aquifer type:	Not Reported	Well depth:	45.0
Hole depth:	60.8	Source:	D
Project no:	Not Reported		

# GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS RADON

## AREA RADON INFORMATION

State Database: New York Radon Basement Screening Results for 14207:

Number of sites tested: 57

Average (pCi/L)	Geometric Mean (pCi/L)	Geometric Std Dev.	Maximum (pCi/L)	% Homes >4 pCi/L	% Homes >20 pCi/L
0.6	0.4	2.4	3.1	0.0	0.0

State Database: New York Radon Basement Screening Results for BUFFALO:

Number of sites tested: 662

Average (pCi/L)	Geometric Mean (pCi/L)	Geometric Std Dev.	Maximum (pCi/L)	% Homes >4 pCi/L	% Homes >20 pCi/L
1.1	0.7	2.7	20.2	4.7	0.2

Federal EPA Radon Zone for ERIE County: 1

Note: Zone 1 indoor average level > 4 pCi/L.  
 : Zone 2 indoor average level >= 2 pCi/L and <= 4 pCi/L.  
 : Zone 3 indoor average level < 2 pCi/L.

Federal Area Radon Information for ERIE COUNTY, NY

Number of sites tested: 622

Area	Average Activity	% <4 pCi/L	% 4-20 pCi/L	% >20 pCi/L
Living Area	1.000 pCi/L	89%	11%	0%
Basement	1.150 pCi/L	87%	11%	2%

## PHYSICAL SETTING SOURCE RECORDS SEARCHED

### HYDROLOGIC INFORMATION

**Flood Zone Data:** This data, available in select counties across the country, was obtained by EDR in 1999 from the Federal Emergency Management Agency (FEMA). Data depicts 100-year and 500-year flood zones as defined by FEMA.

**NWI:** National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 2002 from the U.S. Fish and Wildlife Service.

### HYDROGEOLOGIC INFORMATION

#### **AQUIFLOW<sup>R</sup> Information System**

Source: EDR proprietary database of groundwater flow information

EDR has developed the AQUIFLOW Information System (AIS) to provide data on the general direction of groundwater flow at specific points. EDR has reviewed reports submitted to regulatory authorities at select sites and has extracted the date of the report, hydrogeologically determined groundwater flow direction and depth to water table information.

### GEOLOGIC INFORMATION

#### **Geologic Age and Rock Stratigraphic Unit**

Source: P.G. Schruben, R.E. Arndt and W.J. Bawiec, Geology of the Conterminous U.S. at 1:2,500,000 Scale - A digital representation of the 1974 P.B. King and H.M. Beikman Map, USGS Digital Data Series DDS - 11 (1994).

#### **STATSGO: State Soil Geographic Database**

The U.S. Department of Agriculture's (USDA) Soil Conservation Service (SCS) leads the national Cooperative Soil Survey (NCSS) and is responsible for collecting, storing, maintaining and distributing soil survey information for privately owned lands in the United States. A soil map in a soil survey is a representation of soil patterns in a landscape. Soil maps for STATSGO are compiled by generalizing more detailed (SSURGO) soil survey maps.

### ADDITIONAL ENVIRONMENTAL RECORD SOURCES

#### **FEDERAL WATER WELLS**

##### **PWS: Public Water Systems**

Source: EPA/Office of Drinking Water

Telephone: 202-564-3750

Public Water System data from the Federal Reporting Data System. A PWS is any water system which provides water to at least 25 people for at least 60 days annually. PWSs provide water from wells, rivers and other sources.

##### **PWS ENF: Public Water Systems Violation and Enforcement Data**

Source: EPA/Office of Drinking Water

Telephone: 202-564-3750

Violation and Enforcement data for Public Water Systems from the Safe Drinking Water Information System (SDWIS) after August 1995. Prior to August 1995, the data came from the Federal Reporting Data System (FRDS).

**USGS Water Wells:** In November 1971 the United States Geological Survey (USGS) implemented a national water resource information tracking system. This database contains descriptive information on sites where the USGS collects or has collected data on surface water and/or groundwater. The groundwater data includes information on more than 900,000 wells, springs, and other sources of groundwater.

## PHYSICAL SETTING SOURCE RECORDS SEARCHED

### STATE RECORDS

#### New York Public Water Wells

Source: New York Department of Health  
Telephone: 518-458-6731

#### New York Facility and Manifest Data

Source: NYSDEC  
Telephone: 518-457-6585  
Facility and manifest data. Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a tsd facility.

### RADON

#### New York Radon Basement Screening Results

Source: New York Department of Health  
Telephone: 518-402-7556

#### Area Radon Information

Source: USGS  
Telephone: 703-356-4020  
The National Radon Database has been developed by the U.S. Environmental Protection Agency (USEPA) and is a compilation of the EPA/State Residential Radon Survey and the National Residential Radon Survey. The study covers the years 1986 - 1992. Where necessary data has been supplemented by information collected at private sources such as universities and research institutions.

#### EPA Radon Zones

Source: EPA  
Telephone: 703-356-4020  
Sections 307 & 309 of IRAA directed EPA to list and identify areas of U.S. with the potential for elevated indoor radon levels.

### OTHER

#### Epicenters: World earthquake epicenters, Richter 5 or greater

Source: Department of Commerce, National Oceanic and Atmospheric Administration